



Operator's Manual

HDO9000 High Definition Oscilloscopes



HDO9000 High Definition Oscilloscopes Operator's Manual

© 2016 Teledyne LeCroy, Inc. All rights reserved.

Unauthorized duplication of Teledyne LeCroy, Inc. documentation materials other than for internal sales and distribution purposes is strictly prohibited. However, clients are encouraged to duplicate and distribute Teledyne LeCroy, Inc. documentation for their own internal educational purposes.

HDO and Teledyne LeCroy, Inc. are trademarks of Teledyne LeCroy, Inc., Inc. Other product or brand names are trademarks or requested trademarks of their respective holders. Information in this publication supersedes all earlier versions. Specifications are subject to change without notice.

927439 RevA September 2016

Contents

Symbols1Precautions1Operating Environment2Cooling2Calibration2Cleaning2Power3AC Power3Power Consumption3Ground3Oscilloscope Overview4Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7Horizontal Controls8
Operating Environment2Cooling2Calibration2Cleaning2Power3AC Power3Power Consumption3Ground3Oscilloscope Overview4Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Cooling 2 Calibration 2 Cleaning 2 Power 3 AC Power 3 Power Consumption 3 Ground 3 Oscilloscope Overview 4 Front of Oscilloscope 4 Side of Oscilloscope 5 Back of Oscilloscope 6 Front Panel 7 Top Row Controls 7 Trigger Controls 7
Calibration2Cleaning2Power3AC Power3Power Consumption3Ground3Oscilloscope Overview4Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Cleaning2Power3AC Power3Power Consumption3Ground3Oscilloscope Overview4Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Power 3 AC Power 3 Power Consumption 3 Ground 3 Oscilloscope Overview 4 Front of Oscilloscope 4 Side of Oscilloscope 5 Back of Oscilloscope 6 Front Panel 7 Top Row Controls 7 Trigger Controls 7
AC Power3Power Consumption3Ground3Oscilloscope Overview4Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Power Consumption3Ground3Oscilloscope Overview4Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Ground 3 Oscilloscope Overview 4 Front of Oscilloscope 4 Side of Oscilloscope 5 Back of Oscilloscope 6 Front Panel 7 Top Row Controls 7 Trigger Controls 7
Oscilloscope Overview4Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Front of Oscilloscope4Side of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Side of Oscilloscope5Back of Oscilloscope6Front Panel7Top Row Controls7Trigger Controls7
Back of Oscilloscope 6 Front Panel 7 Top Row Controls 7 Trigger Controls 7
Front Panel 7 Top Row Controls 7 Trigger Controls 7
Top Row Controls7Trigger Controls7
Trigger Controls
Horizontal Controls
Vertical Controls
Math, Zoom, and Mem Buttons
Cursor Controls 8
Adjust & Intensity9
Bottom Row Controls
Signal Interfaces
Analog Inputs
Probes
LBUS Interface
Digital Leadset
Oscilloscope Set Up
Powering On/Off
Software Activation
Firmware12
Purchased Options12
Connecting to Other Devices/Systems13
LAN

USB Peripherals	
Printer	
External Monitor	
Remote Control	
Auxilliary Output	
Language Selection	14
Using MAUI	
Touch Screen	
Menu Bar	
Grid Area	
Descriptor Boxes	
Dialogs	
OneTouch Help	
Turn On	
Activate	
Copy Setups	
Change Source	
Position Cursors	
Change Trigger	23
Store to Memory	24
Move Trace	
Scroll	
Pan Trace	
Zoom	
Turn Off	
Working With Traces	
Active Trace	
Foreground Trace	
Turning On/Off Traces	
Adjusting Traces	
Moving Traces	
Labeling Traces	
Zooming Traces	
Print/Screen Capture	
X-Stream Application Window	
Acquisition	
Auto Setup	

Restore Default Setup Viewing Status Vertical Channel Setup Dialog Cx (Channel) Dialog Probe Dialog Cable De-Embedding Option Digital (Mixed Signal)	 37 38 39 41 42 43 43 43 44 45
Vertical Channel Setup Dialog Cx (Channel) Dialog Probe Dialog Cable De-Embedding Option	38 39 41 42 43 43 43 43 44 45
Channel Setup Dialog Cx (Channel) Dialog Probe Dialog Cable De-Embedding Option	38 39 41 42 43 43 43 44 45
Cx (Channel) Dialog Probe Dialog Cable De-Embedding Option	39 41 42 43 43 43 43 44 45
Cable De-Embedding Option	42 43 43 43 44 45
	.43 .43 .43 .44 .45
Digital (Mixed Signal)	43 43 44 45
	43 44 45
Digital Traces	.44 45
Activity Indicators	45
Digitalx (Group) Set Up	
Digital Display Set Up	
Renaming Digital Lines	46
Timebase	.47
Timebase Set Up	47
HD1024	.49
Sampling Mode	.51
Clock Source Settings	55
History Mode	.56
Trigger	.58
Trigger Modes	58
Trigger Types	59
Trigger Set Up	60
Trigger Holdoff	67
Software Assisted Trigger	.70
TriggerScan	71
isplay	73
Multi-Grid Display	
Q-Scape Multi-Tabbed Display	
Display Set Up	
Display Mode (Q-Scape only)	
Extended Display	
Grid Mode	
Grid Intensity	
Trace Intensity	
XY Plots	
Sequence Display Mode	

Persistence Display	
Apply Persistence	
Remove Persistence	
Math and Measure	
Cursors	
Cursor Types	
Apply and Position Cursors	
Standard Cursors Dialog	
Measure	
Measure Table	
Measure Dialog	
Parameter Set Up	
Math on Parameters	
Using Web Editor	
Graphing Measurements	
List of Standard Measurements	
EMC Pulse Parameter Software Package	
Calculating Measurements	
Math	
Math Function Set Up	
Math Dialog	
Average Function	
Copy Function	
ERes Function	
Fast Wave Port Function	
FFT Function	
Interpolate Function	
Sparse Function	
Rescale Function and Assigning Units	
List of Standard Operators	
Memory	
Saving Memories	
Restoring Memories	
Analysis Tools	
WaveScan	
Scan Modes	
Scan Views	

Setting Up WaveScan	
Scan Overlay	
Scan Histogram	
WaveScan Search	
Pass/Fail Testing	
Mask Test Qualifiers	
Param(eter) Compare Qualifiers	
Define Pass/Fail Tests	
Saving Data (File Functions)	
LabNotebook	
Create Notebook Entry	
LabNotebook Drawing Toolbar	
Manage Notebook Entries	
Flashback Recall	
Manage Notebooks	
Customize Reports	
LabNotebook Preferences	
Save / Recall	
Save Setups	
Recall Setups	
Save Waveforms	
Recall Waveforms	
Save Table Data	
Auto Save	
Utilities	149
Utilities	
Status	
Remote Control	
Hardcopy (Print)	
Auxiliary Output	
Date/Time	
Options	
Disk Utilities	
Preferences	
Acquisition Preferences	
Calibration	
E-Mail	

Color	
Miscellaneous	163
Maintenance	
Touch Screen Calibration	
Restart/Reboot Instrument	164
Firmware Update	
Technical Support	166
Phone	
Web	166
Service Centers	
Returning a Product for Service	167
Certifications	
EMC Compliance	
EC Declaration of Conformity- EMC	168
Australia & New Zealand Declaration of Conformity- EMC	169
Safety Compliance	
EC Declaration of Conformity– Low Voltage	
U.S. Nationally Recognized Agency Certification	169
Canadian Certification	
Environmental Compliance	
End-of-Life Handling	
Restriction of Hazardous Substances (RoHS)	
ISO Certification	
Warranty	
Intellectual Property	
Windows License Agreement	171
Index	172

Welcome

Thank you for purchasing a Teledyne LeCroy High Definition Oscilloscope. We're certain you'll be pleased with the detailed features unique to our instruments.

The manual is arranged in the following manner:

- Safety contains important precautions and information relating to power and cooling.
- Oscilloscope Overview through Maintenance cover everything you need to know about the operation and care of the instrument.

Documentation for using software options is available from the Teledyne LeCroy website at teledynelecroy.com. Our website maintains the most current product specifications and should be checked for frequent updates.

Take a moment to verify that all items on the packing list or invoice copy have been shipped to you. Contact your nearest Teledyne LeCroy customer service center or national distributor if anything is missing or damaged. We can only be responsible for replacement if you contact us immediately.

We truly hope you enjoy using Teledyne LeCroy's fine products.

Sincerely,

David C Mray

David C. Graef *Vice President and General Manager, Oscilloscopes* Teledyne LeCroy

Safety

To maintain the instrument in a correct and safe condition, observe generally accepted safety procedures in addition to the precautions specified in this section. **The overall safety of any system incorporating this product is the responsibility of the assembler of the system.**

Symbols

These symbols appear on the instrument or in documentation to alert you to important safety considerations:

Caution of potential damage to instrument or **Warning** of potential bodily injury. Refer to the accompanying information. Do not proceed until the information is fully understood and conditions are met.

🗥 Caution, high voltage; risk of electric shock or burn.

Caution, contains parts/assemblies susceptible to damage by Electrostatic Discharge (ESD).

Frame or chassis terminal (ground connection).

Alternating current.

 \bigcirc Standby power (front of instrument).

Precautions



Caution: Comply with the following instructions to avoid personal injury or damage to your equipment.

Use indoors only within the operational environment listed. Do not use in wet or explosive atmospheres.

Maintain ground. This product is grounded through the power cord grounding conductor. To avoid electric shock, connect only to a grounded mating outlet.

Connect and disconnect properly. Do not connect/disconnect probes, test leads, or cables while they are connected to a live voltage source.

Observe all terminal ratings. Do not apply a voltage to any input that exceeds the maximum rating of that input. Refer to the front of the instrument for maximum input ratings.

Use only power cord shipped with this instrument and certified for the country of use.

Keep product surfaces clean and dry. See Cleaning.

Do not remove the covers or inside parts. Refer all maintenance to qualified service personnel.

Execise care when lifting. Use the built-in carrying handle.

Do not operate with suspected failures. Do not use the product if any part is damaged. Obviously incorrect measurement behaviors (such as failure to calibrate) might indicate impairment due to hazardous live electrical quantities. Cease operation immediately and sequester the instrument from inadvertent use.

Operating Environment

Temperature: 5 to 40° C.

Humidity: Maximum relative humidity 90 % for temperatures up to 31° C, decreasing linearly to 50% relative humidity at 40° C.

Altitude: Up to 3,000 m at or below 30° C.

Cooling

The instrument relies on forced air cooling with internal fans and vents. Take care to avoid restricting the airflow to any part. In a benchtop configuration, leave a minimum of 15 cm (6 inches) around the sides between the instrument and the nearest object. The feet provide adequate bottom clearance. Follow rackmount instructions for proper rack spacing.



Caution: Do not block the cooling vents.

The instrument also has internal fan control circuitry that regulates the fan speed based on the ambient temperature. This is performed automatically after start-up.

Calibration

The oscilloscope is calibrated at the factory prior to being shipped. The recommended calibration interval is one year. Calibration should be performed by qualified personnel only.

Schedule an annual factory calibration as part of your regular maintenance. Extended warranty, calibration, and upgrade plans are available for purchase. Contact your Teledyne LeCroy sales representative or **customersupport@teledynelecroy.com** to purchase a service plan.

The oscilloscope software includes both automatic and user-initiated calibration functions. See Calibration Preferences.



Caution: Remove all inputs prior to performing calibration.

Cleaning

Clean only the exterior of the instrument using a soft cloth moistened with water or an isopropyl alcohol solution. Do not use harsh chemicals or abrasive elements. Under no circumstances submerge the instrument or allow moisture to penetrate it. Dry the instrument thoroughly before connecting a live voltage source.



Caution: Unplug the power cord from the AC inlet before cleaning to avoid electric shock. Do not attempt to clean internal parts. Refer all maintenance to qualified service personnel.

Power

AC Power

The instrument operates from a single-phase, 100-240 Vrms (\pm 10%) AC power source at 50/60 Hz (\pm 5%) or a 100-120 Vrms (\pm 10%) AC power source at 400 Hz (\pm 5%). Manual voltage selection is not required because the instrument automatically adapts to the line voltage.

Power Consumption

Maximum power consumption with all accessories installed (e.g., active probes, USB peripherals, digital leadset) is 500 W (500 VA). Power consumption in Standby mode is 15 W.

Ground

The AC inlet ground is connected directly to the frame of the instrument. For adequate protection again electric shock, connect to a mating outlet with a safety ground contact.



Caution: Only use the power cord provided with your instrument. Interrupting the protective conductor (inside or outside the case), or disconnecting the safety ground terminal, creates a hazardous situation. Intentional interruption is prohibited.

Oscilloscope Overview

Front of Oscilloscope



- A. Capacitive touch screen display
- B. Front panel
- C. Power button
- D. Channel inputs (C1-C4)
- E. Ext input
- F. USB 2.0 port

- G. Aux output
- H. Mixed-Signal interface
- I. LBUS input
- J. Ground and Calibration output terminals
- K. Tilting feet

Side of Oscilloscope



- A. USB 2.0 ports (2)
- B. Ethernet port for connecting to LAN or remote control
- C. DisplayPort ports (2) for connecting external monitor
- D. USB 3.1 ports (4)
- E. DVI port for external monitor
- F. Audio In/Out (mic, speaker, and line-in) for connecting external audio devices
- G. USBTMC port for remote control

Back of Oscilloscope



- A. Built-in carrying handle
- B. Ref Out and Ref In for external reference clock
- C. AC power inlet
- D. Kensington lock

Front Panel



Most front panel controls duplicate functionality also available through the touch screen display.

All the knobs on the front panel function one way if turned and another if pushed like a button. The first label describes the knob's principal "turn" action, and the second label describes its "push" action.

Front panel buttons light up to indicate which traces and functions are active. Actions performed from the front panel always apply to the active trace.

Top Row Controls

Auto Setup performs an <u>Auto Setup</u>. After the first press, you will be prompted for a confirmation. Press the button again or use the touch screen to confirm.

Default Setup resets the oscilloscope to the factory default configuration. After the first press, you will be prompted for a confirmation. Press the button again or use the touch screen to confirm.

Clear Sweeps resets the acquisition counter and any cumulative measurements.

Touch Screen toggles on/off touch screen functionality.

Print captures the entire screen and outputs it according to your <u>Hardcopy settings</u>.

HD turns on/off HD1024 technology.

Trigger Controls

The front panel **Level knob** changes the trigger threshold level (V). The number is shown on the Trigger descriptor box. Pushing the knob sets the trigger level to the 50% point of the input signal.

Setup opens the Trigger setup dialog. Press it again to close the dialog.

The **READY** indicator is lit when the trigger is armed and ready. **TRIG'D** is lit momentarily when a trigger occurs.

Auto sets Auto mode, which triggers the oscilloscope after a set time, even if the trigger conditions are not met.

Normal sets Normal mode, which triggers the oscilloscope each time a signal is present that meets the trigger conditions.

Single sets Single trigger mode. The first press readies the oscilloscope to trigger. The second press arms and triggers the oscilloscope once (single-shot acquisition) when the input signal meets the trigger conditions.

Stop prevents the scope from triggering on a signal. If you boot up the instrument with the trigger in **Stop** mode, a "No trace available" message is shown. Press the Auto button to display a trace.

Horizontal Controls

Turn the **Delay knob** to change the Trigger Delay value (S). Push the knob to reset Delay to zero.

If the trace source is an input channel, turn the **Horizontal Adjust knob** to set the Time/division (S) of the oscilloscope acquisition system. The value is shown on the Timebase descriptor box. When using this control, the oscilloscope allocates memory as needed to maintain the highest sample rate possible for the timebase setting. If the trace source is a zoom, memory or math function, turn the knob to change the horizontal scale of the trace, effectively "zooming" in or out. The value is shown on the corresponding descriptor box. Push the knob to change the setting in fine increments; push it again to return to 1, 2, 5, 10-step increments.

Vertical Controls

The front panel **Channel buttons** (1-4) turn on a channel that is off, or activate a channel that is already on. When the channel is active, pushing its channel button turns it off. A lit button shows the active channel (in this image, C1 is lit).

Offset knob adjusts the zero level of the trace (this makes it appear to move up or down relative to the center axis of the grid). The value appears on the trace descriptor box. Push it to reset Offset to zero.

Gain knob sets Vertical Gain (V/div). The value appears on the trace descriptor box. Push it once to adjust V/div in fine increments; push it again to adjust in 1, 2, 5, 10-step increments.

Dig button enables digital input on -MS models.

Math, Zoom, and Mem Buttons

The front panel **Zoom** button creates a quick zoom of each open channel trace. The resulting zoom traces are 1/10 of the channel timebase and centered on the display. Touch the zoom trace descriptor box to display the zoom controls and adjust this. Touch the Zoom button again to turn off the zooms.

The **Math** and **Mem**(ory) buttons open the corresponding setup dialogs.

Cursor Controls

Cursors identify specific voltage and time values on the waveform. The white cursor markers help make these points more visible, as well as provide a simple way to reposition them. A readout of the values appears on the trace descriptor box.

There are five preset cursor types, each with a unique appearance on the display. These are described in more detail in the <u>Cursors</u> section.

Press the front panel **Type** button to apply or remove cursors. Continue pressing to cycle through all cursor types until the desired type is found ("no cursors" will appear in the cycle).

Turn the **Cursor knob** to reposition the selected cursor line. Push it to select a different cursor line to adjust.

Adjust & Intensity

The front panel **Adjust knob** changes the value in active (highlighted) data entry fields that do not have dedicated knobs. Pushing Adjust toggles between coarse (large increment) or fine (small increment) adjustments when the knob is turned.

The **Intensity button** sets the Adjust knob to control the trace intensity. When more data is available than can actually be displayed, the Intensity button helps to visualize significant events by applying an algorithm that dims less frequently occurring samples. This feature can also be accessed from the <u>Display Setup</u> dialog.

Bottom Row Controls

Decode opens the Serial Decode dialog if you have serial data decoder options installed.

WaveScan opens the WaveScan dialog.

Spectrum opens the Spectrum Analyzer dialog if you have that option installed.

History opens the History Mode dialog.

Signal Interfaces

The instrument offers a variety of interfaces for using probes or other devices to input analog or digital signals.

See the product page at teledynelecroy.com for a list of compatible devices.

Analog Inputs

A series of connectors arranged on the front of the instrument are used to input analog signals on channels 1-4. EXT can be used to input an external trigger pulse or sample clock signal.

HDO9000 channel connectors use the ProBus interface. The ProBus interface contains a 6-pin power and communication connection and a BNC signal connection to the probe. It includes sense rings for detecting passive probes and accepts a BNC cable connected directly to it. ProBus offers 50 Ω and 1 M Ω input impedance and control for a wide range of probes.

The channel interfaces power probes and completely integrate the probe with the channel. Upon connection, the probe type is recognized and some setup information, such as input coupling and attenuation, is performed automatically. This information is displayed on the Probe Dialog, behind the Channel (C*x*) dialog. System (probe plus instrument) gain settings are automatically calculated and displayed based on the probe attenuation.

Probes

The oscilloscope is compatible with the included passive probes and most Teledyne LeCroy active probes that are rated for the instrument's bandwidth. Probe specifications and documentation are available at <u>teledynelecroy.com/probes</u>.

Passive Probes

The passive probes supplied are matched to the input impedance of the instrument but may need further compensation. Follow the directions in the probe instruction manual to compensate the frequency response of the probes.

Active Probes

Most active probes match probe to oscilloscope response automatically using probe response data stored in an on-board EEPROM. This ensures the best possible combined probe plus oscilloscope channel frequency response without the need to perform any de-embedding procedure.

Be aware that many active probes require a minimum oscilloscope firmware version to be fully operational. See the probe documentation.

LBUS Interface

The LBUS (LeCroy Peripheral Bus) interface provides precise timing synchronization between the oscilloscope and external devices. It can be used with the optional 8-CH-SYNC for synchronization with other instruments or the HDA125-xx-LBUS for high-speed digital analysis and triggering.

Digital Leadset



The digital leadset provided with -MS model oscilloscopes enables input of up-to-16 lines of digital data. Lines can be organized into four logical groups and renamed appropriately.

The digital leadset features two digital banks with separate Threshold controls, making it possible to simultaneously view data from different logic families.

Connecting/Disconnecting the Leadset

The digital leadset connects to the Mixed Signal interface on the front of the instrument.

To connect the leadset to the instrument, push the connector into the Mixed Signal interface below the front panel until you hear a click.

To remove the leadset, press and hold the buttons on each side of the connector, then pull out to release.

Grounding Leads

Each flying lead has a signal and a ground connection. A variety of ground extenders and flying ground leads are available for different probing needs.

To achieve optimal signal integrity, connect the ground at the tip of the flying lead for *each* input used in your measurements. Use either the provided ground extenders or ground flying leads to make the ground connection.

Oscilloscope Set Up

Powering On/Off

Press the **Power button** to turn on the instrument. The X-Stream application loads automatically when you use the Power button.



Caution: Do not change the instrument's Windows[®] Power Options setting from the default Never to System Standby or System Hibernate. Doing so can cause the system to fail.



Caution: Do not power on or calibrate with a signal attached.

Use the **File > Shutdown** menu bar option to switch "off". Pressing Power again will execute a shutdown, but we do not recommend doing this because it does not allow the Windows operating system to shut down properly, and memories and setup panels will not be saved. Never power off by pulling the power cord from the socket or shutting off a connected power strip.

The Power button does not disconnect the instrument from the AC power supply. The only way to fully power down the instrument is to unplug the AC power cord.

We recommend unplugging the instrument if it will remain unused for a long period of time.

Software Activation

The operating software (firmware and standard applications) is active upon delivery. At power-up, the instrument loads the software automatically.

Firmware

Free firmware updates are available periodically from the Teledyne LeCroy website at:

teledynelecroy.com/support/softwaredownload

Registered users can receive an email notification when a new update is released. Follow the instructions on the website to download and install the software.

Purchased Options

If you decide to purchase an option, you will receive a license key via email that activates the optional features. See <u>Options</u> for instructions on activating optional software packages.

Connecting to Other Devices/Systems

Make all desired cable connections. After start up, configure the connections using the menu options listed below. More detailed instructions are provided later in this manual.

LAN

The instrument accepts DHCP network addressing. Connect a cable from the Ethernet port on the side panel to a network access device.

To assign a static IP address, go to Utilities > Utilities Setup > Remote and choose Net Connections from the Remote dialog. Use the standard Windows networking dialogs to configure the device address.

Go to Utilities > Preference Setup > Email to configure email settings.

USB Peripherals

Connect the device to a USB port on the front or side of the instrument.

Printer

The HDO9000 supports USB printers compatible with the instrument's Windows OS. Go to Utilities > Utilities Setup > Hardcopy to configure printer settings.

External Monitor

You may operate the instrument using the built-in touch screen or attach an external monitor for extended desktop operation. A properly configured external touch-screen monitor will take on all the touch-screen capabilities of the internal display.



Note: The oscilloscope display utilizes Fujitsu touch-screen drivers. Because of conflicts, external monitors with Fujitsu drivers can not be used to control the system, only as displays.

The HDO9000 supports WQXGA monitors with 2560x1600 resolution.

Connect the monitor cable to the DisplayPort connector on the side of the instrument (you can use an adaptor if the monitor cable has a different interface). Monitors with DVI-D interfaces are also supported. Minimize the X-Stream application and use the Windows controls to configure the display. Configure the instrument as the primary monitor and be sure to extend, not duplicate, the display.

Remote Control

Go to Utilities > Preference Setup > Remote to <u>configure remote control</u>. Connect the devices using the cable type required by your selection. TCP/IP over Ethernet is generally supported, as is USB over the USBTMC connection. GPIB is also supported with the correct hardware option installed.

Auxilliary Output

To output signal from the instrument to another device, connect a BNC cable from Aux Out to the other device. Go to Utilities > Utilities Setup > Aux Output to <u>configure the output</u>.

 
Language Selection

To change the language that appears on the touch screen:

- 1. Go to **Utilities > Preference Setup > Preferences** and make a **Language** selection.
- 2. Follow the prompt to restart the application.

To also change the language of the Windows operating system dialogs:

- 1. Choose File > Minimize to hide X-Stream and show the Windows Desktop.
- 2. From the Windows task bar, choose Start > Control Panel > Clock, Language and Region.
- 3. Under Region and Language select Change Display Language.
- 4. Touch the Install/Uninstall Languages button.
- 5. Select Install Language and Browse Computer or Network.
- 6. Touch the **Browse** button, navigate to D:\Lang Packs\ and select the language you want to install. The available languages are: German, Spanish, French, Italian, and Japanese. Follow the installer prompts.
- 7. <u>Reboot</u> after changing the language.



Using MAUI

MAUI, the Most Advanced User Interface, is Teledyne LeCroy's unique oscilloscope user interface. MAUI is designed for touch—all important controls for vertical, horizontal, and trigger are only one touch away.

Touch Screen

The touch screen is the principal viewing and control center. The entire display area is active: use your finger or a stylus to touch, drag, swipe, or draw a selection box.

Many controls that display information also work as "buttons" to access other functions. If you have a mouse installed, you can click anywhere you can touch to activate a control; in fact, you can alternate between clicking and touching, whichever is convenient for you.

The touch screen is divided into the following major control groups:

- <u>Menu bar</u>
- Grid area
- Descriptor boxes
- Dialogs



Menu Bar

The top of the window contains a complete menu of functions. Making a selection here changes the dialogs displayed at the bottom of the screen.

While many common operations can also be performed from the front panel or launched via the descriptor boxes, the menu bar is the best way to access dialogs for Save/Recall (File) functions, Display functions, Status, LabNotebook, Pass/Fail setup, and Utilities/Preferences setup.

You will see a **Q-Scape** control added to the menu bar when the Q-Scape option is installed. This allows you to choose different tabbed display configurations. See <u>Display</u>.


If an action can be "undone", a small **Undo** button appears at the far right of the menu bar. Click this to return to the previous display.

Grid Area

The grid area displays the waveform traces. Every grid is 8 Vertical divisions representing the full number of Vertical levels possible at the current resolution and 10 Horizontal divisions. The value represented by Vertical and Horizontal divisions depends on the Vertical and Horizontal scale of the traces that appear on the grid.

Multi-Grid Display

The grid area can be divided into multiple grids showing different types and numbers of traces (by default, it will divide automatically as needed up to 16 times). Regardless of the number and orientation of grids, every grid always represents the same number of Vertical levels. Therefore, absolute Vertical measurement precision is maintained.

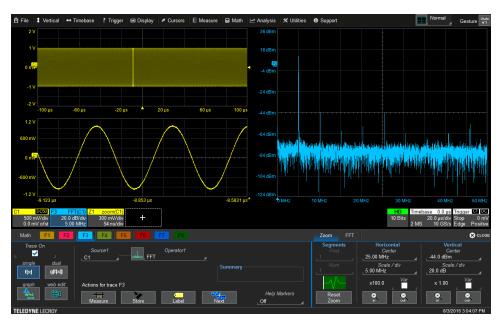

Different types of traces opening in a multi-grid display.

Q-Scape Tabs

On instruments with the Q-Scape option installed, Tabs 1-4 appear along the top of the grid area. Each tab is a distinct multi-grid display. See <u>Display</u> for more information about using Q-Scape.

Grid Indicators

These indicators appear around or on the grid to mark important points on the display. They are matched to the color of the trace to which they apply. When multiple traces appear on the same grid, indicators refer to the *foreground* trace—the one that appears on top of the others.

50 ns	Axis labels mark the times/units represented by a grid division. They update dynamically as you pan the trace or change the Vertical/Horizontal scale. Originally shown in absolute values, the labels change to show delta from 0 (center) when the number of significant digits grows too large. The number of labels that appear on each grid depends on the total number of grids open. To remove them, go to Display > Display Setup and deselect Axis Labels.
	Trigger Time , a small triangle along the bottom (horizontal) edge of the grid, shows the time of the trigger. Unless Horizontal Delay is set, this indicator is at the zero (center) point of the grid. Delay time is shown at the top right of the Timebase descriptor box.
→	Pre/Post-trigger Delay , a small arrow to the bottom left or right of the grid, indicates that a pre- or post-trigger Delay has shifted the Trigger Position indicator to a point in time not displayed on the grid. All Delay values are shown on the Timebase Descriptor Box.
	Trigger Level at the right edge of the grid tracks the trigger voltage level. If you change the trigger level when in Stop trigger mode, or in Normal or Single mode without a valid trigger, a hollow triangle of the same color appears at the new trigger level. The trigger level indicator is not shown if the triggering channel is not displayed.
<mark>.<u>C1</u></mark>	Zero Volts Level is located at the left edge of the grid. One appears for each open trace on the grid, sharing the number and color of the trace.
N. A. A.	Cursor markers appear over the grid to indicate specific voltage and time values on the waveform. Drag-and- drop cursor markers to quickly reposition them.

Grid Intensity

You can adjust the brightness of the grid lines by going to **Display > Display Setup** and entering a new **Grid Intensity** percentage. The higher the number, the brighter and bolder the grid lines.

 
Descriptor Boxes

Trace descriptor boxes appear just beneath the grid whenever a trace is turned on. They function to:

- Inform-descriptors summarize the current trace settings and its activity status.
- **Navigate**—touch the descriptor box once to activate the trace, a second time to open the trace setup dialog.
- Arrange-drag-and-drop descriptor boxes to move traces among grids.
- **Configure**-drag-and-drop descriptor boxes to change source or copy setups.

Besides trace descriptor boxes, there are also HD, Timebase and Trigger descriptor boxes summarizing the acquisition settings shared by all channels, which also open the corresponding setup dialogs.

Channel Descriptor Box



Channel trace descriptor boxes correspond to analog signal inputs. They show (clockwise from top left): Channel Number, Pre-processing list, Coupling, Vertical Scale (gain) setting, Vertical Offset setting, Sweeps Count (when averaging), Vertical Cursor positions, and Number of Segments (when in Sequence mode).

Codes are used to indicate pre-processing that has been applied to the input. The short form is used when several processes are in effect.

Pre-Processing Type	Long Form	Short Form
Sin X Interpolation	SINX	S
Averaging	AVG	А
Inversion	INV	I
Deskew	DSQ	DQ
Coupling	DC50, DC1M, AC1M or GND	D50, D1, A1 or G
Bandwidth Limiting	BWL	В

Pre-processing Symbols on Descriptor Boxes

Other Trace Descriptor Boxes

Similar descriptor boxes appear for math (Fx), zoom (Zx), and memory (Mx) traces. These descriptor boxes show any Horizontal scaling that differs from the signal timebase. Units will be automatically adjusted for the type of trace.

Math	FFT(C1)	Z1	zoom(C1)	M1
	20.0 dB/div		200 mV/div	200 mV/div
	5.00 MHz		100 µs/div	1.00 ms/div
	1#		6.757 k#	4.922 k#

Trace Context Menu

Touch and hold ("right-click") on the trace descriptor box until a white circle appears to open the trace context menu, a pop-up menu of actions to apply to the trace such as turn off, move to next grid or label.

Setup
Off
Next Grid
Math
Measure
Set label

HD Descriptor Box

The HD descriptor box summarizes the total resolution at which the instrument is operating. When HD1024 is enabled, this may be 9 or 10 bits depending on the number of active channels and other timebase settings. Touch the HD descriptor to open the HD Summary dialog, which shows the current resolution, bandwidth, and other settings per channel. When HD1024 is disabled, the HD descriptor box is hidden.



Timebase and Trigger Descriptor Boxes

The Timebase descriptor box shows: (clockwise from top right) Horizontal Delay, Time/div, Sample Rate, Number of Samples, and Sampling Mode (blank when in real-time mode).


Trigger descriptor box shows: (clockwise from top right) Trigger Source and Coupling, Trigger Level (V), Slope, Trigger Type, Trigger Mode.

Time	base	0	ns	Trig	ger		DC
	50.0	ns/o	div	Auto)	0.0	mV
5 kS	1	0 GS	S/s	Edg	е	Pos	itive
X1=	-125.0) ns		ΔX=	2	250.0	ns
X2=	125.0) ns	1//	7X=	4.0	100 N	٨Hz

Horizontal (time) cursor readout, including the time between cursors and the frequency, is shown beneath the TimeBase and Trigger descriptor boxes. See the <u>Cursors</u> section for more information.

Dialogs

Dialogs appear at the bottom of the display for entering setup data. The top dialog will be the main entry point for the selected functionality. For convenience, related dialogs appear as a series of tabs behind the main dialog. Touch the tab to open the dialog.

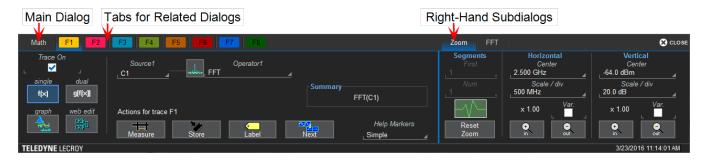

Right-Hand Subdialogs

At times, your selections will require more settings than can fit on one dialog, or the task commonly invites further action, such as zooming a new trace. In that case, subdialogs will appear to the right of the dialog. These subdialog settings always apply to the object that is being configured on the left-hand dialog.

Action Toolbar

Several setup dialogs contain a toolbar at the bottom of the dialog. These buttons enable you to perform commonplace tasks—such as turning on a measurement—without having to leave the underlying dialog. Toolbar actions always apply to the active trace.



Measure opens the Measure pop-up to set measurement parameters on the active trace.

Zoom creates a zoom trace of the active trace.

Math opens the Math pop-up to apply math functions to the active trace and create a new math trace.

Decode opens the main Serial Decode dialog where you configure and apply serial data decoders and triggers. This button is only active if you have serial data software options installed.

Store loads the active trace into the corresponding memory location (C1, F1 and Z1 to M1; C2, F2 and Z2 to M2, etc.).

Find Scale performs a vertical scaling that fits the waveform into the grid.

Next Grid moves the active trace to the next grid. If you have only one grid displayed, a new grid will be created automatically, and the trace moved.

Label opens the Label pop-up to annotate the active trace.

Histogram, **Trend**, and **Track** buttons appear at the bottom of the **Parameter** (P*x*) dialogs. They allow you to create a Math function to plot the parameter while remaining on the measurement dialogs.



OneTouch Help

Touch, drag, swipe, pinch, and flick can be used to create and change setups with one touch. Just as you change the display by using the setup dialogs, you can change the setups by moving different display objects. Use the setup dialogs to refine OneTouch actions to precise values.

As you drag & drop objects, valid targets are outlined with a white box. When you're moving over invalid targets, you'll see the "Null" symbol (\emptyset) under your finger tip or cursor.


Turn On

To **turn on a new channel, math, memory, or zoom trace**, drag any descriptor box of the same type to the Add New ("+") box. The next trace in the series will be added to the display at the default settings. It is now the active trace.




If there is no descriptor box of the desired type on the screen to drag, touch the Add New box and choose the trace type from the pop-up menu.

To turn on the Measure table when it is closed, touch the Add New box and choose Measurement.

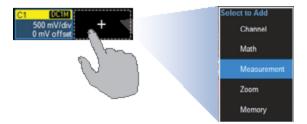

Activate

 Touch a trace or its descriptor box to *activate* it and bring it to the *foreground*. When the descriptor box appears highlighted in blue, front panel controls and touch screen gestures apply to that trace.




Copy Setups

To **copy the setup of one trace** to another of the same type (e.g., channel to channel, math to math), drag-and-drop the source descriptor box onto the target descriptor box.



 To **copy the setup of a measurement** (P*x*), drag-and-drop the source column onto the target column of the Measure table. You can do the same for a qualifier (Q*x*) on the Pass/Fail readout table.



Change Source

To **change the source of a trace**, drag-and-drop the descriptor box of the desired source onto the target descriptor box. You can also drop it on the Source field of the target setup dialog.

 


To **change the source of a measurement**, drag-and-drop the descriptor box of the desired source onto the parameter (P*x*) column of the Measure table. You can do the same to a qualifier (Q*x*) on the Pass/Fail readout table.




Position Cursors

To **change cursor measurement time/level**, drag cursor markers to new positions on the grid. The cursor readout will update immediately.




To **place horizontal cursors** on zooms or other calculated traces where the source Horizontal Scale has forced cursors off the grid, drag the cursor readout from below the Timebase descriptor to the grid where you wish to place the cursors. The cursors are set at either the 5 (center) or 2.5 and 7.5 divisions of the grid. Cursors on the source traces adjust position accordingly.

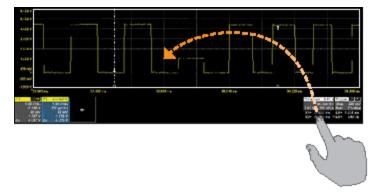


Change Trigger

To **change the trigger level**, drag the Trigger Level indicator to a new position on the Y axis. The Trigger descriptor box will show the new voltage Level.

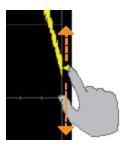


 To **change the trigger source channel**, drag-and-drop the desired channel (C*x*) descriptor box onto the Trigger descriptor box. The trigger will revert to the last trigger set on that channel.




Store to Memory

 To **store a trace to internal memory**, drag-and-drop its trace descriptor box onto the target memory (Mx) descriptor box.



Move Trace

To **move a trace to a different grid**, drag-and-drop the trace descriptor box onto the target grid. If you are in a multi-tabbed Q-Scape display mode, you can move traces between tabs this way.

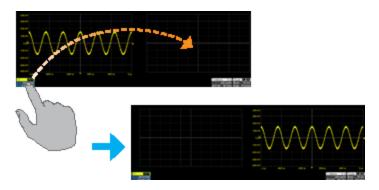


Scroll

To **scroll long lists of values** or readout tables, swipe the selection dialog or table in an up or down direction.



Pan Trace

To **pan a trace**, activate it to bring it to the forefront, then drag the waveform trace right/left or up/down. If it is the source of any other trace, that trace will move, as well. For channel traces, the Timebase descriptor box will show the new Horizontal Delay value. For other traces, the zoom factor controls show the new Horizontal Center.

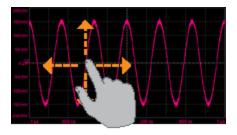


Tip: If you are using the <u>multi-zoom feature</u>, all time-locked traces will pan together.


To **pan at an accelerated rate**, swipe the trace right/left or up/down.

Zoom


To **create a new zoom trace**, touch then drag diagonally to draw a selection box around the portion of the trace you want to zoom. Touch the Zx descriptor box to open the zoom factor controls and adjust the zoom exactly.

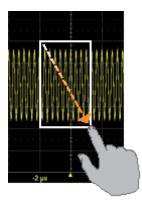

 To "zoom in" on any trace, unpinch two fingers over the trace horizontally.



 
To "zoom out" on any trace, pinch two fingers over the trace horizontally.



Note: Pinch gestures do not create a separate zoom (Zx) trace, they only adjust the Horizontal Scale. When you pinch a channel (Cx) trace, the Timebase for all channels changes. If the trace is the source of any other, all its dependent traces change as well.

Turn Off

To turn off a trace, flick the trace descriptor box toward the bottom of the screen.

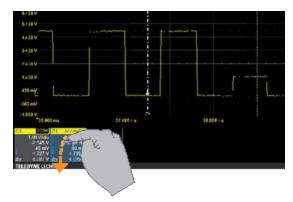

To **turn off a measure parameter** or Pass/Fail qualifier, flick the Px or Qx cell toward the bottom of the screen. If it's the last active cell of the table, the table will close.

Measure	P1:ampl(C1)	P2:ampl(C1)
value	280.0 mV	280.0 mV
mean	280.0 mV	
min	280.0 mV	
max	280.0 mV	80.0 m
sdev		
sdev num	1	
status		1

Working With Traces

Traces are the visible representations of waveforms that appear on the display grid. They may show live inputs (Cx, Digitalx), a math function applied to a waveform (Fx), a stored memory of a waveform (Mx), a zoom of a waveform (Zx), or the processing results of special analysis software.

Traces are a touch screen object like any other and can be manipulated. They can be panned, moved, labeled, zoomed, and captured in different visual formats for printing/reporting.

Each visible trace will have a <u>descriptor box</u> summarizing its principal configuration settings. See <u>OneTouch Help</u> for more information about how you can use traces and trace descriptor boxes to modify your configurations.

Active Trace

Although several traces may be open, only one is *active* and can be adjusted using front panel controls and touch screen gestures. A highlighted descriptor box indicates which trace is active. All actions apply to that trace until you activate another. Touch a trace descriptor box to make it the active trace (and the foreground trace in that grid).

C1	DC1M	C1	DC1M
	200 mV/div		200 mV/div
	10.0 mV ofst	1	0.0 mV ofst

Active trace descriptor (left), inactive trace descriptor (right).

Whenever you activate a trace, the dialog at the bottom of the screen automatically switches to the appropriate setup dialog.



Active descriptor box matches active dialog tab.

Foreground Trace

Since multiple traces can be opened on the same grid, the trace shown on top of the others is the *foreground* trace. Grid indicators (matched to the input channel color) represent values for the foreground trace.

Touch a trace or its descriptor box to bring it to the foreground. This also makes it the active trace.

Note that a *foreground* trace may not be the same as the *active* trace. A trace in a separate grid may subsequently become the active trace, but the indicators on a given grid will still represent the foreground trace in that group.

Turning On/Off Traces

Traces

From the front panel, press the **Channel button** (1-4) to turn on the trace; press again to turn it off.

From the display, touch the **Add New box** and select **Channel**, or drag another Channel (C*x*) descriptor box to the Add New box.

To turn off a channel trace, do any of the following:

- Flick the descriptor box toward the bottom of the screen.
- Touch-and-hold (right-click) on the descriptor box until a white circle appears, then from the **context menu** select **Off**.
- Clear the channel checkbox on the Channel Setup or Cx dialogs.

Note: The default is to display each trace in its own grid. Use the Display menu to change how traces are displayed.

Digital Traces

From the front panel, press the **Dig button**, then check **Group** on the Digital<#> trace dialog.

From the menu bar, choose **Vertical > Digital <#> Setup**, then check **Group** on the Digital<**#>** trace dialog.

Clear the Group checkbox to turn off the trace, or flick the digital trace descriptor box toward the bottom of the screen.

Other Traces

From the front panel, touch the **Zoom** button to create quick zooms of all open traces. Press the button again to turn them off.

From the display, touch the **Add New box** and select the trace type, or drag another descriptor box of that type to the Add New box.

Adjusting Traces

To adjust Vertical Scale (gain or sensitivity) and Vertical Offset, just activate the trace and use the front panel Vertical knobs. To make other adjustments—such as pre-processing on channel traces or the function definition of math traces—touch the trace descriptor box twice to open the appropriate setup dialog.

Many entries can be made by selecting from the pop-up menu that appears when you touch a control. But when an entry field appears highlighted after touching, it is *active* and the value can be modified by turning the front panel knobs. Fields that don't have a dedicated knob (as do Vertical Level and Horizontal Delay) can be modified using the Adjust knob.

If you have a keyboard installed, you can type entries in an active (highlighted) data entry field. Or, you can touch again, then "type" the entry by touching keys on the virtual keypad or keyboard.


To use the virtual keypad, touch the soft keys exactly as you would a calculator. When you touch OK, the calculated value is entered in the field.

Moving Traces

Use any of these methods to move traces from grid to grid. See <u>OneTouch Help</u> for ways to pan traces within the same grid.

Drag-and-Drop

You can move a trace from one grid to another by dragging its descriptor box to the desired grid. This is a convenient way to quickly re-arrange traces on the display.

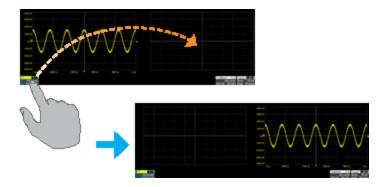

If you are in Q-Scape display mode, you can drag the descriptor box to a grid on another tab, provided the grid is visible while you are moving the trace. For example, you cannot drag descriptors across tabs in Q-Scape Single mode, because the target grids aren't visible, but you can in Q-Scape Dual or Q-Scape Mosaic modes. This is true even in extended display. For more information, see <u>Display</u>.

Next Grid Button

Touch twice on the descriptor box of the trace you want moved to open the setup dialog, then touch the **Next Grid** action toolbar button at the bottom of the dialog. You can also touch and hold (right-click) the trace descriptor box and choose Next Grid from the context menu.

Note: If only one grid is open, a second grid opens automatically when you select Next Grid.


Labeling Traces

The Label function gives you the ability to add custom annotations to the trace display. Once placed, labels can be moved to new positions or hidden while remaining associated with the trace.



Create Label

1. Select **Label** from the context menu, or touch the **Label** Action toolbar button on the trace setup dialog.

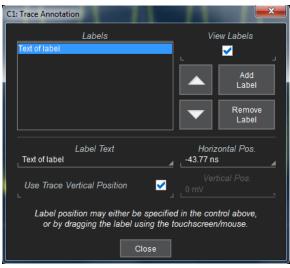

- 2. On the Trace Annotation pop-up, touch Add Label.
- 3. Enter the Label Text.
- 4. Optionally, enter the **Horizontal Pos.** and **Vertical Pos.** (in same units as the trace) at which to place the label. The default position is 0 ns horizontal. **Use Trace Vertical Position** places the label immediately above the trace.

Reposition Label

Drag-and-drop labels to reposition them, or change the position settings on the Trace Annotation popup.

Edit/Remove Label

On the Trace Annotation pop-up, select the **Label** from the list. Change the settings as desired, or touch **Remove Label** to delete it.

Clear View labels to hide all labels. They will remain in the list.

Zooming Traces

The Zoom function magnifies a selected region of a trace. Depending on your oscilloscope model, you can display up to eight zooms of any channel, math, or memory trace.

<u>Zooms may be created</u> in several ways, using either the front panel or the touch screen. You can adjust zooms the same as any other trace using the front panel Vertical and Horizontal knobs or the touch screen <u>zoom factor controls</u>.

The current settings for each zoom trace can be seen on the <u>Zx dialogs</u>, while the <u>Zoom dialog</u> is a convenient panel for turning on/off zooms or changing the zoom source.

The MultiZoom feature creates time-locked zoom traces for only the waveforms that you choose to include. The zooms are of the same X-axis section of each waveform. As you scroll through a waveform, all included zooms scroll in unison. For more information, refer to MultiZoom.

Zoom Dialog


Zoom controls appear throughout the X-Stream software wherever it is likely you may wish to change the display scale of a trace, sometimes as a main dialog, sometimes as a subdialog, such as when setting up:

- Math traces on **Fx dialogs**
- Memory traces on Mx dialogs

To display the zoom controls, choose **Math > Zoom Setup** from the menu bar, or touch a zoom descriptor box.


The main Zoom dialog contains selection boxes for turning on/off and changing the source of a zoom. There are also options to:

- Reset All, return all zooms to x1 magnification.
- Quick Zoom, create a corresponding zoom trace for each open channel trace, same as using the front panel Zoom button.
- <u>MultiZoom</u>

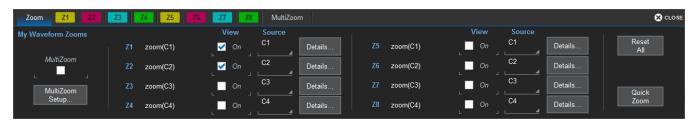

Zx Dialog

Behind the main Zoom dialog is a separate tab for each potential zoom trace (Z1-Zx). Each Zx dialog reflects the current scale settings for that zoom trace. Use it to adjust the zoom magnification.

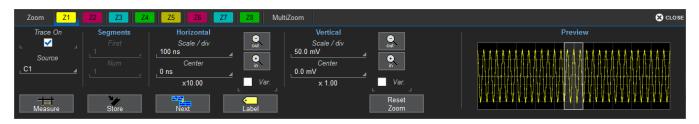

Trace Controls

Trace On shows/hides the zoom trace. It is selected by default when the zoom is created.

Source lets you change the source for this zoom to any channel, math, or memory trace while maintaining all other settings.

Segment Controls

These controls are used in Sequence Sampling Mode.

Zoom Factor Controls

- Out and In buttons increase/decrease zoom magnification and consequently change the Horizontal and Vertical Scale settings. Touch either button until you've achieved the desired level.
- Var.checkbox enables zooming in single increments.
- Horizontal Scale/div sets the time represented by each horizontal division of the grid. It is the equivalent of Time/div in channel traces, only unlike that setting, it may differ for each zoom trace.
- Vertical Scale/div sets the voltage level represented by each vertical division of the grid; it's the equivalent of V/div in channel traces.
- Horizontal/Vertical Center sets the time/voltage at the center of the grid. The horizontal center is the same for all zoom traces.
- **Reset Zoom** returns the zoom to x1 magnification.

Creating Zooms


Zooms magnify a selected region of another trace by altering the Horizontal Scale relative to the source trace. Any type of trace can be "zoomed" by creating a new zoom trace (Zx) following the procedures here.



Note: Alternatively, channel or math traces can be "zoomed" by pinching/unpinching two fingers over the trace. This method does not create a separate zoom trace. With channel

traces, pinching will alter the acquisition timebase and the scale of all traces. Create a separate zoom trace if you do not wish to do this.

All zoom traces open in the next empty grid, with the zoomed portion of the source trace highlighted. If there are no more available grids, zooms will open in the same grid as the source trace.

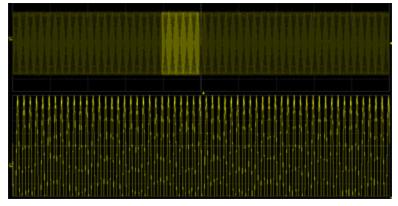

Zoomed area of original trace highlighted. Zoom in new grid below.


Quick Zoom

Use the **front panel Zoom button** to quickly create one zoom trace for each displayed channel trace. Quick zooms are created at the same vertical scale as the source trace and 10:1 horizontal magnification.

To turn off the quick zooms, press the Zoom button again.

Manually Create Zoom

To manually create a zoom, touch-and-drag diagonally to draw a selection box around any part of the source trace.

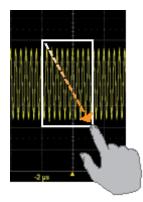

Selection box over trace.

The zoom will resize the selected area to fit the full width of the grid. The degree of vertical and horizontal magnification, therefore, depends on the size of the rectangle that you draw.

HDO9000 High Definition Oscilloscopes Operator's Manual

Alternatively, you can drag any Zx descriptor box over the **Add New box**, or touch the Add New box and choose Zoom from the pop-up menu. The next available zoom trace opens.

Finally, you can touch-and-hold (right-click) on the descriptor box of the trace you wish to zoom until a white circle appears, then choose Math from the context menu. Select the Zoom operator to create a zoom in the next open math function. This method creates a new Fx trace, rather than a new Zx trace, but it can be rescaled in the same manner.

Adjust Zoom Scale

The zoom's Horizontal units will differ from the signal timebase because the zoom is showing a calculated scale, not a measured level. This allows you to adjust the zoom factor using the front panel knobs or the <u>zoom factor controls</u> however you like without affecting the timebase (a characteristic shared with math and memory traces).

Close Zoom

New zooms are turned on and visible by default. If the display becomes too crowded, you can close a particular zoom and the zoom settings are saved in its Zx location, ready to be turned on again when desired.

To close the zoom, touch-and-hold (right-click) on the zoom descriptor box until the white circle appears, then from the context menu choose **Off**.

MultiZoom

MultiZoom creates time-locked zoom traces for only the waveforms that you choose to include. The zooms are of the same X-axis section of each waveform. As you scroll through a waveform, all included zooms scroll in unison.

Set Up MultiZoom

- 1. Choose Math > Zoom Setup... to open the Zoom dialog, then touch the MultiZoom tab or MultiZoom Setup... button.
- 2. On the MultiZoom dialog, check **On**.
- 3. Select all the traces that are **In** the MultiZoom group.

Zoom Z1 Z2 Z	Z3 Z4 Z5 Z6 Z7 Z8	MultiZoom	CLOSE
Multi-Zoom	, ✓ In Z1 = zoom(C1)		Auto-Scroll (Horizontal)
✓ On ∟ ⊥ Choose which traces are	✓ In Z2 = zoom(C2)		
zoomed together as a group.			Reset
Quick Zoom			Par Var Reset Zoom

Scroll Waveforms

The Auto-Scroll controls appear at the right of the MultiZoom dialog. They work similarly to A/V controls to allow you to continuously scroll all the selected zoom traces in time-locked steps from the beginning to the end of the acquisition.

Print/Screen Capture

The Print function captures an image of the display and outputs it according to your <u>Hardcopy</u> <u>settings</u>. It can be used to save a visual representation of waveform traces.

Print may be used as a screen capture tool by selecting to print to a graphical file format on the Hardcopy dialog. Once configured, there are three ways to take a capture of the screen:

- Press the front panel Print button.
- Choose File > Print.
- Go to Utilities > Utilities Setup > Hardcopy tab and touch the Print button to the far right of the dialog.



X-Stream Application Window

X-Stream, the oscilloscope application, functions much like other Windows applications.

To show the Windows desktop, choose **File > Minimize**. To restore the window, touch the touch screen icon in the lower right corner of the desktop.

To fully exit the application, choose **File > Exit**. The operating system will continue to run. To reload the application after exiting, touch the **Start DSO** desktop shortcut.

Acquisition

The acquisition settings include everything required to produce a visible trace on screen and an acquisition record that may be saved for later processing and analysis:

- <u>Vertical</u> axis scale at which to show the input signal and probe characteristics that affect the signal, such as attenuation and deskew time
- <u>Horizontal</u> axis scale at which to represent time, and acquisition sampling mode and sampling rate
- Acquisition trigger mechanism

Optional acquisition settings include bandwidth filters and pre-processing effects, vertical offset, and horizontal trigger delay, all of which affect the appearance and position of the waveform trace.

The overall length of the acquisition in time is determined by the Time/Division (timebase) setting, with acquisition time equal to 10 times the Time/Division setting. The formula for maximum sample rate is: *Sample Rate = Memory Samples/Acquisition Time*, with the maximum sample rate being limited by the instrument's analog-to-digital converter (ADC). The instrument allocates memory as needed to maintain the highest sample rate possible for the timebase.

To avoid aliasing and other waveform distortions, it is advisable (per Nyquist) to acquire at a sample rate at least twice the bandwidth of the input signal. It can be shown that a sample rate 10 times the acquisition bandwidth is preferable in order to over sample fast signal rise times consistent with the oscilloscope bandwidth.

Those with higher speed acquisition systems may need to manually adjust Bandwidth, Time/div, Sample Rate, and the number of Active Channels to achieve the optimal result. Most Teledyne LeCroy oscilloscopes have a Fixed Sample Rate option, which uses whatever memory is required for the acquisition time, until none remains.

Auto Setup

Auto Setup quickly configures the essential acquisition settings based on the first input signal it finds, starting with Channel 1. If nothing is connected to Channel 1, it searches Channel 2 and so forth until it finds a signal. Vertical Scale (V/div), Offset, Timebase (Time/div), and Trigger are set to an Edge trigger on the first, non-zero-level amplitude, with the entire waveform visible for at least 10 cycles over 10 horizontal divisions.

To run Auto Setup:

- 1. Either press the front panel **Auto Setup button** or choose **Auto Setup** from the Vertical, Timebase, or Trigger menus. All these options perform the same function.
- 2. Press the Auto Setup button again or use the touch screen display to confirm Auto Setup.

After running Auto Setup, you'll see the words "Auto Setup" next to an Undo button at the far right of the menu bar. This allows you to restore the settings in place prior to the Auto Setup.

Note: You will undo all new measurements or math function definitions entered since the Auto Setup when you Undo the Auto Setup. Perform this work when the instrument is not in the Auto Setup mode if you wish for it to persist.

Restore Default Setup


Restore the factory default state by pressing the front panel **Default Setup** button. You can also restore default settings by choosing **File > Recall Setup > Recall Default**.

Setting	Default
Channel/Vertical	C1 on at 50 mV/div Scale, 0 V Offset
Timebase	HD Mode on, Real Time Sampling at 50 ns/div, 0 Delay, 20 kS at 40 GS/s, 2.5 MS Memory
Trigger	C1 with an Auto Positive Edge, DC Coupling, 0 V Level
Display	Auto Grid
Cursors	Off
Measurements	Cleared
Math	Cleared

Viewing Status

All instrument settings can be viewed through the various Status dialogs. These show all existing acquisition, trigger, channel, math function, measurement and parameter configurations, as well as which are currently active.

Access the Status dialogs by choosing the Status option from the Vertical, Timebase, Math, or Analysis menus (e.g., Channel Status, Acquisition Status).

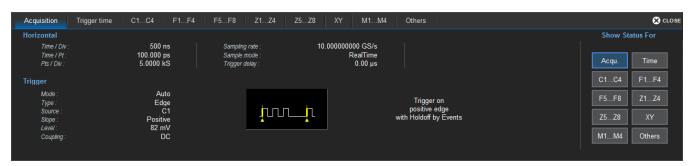

Vertical

Vertical, also called Channel, settings usually relate to voltage level and control input channel traces (C1-Cx) along the Y axis.



Note: While Digital settings can be accessed through the Vertical menu on -MS model instruments, they are handled quite differently. See <u>Digital</u>.

The amount of voltage displayed by one vertical division of the grid, or Vertical Scale (V/div), is most quickly adjusted by using the front panel **Vertical knob**. The Cx descriptor box always shows the current Vertical Scale setting.

Detailed configuration for each trace is done on the <u>Cx dialogs</u>. Once configured, channel traces can be quickly turned on/off or modified using the <u>Channel Setup dialog</u>.

Channel Setup Dialog

Use the Channel Setup dialog to quickly make basic Vertical settings for all analog input channels. To access the Channel Setup dialog, choose **Vertical > Channel Setup** from the menu bar.



To show/hide the channel trace, select/deselect the checkbox next the channel number.

To change the channel trace color, touch the color block next to the channel number, then choose the new color from the pop-up menu.

To change any other Vertical settings, touch the input field and enter the new value.



Tip: Apply pre-processing settings on the Channel Dialog (Cx).

To copy settings from one channel to another, drag-and-drop the source channel descriptor box onto the target channel descriptor box.

Cx (Channel) Dialog

Full vertical setup is done on the Cx dialog. To access it, choose **Vertical > Channel <#> Setup** from the menu bar, or touch the **Channel descriptor box**.



The Cx dialog contains:

- Vertical settings for scale, offset, coupling, bandwidth, and probe attenuation
- Current Bandwidth and Resolution when operating in HD Mode
- Rescale settings
- Pre-processing settings for pre-acquisition processes such as noise filtering and interpolation.

If a Teledyne LeCroy probe is connected to the channel, a <u>Probe dialog</u> tab appears to the right of the Cx dialog.

Vertical Settings

The **Trace On** checkbox turns on/off the channel trace.

Vertical Scale sets the gain (sensitivity) in the selected Vertical units, Volts by default. Select **Variable Gain** for fine adjustment or leave the checkbox clear for fixed 1, 2, 5, 10-step adjustments.

Offset adds a defined value of DC offset to the signal as acquired by the input channel. This may be helpful in order to display a signal on the grid while maximizing the vertical height (or gain) of the signal. A negative value of offset will "subtract" a DC voltage value from the acquired signal (and move the trace down on the grid") whereas a positive value will do the opposite. Touch **Zero Offset** to return to zero.

A variety of **Bandwidth** filters are available at fixed settings. To limit bandwidth, select a filter from this field.

Coupling may be set to DC 50 Ω , DC1M, AC1M or GROUND.



Caution: The maximum input voltage depends on the input used. Limits are displayed on the body of the instrument. Whenever the voltage exceeds this limit, the coupling mode automatically switches to GROUND. You then have to manually reset the coupling to its previous state. While the unit does provide this protection, damage can still occur if extreme voltages are applied.

Probe Attenuation and Deskew

Probe **Attenuation** and **Deskew** values for third-party probes may be entered manually on the Cx dialog. The instrument will detect it is a third-party probe and display these fields.

When a Teledyne LeCroy probe is connected to a channel input:

- Passive probe Attenuation is automatically set, and this field is disabled on the Cx dialog.
- For active voltage and current probes, a tab is added to the right of the Cx tab. The Attenuation field becomes a button to access the <u>Probe dialog</u>. Enter Attenuation on the Probe dialog.

Rescale Settings

The rescale function allows you to apply a multiplication factor, additive constant, and differential vertical unit to the waveform vertical samples.

Vertical Units may be changed from Volts (V) to Amperes (A). This is useful when using a third-party current probe (which is not auto-detected) or when probing across a current sensor/resistor.

Enter the desired values in **Units/V** and **Add**. These two selections provide the same capability as the Rescale math function (y=mx+b) but in a more intuitive, user-friendly format.

Pre-Processing Settings

Average performs continuous averaging or the repeated addition, with unequal weight, of successive source waveforms. It is particularly useful for reducing noise on signals drifting very slowly in time or amplitude. The most recently acquired waveform has more weight than all the previously acquired ones: the continuous average is dominated by the statistical fluctuations of the most recently acquired waveforms in the continuous average gradually tends to zero (following an exponential rule) at a rate that decreases as the weight increases.

Interpolate applies (Sinx)/x interpolation to the waveform. The default selection of None applies Linear interpolation, which inserts a straight line between sample points and is best used to reconstruct straight-edged signals such as square waves. (Sinx)/x interpolation, on the other hand, is suitable for reconstructing curved or irregular wave shapes, especially when the sample rate is 3 to 5 times the system bandwidth. Select an upsample factor of 2 or 5 points between each sample point. Interpolation is disabled when in HD Mode.

Deskew adjusts the horizontal time offset by the amount entered in order to compensate for propagation delays caused by different probes or cable lengths. The valid range is dependent on the current timebase setting. The Deskew pre-processing setting and the Deskew math function perform the same action.

Noise Filter applies Enhanced Resolution (ERes) filtering to increase vertical resolution, allowing you to distinguish closely spaced voltage levels. The tradeoff is reduced bandwidth. The functioning of the instrument's ERes is similar to smoothing the signal with a simple, moving-average filter. It is best used on single-shot acquisitions, acquisitions where the data record is slowly repetitive (and you cannot use averaging), or to reduce noise when your signal is noticeably noisy but you do not need to perform noise measurements. It also may be used when performing high-precision voltage

measurements and zooming with high vertical gain, for example. See <u>Enhanced Resolution</u>. ERes is disabled when in HD Mode.

Invert inverts the trace.

Cable De-Embedding (available as an option) allows you to remove the effects of cables used in the test setup. Select the checkbox, then enter the attenuation constants or cable characteristics (provided by the cable manufacturer) on the Cable De-Embedding dialog that appears. See <u>Cable De-Embedding</u>.

Probe Dialog

The Probe Dialog immediately to the right of the Cx dialog displays the probe attributes and (depending on the probe type) allows you to AutoZero, DeGauss and make tip selection for probes from the touch screen. Other settings may appear, as well, depending on the probe model.

Caution: Remove probes from the circuit under test before initializing Auto Zero or DeGauss.

Channel Setup C1 C1 HVD3102 C2	C3 C4		CLOSE
High Voltage Differential Probe	To remove output offset drift, Start an AutoZero cycle by removing probe	Attributes	
	from circuit under test then pushing		A001
	AutoZero.		25 MHz
	Auto Zero	Attenuation :	÷50
			DC 10MΩ
		I I	

Auto Zero Probe

Auto Zero corrects for DC offset drifts that naturally occur from thermal effects in the amplifier of active probes. Teledyne LeCroy probes incorporate Auto Zero capability to remove the DC offset from the probe's amplifier output to improve the measurement accuracy.

DeGauss Probe

The Degauss control is activated for some types of probes (e.g., current probes). Degaussing eliminates residual magnetization from the probe core caused by external magnetic fields or by excessive input. It is recommended to always Degauss probes prior to taking a measurement.

Tip Select

If using one of the modular WaveLink probes, specify the type of tip/lead you're using by touching the **Tip Select** control and making the appropriate selection.

Note: It's crucial to make the tip selection on this field as it results in the amplifier and tip combination having the response calibrated for at the factory. Failure to do so may result in inaccurate measurements.

Cable De-Embedding Option

Losses in the cables used in the test setup can reduce the accuracy of your signal (for example, signal amplitude and risetime), as well as introduce Inter-Symbol Interference. These cable effects can dramatically alter measurements and potentially create mask test violations.

Cable De-Embedding, available as an option, allows you to quickly specify the characteristics of the cables (typically found on the cable's data sheet) in your test setup and analyze your signal with the effects of the cables removed. The compensated signal is a more accurate representation of what was actually transmitted.

When Cable De-Embedded is installed and selected from the channel pre-processing settings, the Cable De-Embedding dialog will appear for you to describe the cable being used on the channel.

Channel Setup	Cable De-Embedding	C3 C4		🙁 CLOSE
Cable specified by AttenuationConstants Cable Length 2.00"	Delay specified by PropagationVelocity Propagation Velocity 99.00 %	Insertion loss [dB/100"] f [GHz] Cable A1 0e-6 $*f$ f	DefaultCable Load Save Apply Properties changed, please press apply to use the new settings	Browse

- 1. Touch Vertical > Channel # Setup... from the menu bar.
- 2. On the Cx dialog, check **Cable De-Embedding**to display the Cable De-Embedding tab.
- 3. On the Cable De-Embedding dialog, touch **Cable Specified by** and choose either:

Attenuation Constants. Enter the cable loss model constants (provided by the manufacturer) in **Cable A1** and **Cable A2**.

Or

Attenuation Table. Enter the first set of **Frequency** and **Attenuation** values. Touch **Add** to continue adding rows as needed.

Tip: To edit a row in the table, select the row, change values, then touch **Change**. To delete a row, select the row and touch **Delete**.

- 4. Touch **Delay Specified by** and choose from Propagation Velocity, Nominal Delay, or Dielectric Constant. Enter the value in the field of the same name.
- 5. Enter the Cable Length in inches.
- 6. Click **Apply** to initiate the cable de-embedding for the signal on this channel so that the effects of the cable are removed.
- 7. To save this cable configuration for future use, touch **File Name [DefaultCable]** and enter a name, or touch **Browse** and select a file to overwrite. To reload previously saved configurations, browse to the file, then touch **Load**.


Digital (Mixed Signal)

The <u>digital leadset</u> (standard with -MS model oscilloscopes) inputs up-to-16 lines of digital data. Leads are organized into two banks of eight leads each, and you assign each bank a standard Logic Family or a custom Threshold to define the digital logic of the signal.

There are four set up dialogs for each of four possible digital groups, which correspond to buses: Digital1 to Digital4. You choose which lines from among the 16 make up each digital group, what they are named, and how the group appears on the display. Initially, logical lines are numbered the same as the physical lead they represent, although any line number can be re-assigned to any lead.

Digital Traces

When a digital group is enabled, digital Line traces show which lines are high, low, or transitioning relative to the threshold. You can also view a digital Bus trace that collapses all the lines in a group into their Hex values.

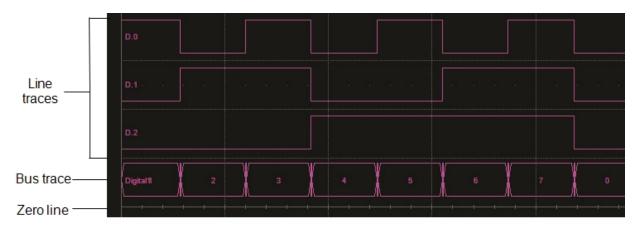

Four digital traces displayed with a Vertical Position +4.0 (top of grid) and a Group Height 4.0 (divisions).

Activity Indicators

Activity indicators at the bottom of the Digital*x* dialogs show which lines are High (up arrow), Low (down arrow), or Transitioning (up an down arrows) relative to the Logic Threshold value. They provide a quick view of which lines are active and of interest to display on screen.



Digitalx (Group) Set Up

Digital1 Digital2 Digital3	Digital4 Logic Setup	😢 CLOSE
View Group Display D0-D7 Display Mode LINES Labels DATA Q	D15-D8 D7 D6 D5 D4 D3 D2 D1 D0 DATA.7 DATA.6 DATA.5 DATA.4 DATA.3 DATA.2 DATA.1 DATA.0 Reset Names Line Activity D15 D8 D7 D0 X X X X X X X X X X X X X X X X X X X	Zoom Decode t Store Next Grid


To set up a digital input:

- 1. Connect the digital leadset to the test device and the instrument.
- 2. From the menu bar, choose Vertical > Digital <#> Setup, or press the front panel Dig button and select the desired Digitalx tab.
- 3. On the Digital*x* set up dialog, check the boxes for lines **D0** through **D15** that comprise the group.

Touch the Display D0-D7 and Display D8-D15 buttons to quickly turn on the entire digital bank, or touch the Right and Left Arrow buttons to switch between each digital bank as you make line selections.

Note: Each group can consist of anywhere from 1 to 16 of the leads, from either digital bank regardless of the Logic set on the bank. It does not matter if the some or all of the lines have been included in other groups.

- 4. Check **View Group** to enable the display. Go on to <u>set up the digital display</u> for the group.
- 5. When you're finished on the Digital*x* dialog, touch **Logic Setup** and choose the **Logic Family** that applies to each digital bank, or set custom **Threshhold** and **Hysteresis** values.

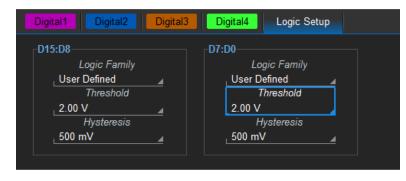

Digital Display Set Up

Choose the type and position of the digital traces that appear on screen for each digital group.

- 1. <u>Set up the digital group</u>.
- 2. Choose a **Display Mode**:
 - Lines (default) shows a time-correlated trace indicating high, low, and transitioning points (relative to the Threshold) for *every* digital line in the group. The size and placement of the lines depend on the number of lines, the Vertical Position and Group Height settings.
 - **Bus** collapses the lines in a group into their Hex values. It appears immediately below all the Line traces when both are selected.
 - Lines & Bus displays both line and bus traces at once.
- 3. In **Vertical Position**, enter the number of divisions (positive or negative) relative to the zero line of the grid where the display begins. The top of the first trace appears at this position.
- 4. In **Group Height**, enter the total number of grid divisions the entire display should occupy. All the selected traces (Line and Bus) will appear in this much space. Individual traces are resized to fit the total number of divisions available.

The example above shows a group of three Line traces plus the Bus trace occupying a Group Height of 4.0 divisions. Each trace takes up one division.

To close digital traces, uncheck the **Group** box on the Digital# dialog.

Tip: Because a new grid opens to accommodate each enabled group, you may wish to enable groups one or two at a time when they have many lines to maximize the total amount of screen space available for each. Closing the set up dialogs will also increase available screen space.

Renaming Digital Lines

The labels used to name each line can be changed to make the user interface more intuitive. Also, labels can be "swapped" between lines.

Changing Labels

- 1. <u>Set up the digital group</u>.
- 2. Touch Label and select from:
 - Data the default, which appends "D." to the front of each line number.
 - Address appends "A." to the front of each line number.
 - Custom lets you create your own labels line by line.
- 3. If using Custom labels:
 - Touch the Line number button below the corresponding checkbox. If necessary, use the Left/Right Arrow buttons to switch between banks.
 - Use the virtual keyboard to enter the name, then press **OK**.

The button and any active line traces are renamed accordingly.

Swapping Lines

This procedure helps in cases where the physical lead number is different from the logical line number you would like to assign to that input. It can save time having to re-attach leads or re-configure groups.

Example: A group is set up for lines 0-4, but lead 5 was accidentally attached to the probing point. By "swapping" line 5 with line 4, you do not need to change either the physical or the logical setup.

- 1. Select a Label of Data or Address.
- 2. Touch the **Line number button** below the corresponding checkbox. If necessary, use the **Left/Right Arrow buttons** to switch between banks.
- 3. From the pop-up, choose the line with which you want to swap labels.

The button and any active line traces are renumbered accordingly.

Timebase

Timebase, also known as Horizontal, settings control the trace along the X axis. The timebase is shared by all channels.

The time represented by each horizontal division of the grid, or **Time/Division**, is most easily adjusted using the **front panel Horizontal knob**. Full Timebase set up, including sampling mode and clock source selection, is done on the Timebase dialog, which can be accessed by either choosing **Timebase > Horizontal Setup** from the menu bar or touching the **Timebase descriptor box**.

Timebase Set Up

Use the Timebase dialog to select the HD mode, sampling mode, memory and number of active channels. You can also use it instead of the Front Panel to modify the Time/Div and horizontal Delay. There are related dialogs for <u>Clock Source</u> and <u>HD Summary</u>.

TimeBase	Clock Source	HD Summary							😢 CLOSE
HD Mode		Sampling Mode		Timebase I	lode	Real Time Sampling	Rate	Active	Channels
HD On	RealTime	Sequence	RIS	Time/Division 50.0 ns 20 kS at 40 GS/s		Sampling Rate		4	9 Bits 10 Bits
HD Off				25 ps/pt for 500 ns Delay 0 ns	Set To Zero	Maximum S	⁻ ixed ample Rate	Auto	Maximize

HD Mode

Choose **HD Mode On** or **Off** to enable/disable HD1024 technology. <u>HD1024</u> is enabled by default to dynamically configure the ADC and filter bandwidth for 9- or 10-bit resolution. When HD Mode is off, the oscilloscope operates at continuous 8-bit resolution.

Sampling Mode

Choose from <u>Real Time</u>, <u>Sequence</u>, <u>RIS</u>, or <u>Roll</u> mode.

Note: Sequence, RIS, and Roll mode acquisition are not available when operating in HD Mode.

Timebase Mode

Time/Division is the time represented by one horizontal division of the grid. Touch the Up/Down Arrow buttons on the Timebase dialog or turn the front panel Horizontal knob to adjust this value.

Delay is the amount of time relative to the trigger event to display on the grid. Raising/lowering the Delay value has the effect of shifting the trace to the right/left. This allows you to isolate and display a time/event of interest that occurs before or after the trigger event.

• **Pre-trigger Delay**, entered as a negative value, displays the acquisition time prior to the trigger event, which occurs at time 0 when in Real Time sampling mode. Pre-trigger Delay can be set up to the instrument's maximum sample record length; how much actual time this represents depends on the timebase. At maximum pre-trigger Delay, the trigger position is off the grid (indicated by the arrow at the lower right corner), and everything you see represents 10 divisions of pre-trigger time.

• **Post-trigger Delay**, entered as a positive value, displays time following the trigger event. Post-trigger Delay can cover a much greater lapse of acquisition time than pre-trigger Delay, up to the equivalent of 10,000 divisions after the trigger event occurred (it is limited at slower time/div settings and in Roll mode sampling). At maximum post-trigger Delay, the trigger point is off the grid far left of the time displayed.

Set to Zero returns Delay to zero.

Real Time Sampling Rate

These controls specify how the instrument samples when in Real Time mode.

Sampling Rate/Maximum Sample Points is the number of samples taken per time division when using a Fixed Sampling Rate. It changes to Maximum Sample Points, the number of samples taken per acquisition, if you choose to Set Maximum Memory.

Set Maximum Memory automatically adjusts the sampling rate to take the maximum number of samples possible given the amount of pre- or post-trigger Delay and the Time/div, up to the maximum record length. This optimizes the sample rate for fast timebases when in Real Time mode.

Fixed Sampling Rate activates the Sampling Rate field for you to set your own rate. Lowering the rate can extend the acquisition to accommodate slower timebases or longer delays.

Active Channels (Dual-Channel Acquisition)

The Active Channels settings allow you to combine the acquisition capabilities of the leftmost pair of channels (C1 and C2) and the rightmost pair of channels (C3 and C4) to result in two channels with maximum sample rate and memory.

In 4-channel mode, all channels remain active at the default sample rate.

To combine channels, under Active Channels, choose 2 or Auto:

- 2-channel mode turns off acquisition on Channels 1 and 4. Channels 2 and 3 acquire at doubled sample rate and memory.
- In Auto mode, the oscilloscope will allot the maximum memory and sample rate possible based on the activity within each *pair* of channels. As long as only one channel in each of the C1-C2 and C3-C4 pairs is turned on, the maximum rate is used. Turning on both channels in either pair has the same effect as selecting 4 Active Channels.

Example: C1 can operate with either C3 or C4 at higher sample rate and memory since they belong to different pairs, and likewise C2. However, C1 cannot operate with C2 without dropping the sample rate, nor can C3 operate with C4.

Refer to Acquisition System in the product datasheet for maximum sample rates.

HD1024

HD1024 high definition technology offers more quantization levels and greater precision when digitizing waveforms. HD1024 dynamically reconfigures the ADC based on the number of active channels and applies bandwidth filters in response to the timebase settings to prevent waveform aliasing while maintaining high resolution. The **HD Mode** setting on the <u>Timebase dialog</u> enables/disables HD1024. When HD Mode is Off, the oscilloscope operates in continuous 8-bit resolution.

HD1024 is enabled by default on all HD09000 oscilloscopes.

Note: HD Mode does not work with Sequence, Roll, or RIS Sampling Mode acquisitions; these options are disabled when in HD Mode. Sample Rate is restricted to a minimum 500 ms/s and the Time/div to a maximum 500 µs. Pre-processor Enhanced Resolution (ERes) and user-defined linear Interpolation are also disabled; interpolation is handled automatically.

HD1024 Methodology

The HD1024 technology utilizes two principal methods for maintaining high resolution: dynamic ADC configuration (managing the number of active channels and resolution) and optimized bandwidth filtering at the input.

Dynamic ADC Configuration

Interleaving allows the oscilloscope to put memory where it is needed to maintain the highest possible sample rate, and the principal way to do this is to combine digital capabilities into a limited number of active channels. There are three <u>Active Channels</u> options you may select from the Timebase dialog. When in HD Mode, this selection affects the number of bits resolution at which any channel may operate, as well as sample rate:

- Four leaves all channels active for acquisition, optimized for 9-bit resolution.
- Two leaves two channels active for acquisition, C2 and C3, optimized for 10-bit resolution.
- Auto, the default HD1024 selection, dynamically configures the number of active channels and the resolution at which they operate depending on which channels are actually active and your other Vertical and Timebase settings. You can enhance the performance of this selection by whenever possible attaching your signals to input pairs C1 and C3, C1 and C4, C2 and C3, or C2 and C4. Doing so supports interleaving to 40 GS/s and maintaining 10-bit resolution.

Anti-Aliasing Filters

If the sample rate lowers to a point where waveform aliasing could occur, HD1024 will dynamically apply bandwidth filters to the input according to the reduction in sample rate in order to ensure that the Nyquist 2:1 ratio of at least two samples per cycle is met. Lowering bandwidth enables the instrument to maintain or even raise the total resolution of that channel.

Example: When a 1 GHz input with DC1 Ω coupling is lowered from 2.5 GS/s to 1 GS/s in HD Mode, a 500 MHz anti-aliasing filter is applied to maintain the 10-bit resolution. If the sample rate is further lowered to 500 MS/s, bandwidth is filtered to 250 MHz.

A half bit of resolution is gained every time the bandwidth is halved. You can reduce or eliminate the need to apply anti-aliasing filters to some channels by manually lowering the bandwidth on others, also helping to maximize resolution. This approach is helpful when your test setup requires more than two active channels, but you don't need full bandwidth on all (for example, a Qualifying signal for triggering on C1 in addition to C2 and C3 for acquisition). You can selectively apply bandwidth filters on the Cx and Channel Setup dialogs.

When anti-aliasing filters are in operation, the Channel descriptor box will show the BWL symbol, the same as when you manually select to limit bandwidth.

HD Descriptor Box

The resolution for which the instrument is optimized is shown on the HD descriptor box, which appears whenever HD Mode is On. This box will always show 9 or 10 Bits, regardless of the actual bits of resolution on any channel. The HD descriptor is hidden when HD Mode is Off.



Touch the HD descriptor box to open the HD Summary dialog.

HD Summary Dialog

The HD Summary dialog shows a breakdown of the factors that impact resolution on each channel. It displays the:

- Current **Bandwidth** at which the channel is operating due to the combination of manual bandwidth filters, anti-aliasing filters, coupling setting, and timebase
- Number of bits resolution for which the **ADC Configuration** is optimized due to the Active Channels selection
- The number of bits of resolution gained due to all the **Optimized Filtering** of bandwidth on that channel (combined anti-aliasing and manual bandwidth filters)
- The total **Resolution** at which the channel is operating (the sum of ADC Configuration and Optimized Filtering)

Touch the **Cx** button to open the respective channel setup dialog and manually adjust bandwidth filters or coupling.

TimeBase	Clock Source	HD Summary				CLOSE
HD Mode HD On		Bandwidth	ADC configuration	Optimized Filtering	Resolution	
HD	C1	1.00 GHz	10 Bits	1.0 Bits	11.0 Bits	
	C2	4.00 GHz	10 Bits		10.0 Bits	
HD Off	C3	500 MHz	10 Bits	1.5 Bits	11.5 Bits	
K	C4	4.00 GHz	10 Bits		10.0 Bits	

Sampling Mode

The Sampling Mode setting determines how the instrument samples the input signal and renders it for display.

Real Time Sampling Mode

Real Time sampling mode is a series of digitized voltage values sampled on the input signal at a uniform rate. These samples are displayed as a series of measured data values associated with a single trigger event. By default (with no Delay), the waveform is positioned so that the trigger event is time 0 on the grid.

The relationship between sample rate, memory, and time can be expressed as:

Capture Interval = 1/Sample Rate X Memory Capture Interval/10 = Time Per Division

Usually, on fast timebase settings, the maximum sample rate is used when in Real Time mode. For slower timebase settings, the sample rate is decreased so that the maximum number of data samples is maintained over time.

Roll Sampling Mode

Roll mode displays, in real time, incoming points in single-shot acquisitions that appear to "roll" continuously across the screen from right to left until a trigger event is detected and the acquisition is complete. The parameters or math functions set on each channel are updated every time the roll mode buffer is updated as new data becomes available. This resets statistics on every step of Roll mode that is valid because of new data.

Timebase must be set to 100 ms/div or slower to enable Roll mode selection. Roll mode samples at \leq 5 MS/s. Only Edge trigger is supported.

Note: Roll sampling is not available when in HD Mode. If the processing time is greater than the acquire time, the data in memory is overwritten. In this case, the instrument issues the warning, "Channel data is not continuous in ROLL mode!!!" and rolling starts again.


RIS Sampling Mode

RIS (Random Interleaved Sampling) allows effective sampling rates higher than the maximum singleshot sampling rate. It is available on timebases ≤ 10 ns/div.

The maximum effective RIS sampling rate is achieved by making multiple single-shot acquisitions at maximum real-time sample rate. The bins thus acquired are positioned approximately 5 ps (200 GS/s) apart. The process of acquiring these bins and satisfying the time constraint is a random one. The relative time between ADC sampling instants and the event trigger provides the necessary variation.

Because the instrument requires multiple triggers to complete an acquisition, RIS is best used on repetitive waveforms with a stable trigger. The number depends on the sample rate: the higher the sample rate, the more triggers are required. It then interleaves these segments (as shown in the following illustration) to provide a waveform covering a time interval that is a multiple of the

maximum single-shot sampling rate. However, the real-time interval over which the instrument collects the waveform data is much longer, and depends on the trigger rate and the amount of interleaving required.

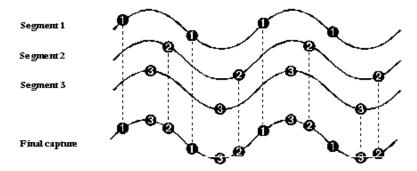

Interleaving of samples in RIS sampling mode.

Note: RIS is not available when the oscilloscope is operating in fixed sample rate or HD Mode.

Sequence Sampling Mode

In Sequence Mode sampling, the completed waveform consists of a number of fixed-size segments. The instrument uses the Timebase Sequence settings to determine the capture duration of each segment. The desired number of segments, maximum segment length, and total available memory are used to determine the actual number of samples or segments, and time or points.

Sequence Mode is ideal when capturing many fast pulses in quick succession or when capturing few events separated by long time periods. The instrument can capture complicated sequences of events over large time intervals in fine detail, while ignoring the uninteresting periods between the events. Measurements can be made on selected segments using the full precision of the timebase.

Note: Sequence Mode sampling is not available when operating in HD Mode.

Sequence Mode Set Up

The Sequence dialog appears only when Sequence Mode sampling is selected. Use it to define the number of fixed-size segments to be acquired in single-shot mode.

TimeBase	Sequence	Clock Source	e			🙁 CLOSE
	isition Settings ber of Segments		Sequence Timeout Imeout Timeout Imeout 100.0000 s Following valid trigger of first segment, use sequence timeout to automatically interrupt the sequence acquisition if the timeout value is exceeded without a valid trigger.	Display Settings Display Mode _Adjacent ▲ Use Zoom traces to select segments viewed and processed.	Show Sequence Trigger Times	

- 1. From the menu bar, choose **Timebase > Horizontal Setup...**, then **Sequence Sampling Mode**.
- 2. On the Sequence tab under Acquisition Settings, touch Number of Segments and enter a value.



Note: The number of segments displayed can be less than the total number of segments acquired.

3. To stop acquisition in case no valid trigger event occurs within a certain timeframe, check the **Enable Timeout** box, then touch **Timeout** and provide a timeout value.

Note: While optional, Timeout ensures that the acquisition completes in a reasonable amount of time and control is returned to the operator/controller without having to manually stop the acquisition.

4. Touch **Display mode** and select a sequence display mode from the pop-up menu:

Adjacent	Overlay
	a
land has been been been been been been been	
Waterfall (cascaded)	Perspective
•	
Mosaic (tiled)	

0

Note: Some display modes have limitations on the number of segments that can be shown at one time.

5. Touch one of the **front panel Trigger buttons** to begin acquisition.

Once acquisition has started, you can interrupt it at any time by pressing the front panel **Stop** button. In this case, the segments already acquired will be retained in memory.

View Sequence Segments

When in Sequence sampling mode, you can view individual segments easily using the front panel Zoom button. A new zoom of the channel trace defaults to Segment 1.

You can view other segments by changing the **First** and total **Num**(ber) of segments to be shown on the Zx dialog. Touch the Zx descriptor box to display the dialog.



Tip: By setting the Num value to 1, you can use the front panel Adjust knob to scroll through each segment in order.

Channel descriptor boxes indicate the total number of segments acquired in sequence mode. Zoom descriptor boxes show the first segment displayed and total number of segments displayed ([#] #). As with all other zoom traces, the zoomed segments are highlighted on the source trace.

C1	DC50	Z1	zoom(C1)
	50.0 mV/div		50.0 mV/div
	0.0 mV ofst		1.00 µs/div
	10 Seg		[4] 6 Seg

Example: You have acquired 10 segments. You choose to display segments 4 to 6-or, a total of 3 segments beginning with segment 4. The Cx descriptor box reads 10. The Zx descriptor box reads [4]3, meaning you are displaying a total of 3 segments, starting with segment 4.

Besides using the Zoom feature, you can also create a Math (Fx) trace to display individual segments.

- 1. From the menu bar, choose **Math > Math Setup...**
- 2. Touch a Function (Fx) tab to display its corresponding dialog.
- 3. On the dialog, touch **Operator1** and select the **Segment** button from the pop-up menu.
- 4. Touch the **Select** subdialog tab.
- 5. Touch **First Selected** and choose the first segment to display.
- 6. Touch **Number of Selected** and enter the total number of segments to display.

To view time stamps for each segment:

1. From the Sequence dialog, choose **Show Sequence Trigger Times**.

Or

From the menu bar, choose Timebase > Acquisition Status, then open Trigger time .

2. Under Show Status For, choose Time.

Clock Source Settings

An external reference clock, applied via the REF In input, is used to synchronize the instrument's internal timebase to an external frequency source. This allows multiple instruments to lock their timebases to a common source.

An external sampling clock, applied via the EXT input, replaces the internal timebase as the sampling clock. This means that the external sampling clock controls when the digitizers sample the input waveforms.

Since the external sampling clock uses the EXT input, an external trigger cannot be used when the external sampling clock is in use.



Clock Frequencies

The signal types, frequency ranges, and levels accepted for an external reference clock or sampling clock are model dependent. See the product specifications at <u>teledynelecroy.com</u>.

Reference Clock

The default setting is to use the instrument's **Internal** 10 MHz clock. To use an external reference clock:

- 1. Connect a clock source to the **Ref In 10 MHz** input using a BNC cable.
- 2. Go to Timebase > Horizontal Setup and choose Real-Time Sampling Mode.
- 3. On the Clock Source tab under Reference Clock choose External.

Sample Clock

The default setting is to use the instrument's Internal clock. To use an external sample clock:

- 1. Connect a clock source to the EXT input using a BNC cable.
- 2. Go to **Timebase > Horizontal Setup** and choose **Real-time Sampling Mode**.
- 3. On the **Clock Source tab** under **Sample Clock** choose from 0V, ECL, or TTL pulse types.
- 4. Choose an **External Coupling** that matches the clock source input impedance.

History Mode

History Mode allows you to review any acquisition saved in the history buffer, which automatically stores all acquisition records until full. Not only can individual acquisitions be restored to the grid, you can "scroll" backward and forward through the history at varying speeds to capture individual details or changes in the waveforms over time.


Each record is indexed and time-stamped, and you can choose to view the absolute time of acquisition or the time relative to when you entered History Mode. In the latter case, the last acquisition is time zero, and all others are stamped with a negative time. The maximum number of records stored depends on your acquisition settings and the total available memory.

Press the front panel **History Mode button**, or choose **Timebase > History Mode** to access this feature.

Entering History Mode automatically stops new acquisitions. To leave History Mode, press the **History Mode button** again, or restart acquisition by pressing one of the front panel Trigger Mode buttons.

0

Note: History Mode does not work with Sequence Mode acquisitions, pre-processor Interpolation set on the input channel, or channel interleaving.

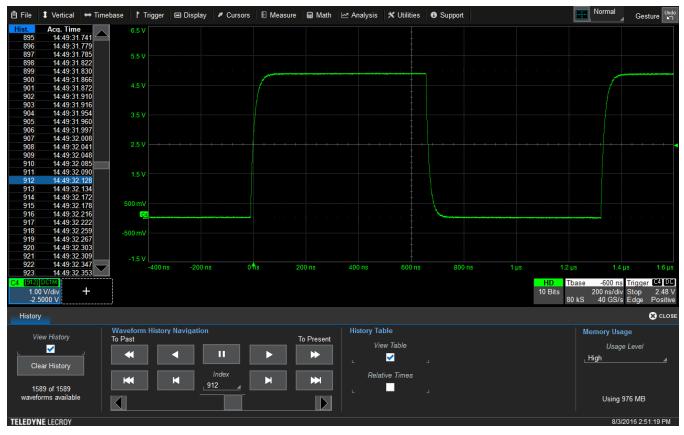

Oscilloscope in History mode.

Replay Acquisition History

This is a good way to begin using History Mode. Watching a "movie" of the history allows you to see waveform changes that are invisible during real-time acquisition.

Select **View History** to enable the display, then use the Navigation buttons or the slider bar at the bottom of the dialog to "scroll" the history of acquisitions.

- The top row buttons scroll: Fast Backward, Slow Backward, Slow Forward, Fast Forward.
- The bottom row buttons step: Back to Start, Back One, Go to Index (row #), Forward One, Forward to End.

Press Pause when you see something of interest, then use the History table to find the exact Index.

Select Single Acquisition

- 1. Select **View History** to enable the display, and **View Table** to show the index of records.
- 2. Optionally, select to show **Relative Times** on the table.
- 3. View individual acquisitions by selecting the row from the table or entering its **Index** number on the dialog.

Trigger

Triggers define the event around which digitized information is displayed on the oscilloscope touch screen.

Different <u>Trigger Types</u> are used to select different events in the trigger source waveforms: edge voltages, pulse widths, high/low states, etc. These may be a single channel event or a complex pattern of events across several channels. On instruments with Mixed Signal capabilities, many triggers can be set on either analog channels, including the External Trigger input, or digital lines.

In addition to the type, the <u>Trigger Mode</u> determines how the instrument behaves as it encounters trigger events: take a single acquisition and stop, holding on to the display of the last acquisition, or continuously take and display acquisitions.

In both cases, when the previous acquisition has completed processing, the oscilloscope is again ready to acquire and the READY indicator is lit. If, while READY, the trigger circuit detects a signal that matches the trigger conditions, the oscilloscope triggers on the next matching event, and the TRIG'D indicator is lit.

Unless modified by a pre- or post-trigger <u>Delay</u>, the trigger event appears at time 0 at the horizontal center of the grid, and a period of time equal to five divisions of the timebase is shown to the left and right of it. Delay shifts the trigger position on screen, displaying a different portion of the pre- or post-trigger waveform.

An additional condition of <u>Holdoff</u> by time or events is available for Edge and Pattern triggers, including those that appear within MultiStage triggers. Holdoff arms the trigger on the first matching event, inserts the holdoff count, then triggers on a subsequent event. Often, especially with repetitive signals, the initial arming event appears to the left of the trigger in "negative" acquisition time.

Trigger Modes

The Trigger Mode determines how often the instrument acquires. It is equivalent to how analog oscilloscopes "sweep," or refresh, the display. Trigger Mode can be set from the Trigger menu or from the front panel Trigger control group.

In **Single** mode, when you choose **Trigger > Single** or press the front panel **Single** button, the oscilloscope readies, arms, and triggers provided all trigger conditions (including Holdoff) are met. It then stops and continues to display the last acquisition until a new one is taken. The oscilloscope remains armed unless manually stopped or triggered, and if a valid trigger does not occur, invoking Single a second time will force a trigger and display the acquisition.

In **Normal** mode, operation is the same as in Single, except that the trigger automatically re-arms after the previous acquisition is complete, and data is continuously refreshed on the touch screen.

Auto operates the same as Normal mode, except that a trigger is forced if the trigger event has not occurred within a preset timeout period.

Stop ceases acquisition processing until you select one of the other three modes. The arming and Holdoff counters are cleared, even if there has not yet been a trigger since the previous acquisition.

Trigger Types

The Trigger Type sets the triggering conditions. Special MultiStage types allow one set of conditions for arming and another (same or different) set for triggering.

If a type is part of a subgroup (e.g., Smart), first choose the subgroup to display all the trigger options.

Basic Types

Edge triggers upon a achieving a certain voltage level in the positive or negative slope of the waveform.

Width triggers upon finding a positive- or negative-going pulse width when measured at the specified voltage level.

Pattern triggers upon a user-defined pattern of concurrent high and low voltage levels on selected inputs. In Mixed-Signal oscilloscopes, it may be a digital logic pattern relative to voltage levels on analog channels, or just a digital logic pattern omitting any analog inputs. Likewise, if your oscilloscope does not have Mixed-Signal capability, the pattern can be set using analog channels alone.

TV triggers on a specified line and field in standard (PAL, SECAM, NTSC, HDTV) or custom composite video signals.

Serial triggers on the occurrence of user-defined serial data events. This type will only appear if you have installed protocol-specific serial data trigger and decode options.

Measurement is not technically a trigger, per se, but permits the instrument to stop and display acquisition based on a post-processing measurement result, similar to a trigger.

MultiStage Types

MultiStage subgroup triggers establish dependencies between two or more distinct events, some that "qualify" or arm, and others that trigger. The individual events are defined exactly as are the basic types (Edge, Width, Pattern, etc.).

<u>Cascaded</u> establishes a succession of criteria in Stages A-D. The trigger occurs when stages B through D—or whatever is the last defined event—are achieved. In Normal trigger mode, it automatically resets after finding the last defined event. You may apply additional Holdoff by time or number of events between each stage in the cascade.

QualFirst arms the oscilloscope on the A event, then triggers on all subsequent B events, saving each as a Sequence Mode segment.



Note: This trigger is only enabled when using Sequence sampling mode.

Qualified arms on the A event, then triggers on the B event. In Normal trigger mode, it automatically resets after the B event, and re-arms upon the next matching A event.



Note: This functionality is identical to Teledyne LeCroy's previous Qualify and State triggers, but presented through a different user interface.

Smart Triggers

The Smart subgroup triggers allow you to apply Boolean logic conditions to the basic signal characteristics of level, slope, and polarity to determine when to trigger.

Glitch triggers upon finding a pulse-width that is less than a specified time or within a specified range of times.

Window triggers when a signal enters or exits a window defined by voltage thresholds.

Interval triggers upon finding a specific interval, the time (period) between two consecutive edges of the same polarity: positive to positive or negative to negative. Use the interval trigger to capture intervals that fall short of, or exceed, a specified range.

Dropout triggers when a signal loss is detected. The trigger is generated at the end of the timeout period following the last trigger source transition. It is used primarily in Single-Shot acquisitions with a pre-trigger Delay.

Runt triggers when a pulse crosses a first threshold, but fails to cross a second threshold before recrossing the first. Other defining conditions for this trigger are the edge (triggers on the slope opposite to that selected) and runt width.


SlewRate triggers when the rising or falling edge of a pulse crosses an upper and a lower level. The pulse edge must cross the thresholds faster or slower than a selected period of time.

Trigger Set Up

To access the Trigger setup dialog, press the **front panel Trigger Setup** button or touch the **Trigger descriptor box**.

Different controls will appear depending on the Trigger <u>Type</u> selected (e.g., Slope for Edge triggers). Complete the settings shown after making your selection.

The trigger condition is summarized in a preview window at the far right of the Trigger dialog. Refer to this to confirm your selections are producing the trigger you want.

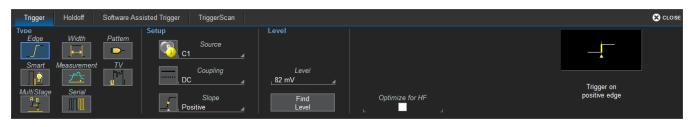

Note: If you wish to trigger on digital input using an external Mixed-Signal device, instructions for installing the device are in the product manual on our website at <u>teledynelecroy.com/support/techlib</u> under Manuals > Mixed Signal Test Solutions.

Source

For most triggers, the **Source** is the analog channel or digital line to inspect for the trigger conditions.

Tip: When triggering on analog channels, the source can be easily set by dragging the desired source channel descriptor box onto the Trigger descriptor box. Note that the trigger type will revert to whatever was last set on that channel.

Pattern triggers may utilize multiple sources (such as a mix of analog and digital signals), and likewise MultiStage triggers may use different sources for the arming and triggering events.

Coupling

For analog triggers, specify the type of signal **Coupling** at the input.

- **DC** All the signal's frequency components are coupled to the trigger circuit for high frequency bursts or where the use of AC coupling would shift the effective trigger level.
- AC The signal is capacitively coupled. DC levels are rejected, and frequencies below 50 Hz are attenuated.
- LFREJ The signal is coupled through a capacitive high-pass filter network, DC is rejected and signal frequencies below 50 kHz are attenuated. For stable triggering on medium to high frequency signals.
- **HFREJ** Signals are DC coupled to the trigger circuit, and a low-pass filter network attenuates frequencies above 50 kHz (used for triggering on low frequencies).

Slope/Polarity

For some triggers, such as Edge, you will be asked to select the waveform **Slope** (rising vs. falling) on which the triggering event may occur.

For others, such as Width, the equivalent selection will be **Polarity** (positive vs. negative).

Level

For analog triggers, enter the voltage **Level** at which the triggering condition must occur. Use the **Find Level** button to set the level to the signal mean.

Trigger types that require multiple crossings to define the triggering condition—such as Window, SlewRate and Runt— will have **Upper Level** and **Lower Level** fields.

For digital triggers, the level is determined by the **Logic Family** that is set on the digital group. This can also be specified by a custom (User-Defined) crossing **Threshold** and **Hysteresis** band. Usually, there will be a separate Logic dialog tab for these triggers.

Conditions (Smart Triggers)

Smart triggers all allow you to apply Boolean logic to refine the triggering condition beyond simply Level and Slope/Polarity.

The values that satisfy the operators of Less Than, Less Than or Equal To, Greater Than, etc. can be set by entering an Upper Value and/or Lower Value.

In some cases, it is possible to set a range of values that satisfy the condition. The values may be **In Range** that is bounded by the upper/lower values or **Out Range**.

The extent of the range can often also be specified by using a **Nominal** and **Delta** value, rather than an absolute upper and lower value. In this case, the Nominal value sets the center of the range, and the Delta determines how many units plus/minus the Nominal value are included in the range.

Patterns

A triggering pattern of low/high states across multiple inputs is used by the Pattern type and MultiStage types that include Patterns as either the arming or triggering event. Patterns may be set on analog channels, digital lines, or a combination or both when Mixed-Signal capabilities are available.

Digital Pattern

The Logic Bus method simplifies pattern set up by utilizing digital groups and logic you have already defined on the Digital Setup dialogs. A digital pattern is set on a single bus (group) manually or by applying a hexadecimal value, while the remaining lines are disabled ("Don't Care").

If you have not set up digital groups, you can set a digital pattern line by line using the Logic method. All available lines remain active for selection.

1. On the Trigger dialog, select **Pattern** trigger type. Open the **Digital Pattern** dialog.

Trigger	Digital Pattern	Levels Ext	TriggerScan					Ӿ close
And Dr	Nand	C1-D8 C1 C1 E X X X X	D7 D X D15 X D15	< <u>x</u>	D2 D1 X X × × × × ×	D0	ww	gicBus 2₽► ions

- 2. At the far right of the dialog, choose either Logic Bus or Logic.
- 3. Optionally, deselect **Filter Out Unstable Conditions**. This default filter ignores short glitches in logic state triggers that last less than 3.5 ns.
- 4. If using Logic Bus, touch **Source** and select the digital group. Any lines that are not in this group will now be disabled.
- 5. To apply a digital logic pattern, either:
 - Enter the hexadecimal value of the pattern in **Hex** or **Value**. Lines will take a logical 1, 0, or X ("Don't Care") according to the pattern. Disabled lines will remain X.

• Touch the **Dx button** for each active line, and select whether it must be High or Low compared to the logic threshold. Depending on your selection, a logical 1 (High) or 0 (Low) now appears on the dialog. Leave X selected for any line you wish to exclude from the pattern. Use the Left and Right Arrow buttons to display lines in other digital banks.

Note: As an alternative to a pattern, you may set edge conditions on any line. Touch the **Dx button** and choose the edge. Edge conditions always assume a logical OR in the overall trigger criteria.

As you work, the checkboxes along the bottom of the dialog will change to show the pattern. You can also use these checkboxes to make selections.

6. If you have not already set a logic threshold, open the **Levels dialog** and select a **Logic Family** for each digital bank from which you've selected lines. To set a custom logic threshold, choose Logic Family User Defined, then enter the **Threshold** voltage and **Hysteresis**.

Note: Digital lines inherit the Logic Setup made when defining digital groups. However, you can change the logic threshold on the Levels dialog. The two settings are linked and always reflect whatever was last selected. Logic thresholds can only be set per lead bank, not individual line.

Analog Pattern

Tip: With the Mixed-Signal option, you can also use the Digital Pattern dialog to set an analog state pattern. Touch Set All To... and select Don't Care. This will eliminate any meaningful digital pattern and activate all the Boolean operators. Use the Left Arrow button to display the C1-EXT group of inputs, and follow the procedure below to set the low/high pattern on each input.

Trigger	Holdoff Ext TriggerScar	n					😢 CLOSE
Type Edge Smart	Width Pattern	Operator And Nand	CHANNEL 1 State High	CHANNEL 2 State Low	CHANNEL 3 State Don't Care	CHANNEL 4 State Don't Care	EXTERNAL State Don't Care
MultiStage		Or Nor	Level -140 mV Triggers when Pattern con All inputs set to DC couplin		Level		

- 1. Select the Boolean **Operator** (AND, NAND, OR, or NOR) that describes the relationship among analog inputs (e.g., C1 must be High NAND C2 must be Low).
- 2. For each input to be included in the trigger pattern, select what **State** it must be in (High, Low, or Don't Care) compared to the threshold Level you will set. Leave "Don't Care" selected for any input you wish to exclude.
- 3. For each input included in the trigger, enter the voltage threshold Level.
- 4. If you've included EXTERNAL as an input, open the **Ext tab** and enter the **Attenuation**.

MultiStage Triggers


MultiStage types arm on the A event, then trigger on a subsequent event. The options for the triggering event depend on the type of arming event.

See Cascaded, QualFirst and Qualified.

Measurement Trigger

Measurement is not technically a trigger, per se, but permits the instrument to stop and display acquisition based on a post-processing measurement result, similar to a trigger. The available measurements depend on your model instrument and the options installed, and each will offer a different method for specifying the "trigger" conditions, based on the type of measurement. Generally, you will be able to specify a triggering value or range of values, and for @level parameters, the voltage level at which the measurement is taken.

A measurement can be defined as a standalone trigger condition or as the final condition in a multistage Cascaded trigger.

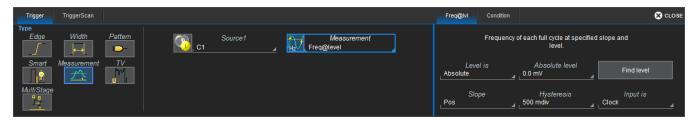

TV Trigger

TV triggers on a specified line and field in standard (PAL, SECAM, NTSC, HDTV) or custom composite video signals.

Trigger	TriggerScan					🗙 CLOSE
Type Edge	Width	Pattern	Setup Source	TV Standard	Trigger On	
			C1	CUSTOM	Line Line	
Smart ?	Measurement		Coupling DC	Frame Rate # of Fields		
MultiStage			Sync Polarity Negative	# of Lines Interlace		TV Trigger on Negative Edge

- 1. Choose the **Source** signal input.
- 2. Choose the signal **TV Standard**. To use a custom signal, also enter the:
 - Frame Rate
 - # of Fields per line
 - # of Lines
 - Interlace ratio
- 3. Choose the Line and Field upon which to trigger.

Serial Trigger

The Serial trigger type will appear if you have installed serial data trigger and decode options. Select the **Serial** type then the desired **Protocol** to open the serial trigger setup dialogs. For setup instructions, see the software instruction manual at <u>teledynelecroy.com/support/techlib</u> under Manuals > Software Options.

A 3.125 Gb/s Serial Trigger hardware option is available for HDO9000 oscilloscopes. This option provides capability for 8b/10b symbol triggering. The trigger hardware is factory installed and is permanently connected internally to C4. Complete information on the operation of this trigger can be obtained in the *High Speed Serial Triggers Instruction Manual*.

Qualified Trigger

A Qualified trigger arms on the A event, then triggers on the B event. In Normal trigger mode, it automatically resets after the B event, and re-arms upon the next matching A event. Unlike a basic Edge or Pattern trigger with Holdoff, the A and B events can occur in different signals, allowing you to use the state of one signal to "qualify" the trigger on another.

On the Trigger dialog, select **MultiStage** trigger type and choose **Qualified**.



On the **Qualified dialog**, choose the A and B events.

Trigger	Qualified	Event 'A' Edge	Event 'B' Pattern	TriggerScan					🛞 CLOSE
Arm Even	trigger on It 'A'		Then trig Event 'B			When 'B' occurs <u>Any</u> <u>Less Than</u>	Starts Holdoff Counter on :		
Edge	State	Pattern	Edge		Glitch	Any Time Greater Th Events			
	÷		Interval	Pattern		Any Time		Trigger with edge trigger settings only after a second qualifying condition is satisfied once.	

When B is an Edge or Pattern , a time window may be added to the trigger conditions by using the **When B Occurs** buttons:

- Any Time triggers if B occurs any time after being qualified by A.
- Less Than triggers only if B occurs before the time set once qualified.
- Greater Than triggers only if B occurs after the time set once qualified.
- Events triggers on the next B event after the specified N Events once qualified.

As with regular <u>Holdoff</u>, the counter may begin from the **Acquisition Start** or the **Last Trigger Time**.

Once you've selected the A and B events on the Qualified dialog, set up the conditions on the respective "Event" dialogs exactly as you would a <u>single-stage trigger</u>.

QualFirst Trigger

The QualFirst trigger, which is used in Sequence sampling mode, is set up exactly like the <u>Qualified</u> trigger. The only difference is that the "B" event is captured as a series of sequence segments, rather than a single acquisition.


Cascaded Trigger

A Cascaded trigger type establishes a succession of criteria in Stages A-D. The trigger occurs when stages B through D—or whatever is the last defined event—are achieved. In Normal trigger mode, it automatically resets after finding the last defined event. You may apply additional Holdoff by time or number of events between each stage in the cascade.

On the Trigger dialog, select MultiStage trigger type and choose Cascaded.



Then, on the **Cascaded dialog** choose the A through D events.

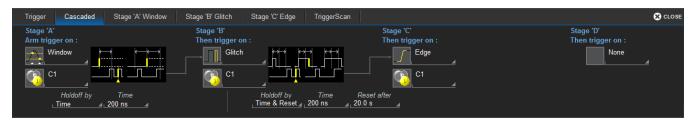

You may apply additional <u>Holdoff</u> at each stage by time or number of events:

- Time and Events work exactly as they do in other Holdoff counts.
- **Time & Reset** sets a Holdoff time between cascaded events, but resets to the beginning of the cascade if no valid trigger occurs before the reset time expires.

Once you've selected the A through D events on the Cascade dialog, set up the conditions on the respective sub-dialogs exactly as you would a <u>single-stage trigger</u>.

Trigger Holdoff


Holdoff is either a period of time or an event count that may be set as an additional condition for Edge and Pattern triggers. Holdoff disables the trigger temporarily, even if the other conditions are met. Use Holdoff to obtain a stable trigger for repetitive, composite waveforms. For example, if the number or duration of sub-signals is known, you can disable them by setting an appropriate Holdoff value.

Note: <u>Qualified</u> operates using time or event conditions similar to Holdoff, but arm and trigger differently.

Hold Off by Time


This is a period of time to wait after the arming event before triggering on the next event. The maximum allowed time is 20 seconds; the Holdoff time would otherwise be limited only by the input signal, the coupling, and the instrument's bandwidth.

When a Holdoff by time is counted from the start of the acquisition, the oscilloscope readies, arms on the first event, holds for the specified time, then triggers on the next event. After one full acquisition has completed, the oscilloscope again readies, arms, holds, and triggers for the following acquisition.

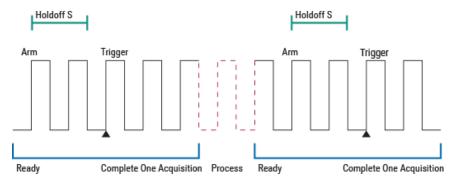

Positive Edge trigger with Holdoff by time counted from the start of acquisition.

When a Holdoff by time is counted from the last trigger time, the oscilloscope immediately re-arms on the first event following the trigger and begins counting the Holdoff, rather than wait to complete the full acquisition. The Holdoff count continues even during the very brief time between acquisitions while the oscilloscope is processing. As soon as the Holdoff is satisfied *and* the oscilloscope is again ready, it triggers on the next event. The re-arming and Holdoff may occur in one acquisition, and the trigger in the next.

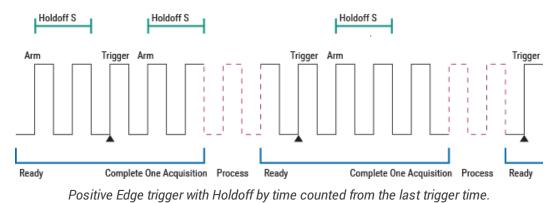


Note: Because there is only one trigger per acquisition, the trigger event will always belongs to the new acquisition. The processing time shown here is for purposes of illustration only.

Regardless of where in the acquisition record the trigger event was found (first edge or last), the display will show time pre- and post-trigger based on your Time/Div and Delay settings.

Hold Off by Events


Events refers to the number of times the trigger conditions have been met following the arming event.

For example, if the Holdoff is two edges counted from the start of the acquisition, the oscilloscope readies, arms on the first edge, holds off for the next two, triggers on the fourth edge, then completes the acquisition. Because there must always be a first arming edge, the Holdoff appears to be "Holdoff plus one."

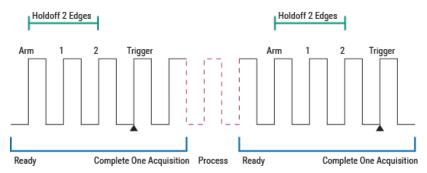

Positive Edge trigger with Holdoff by events counted from start of acquisition.

As with Holdoff by time, when a Holdoff by events is counted from the last trigger time, the oscilloscope re-arms immediately following the trigger and begins the Holdoff count. If the count is satisfied by the time the oscilloscope is again ready, the trigger occurs on the next event at the start of the new acquisition.

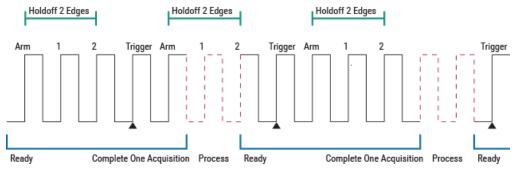

Positive Edge trigger with Holdoff by events counted from last trigger time.

Holdoff Set Up

To add Holdoff to an Edge or Pattern trigger, touch the Trigger descriptor box or press the front panel Trigger Setup button, then open the **Holdoff tab**.

Trigger Holdoff Software Assisted Trig	gger TriggerScan	🗙 CLOSE
Holdoff by None	Starts Holdoff Counter on :	← →
Time Time	Acquisition Start	ίω t
50.0 ns Events	Last Trigger time	Trigger on positive edge with Holdoff by Time

Choose to Holdoff by Time (the clock) or Events.

- If using Holdoff by Time, enter the **Time** in S to wait before triggering.
- If using Holdoff by Events, enter the number of **Events** to wait before triggering.


Choose to Start Holdoff Counter On:

- Current Acquisition Start time.
- Last Trigger Time from previous acquisition.

Software Assisted Trigger

Software Assisted Trigger is used to find the trigger-level crossing point closest to the hardware trigger point. It then adjusts the time offset of the waveform so that it is aligned with the specified trigger level and slope.

In the following figure, the white trace is the waveform at the input to software-assisted trigger processing. The red trace shows it after processing, aligned with the trigger point indicated by the red marker below the grid.

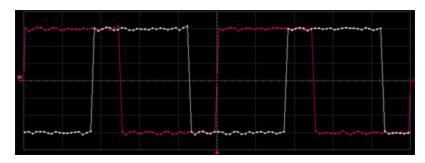

Note: This feature can only be used with an Edge trigger type in Normal trigger mode.

1. From the menu, choose **Triggers > Trigger Setup**, then touch the **Software Assisted Trigger tab**.

Trigger Holdoff Software Assisted Trig	ger TriggerScan			🙁 CLOSE
Software Assisted Trigger Enable Wysteresis 500 mdlv	Horizontal Gate Start -1.000 ns Stop 2.500000 µs	Mode Auto Normal	Auto: Allows all waveforms through the channel. Normal: Allows waveforms only with a trigger crossing within the horizontal gate region through the channel.	

- 2. Touch Enable.
- 3. Create a trigger window by entering a **Hysteresis** value. This value sets a boundary above and below the main trigger level to exclude noise.
- 4. Choose **Auto** or **Normal** mode; this determines the trigger behavior when trigger crossings are not found in the trigger source waveform.
 - Auto mode allows all waveforms through the channel.
 - **Normal** mode allows waveforms only with a trigger crossing within the horizontal gate region through the channel.
- 5. Set **Start** and **Stop** time values on the **Horizontal Gate** part of the Software Assisted Trigger tab. These values control where in the waveform the software-assisted trigger processing searches for trigger crossings.

TriggerScan

TriggerScan is a debugging tool that helps you quickly discover waveform anomalies by automating the process of building triggers designed to find rare events in an acquisition. TriggerScan:

- **Trains** the system by looking at normal acquired waveforms. During the training, TriggerScan analyzes the waveforms to determine what waveforms normally look like. Using this information, it generates a list of smart triggers to isolate abnormal situations.
- Loads the trigger setups from the Trainer and cycles them. As triggers occur, they are overlaid on the screen. All acquisition settings are preserved, and you can use other tools to find the root cause of these anomalies such as WaveScan, Histograms, etc.

Training TriggerScan

The TriggerScan Trainer inspects the current acquisition and automatically builds a list of trigger setups that could potentially be used to find events of interest.

Note: Run the Trainer if you want to change the trigger types or if you change the channel or signal. You must acquire and display at least 3 cycles of a signal before running the Trainer.

- 1. Touch Trigger > Trigger Setup... from the menu bar, then open the TriggerScan tab.
- 2. Touch the **Trainer** button.
- 3. On the TriggerScan Trainer pop-up, choose the **Source** channel on which to train and trigger, and select all the <u>trigger types</u> you want to set up.
- 4. Touch the **Start Training** button. When training is complete, a list of smart trigger setups is displayed in the Trigger List.

Modifying Trigger List

Follow these steps to change the triggers created by TriggerScan. Once you have finalized the Trigger List, you are ready to start scanning.

1. Choose **Trigger > Trigger Setup...** from the menu bar, then open the **TriggerScan** tab.

Trigger TriggerScan				Ӿ CLOSE
	Trigger List		Control	Trigger Scan Setups
Train using current input signal Trainer	Width 373 mV Neg Width 252 mV Neg	Load Load the selected trigger setup	Start Scan	Setup File Name TriagerSeep les Browse
Append current trigger Add setup to the list New	Width 132 mV Neg Runt Pos > 132 mV 72 mV 1.0 ns Runt Pos > 252 mV 72 mV 1.0 ns	E Delete Selected Delete the selected trigger setup		TriggerScan.Iss
Replace the selected Update trigger with the current Selected	Runt Pos > 373 mV 72 mV 1.0 ns Runt Neg > 433 mV 373 mV 1.0 ns Runt Neg > 433 mV 252 mV 1.0 ns	Delete Delete all trigger	Dwell Time Stop On 100 ms	Save Setup Load Setup

- 2. Make any of the following modifications to the Trigger List:
 - Add new trigger: touch the Trigger descriptor box and set up the new trigger as desired on the Trigger dialog. Then, back on the TriggerScan dialog, touch the Add New button to append the new trigger to the Trigger List.

- Replace a trigger with one manually set up on the Trigger dialog: highlight the setup in the Trigger List and touch the **Update Selected** button.
- Delete a trigger: highlight the setup in the Trigger List and touch the **Delete Selected** button. All trigger setups can be deleted in one step by touching the **Delete All** button.
- 3. Optionally:
 - Enter a **Dwell Time** the time instrument should wait before loading the next trigger.
 - Check the **Stop On Trigger** checkbox. You can use this to isolate events as the triggers find them.



Note: If you have Persistence enabled, all trigger events are recorded on the display.

Saving TriggerScan Setups

You can preserve the Trigger List by saving it to a setup file. The current Trigger List is not preserved after exiting the application unless you manually save it.

- 1. On the **TriggerScan** dialog, touch **Setup File Name** and enter a file name, or touch the **Browse** button and select a location and file name.
- 2. Touch the Save Setup... button.

To reload a saved Trigger List, touch the **Browse** button, locating the file, then touch Load Setup....

Running TriggerScan

When the Trigger List is set, touch the **Start Scan** button on the Trigger Scan dialog. The instrument automatically cycles through all the triggers in the list.

To run only a single trigger, select it from the Trigger List and touch **Load Selected**. The trigger settings are copied to the Trigger dialog and will be used when you start acquisition.

Display

Display settings affect the number and style of grids that appear on screen and some of the visual characteristics of traces, such as persistence.

Multi-Grid Display

The HDO features multi-grid display, where each separate grid represents the full number of 4096 vertical levels.

Auto Grid Mode is enabled by default. This feature adds a grid each time a new trace is opened, up to 16 grids, until no more grids are available. There are display options to show all traces on a Single Grid, or to manually divide the display into different numbers and orientations of grids. The Grid Mode icon shows what the result of the selection will be.

Q-Scape Multi-Tabbed Display

Available with the Q-Scape option, the Q-Scape Display Modes divide the screen into multi-tab displays, each of which can be configured with a different multi-grid display mode. Many of the same functions you can perform in Normal mode, such as moving traces by drag-and-drop, you can also perform in Q-Scape modes.

When Q-Scape is installed, the **Display Mode** setting determines whether the touch screen has a single display area ("Normal" mode) or tabs each representing a separate display (the various "Q-Scape" modes). The **Grid Mode** setting determines how grids are configured within the display area and what kind of traces they show (for example, XY or VT). Normal Display Mode (a single display) is the default.



Multi-grid display.

Display Set Up

To access the Display dialog, choose **Display > Display Setup.**




Display Mode (Q-Scape only)

The Display mode determines the number and layout of display tabs. Choose **Normal** (default), a single display with no tabs, or one of the three **Q-Scape display** modes:

• **Q-Scape Single**, a single set of four tabs stacked so that only one at a time is visible. Each tab can have any style of grid mode, same or different.



• **Q-Scape Dual**, two sets of four stacked tabs. Equivalent tabs in each set share the same grid mode, but can display different traces. You can simultaneously view one tab from each set, but they must be different numbered tabs (e.g., Tab 1 from set one and Tab 3 from set two).

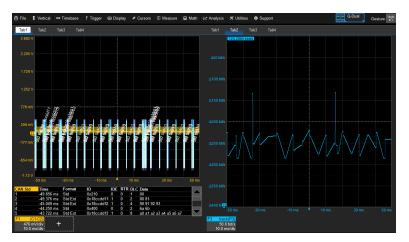

• **Q-Scape Mosaic**, a single set of four tabs arranged so that all are viewed simultaneously. Note that the decoder table appears only in Tab1, since it is part of the display associated with the trace in that tab. However, in the Q-Single example above, the table appears along the entire bottom of the window, because Tab1 takes up the entire display area, whereas here Tab1 takes up only the upper left quadrant.



In Q-Scape modes, channel, math, memory, and zoom descriptors appear in the tab where the trace is open, while Timebase and Trigger descriptors remain outside the tabs, since they are not associated with any one trace.

Note: If you switch from Normal mode into any Q-Scape mode, all traces will move to Tab 1, from which you can drag-and-drop to redistribute them to other grids. In Q-Scape Single mode, you will not be able to drag-and-drop traces across tabs, only to other Tab1 grids.

To rename Q-Scape tabs after they open:

- 1. Touch-and-hold (right-click) on the **Tab** <**#**> until Rename pops up.
- 2. Touch **Rename**.
- 3. Enter the New Alias, then touch OK.

Extended Display

If an external monitor is installed, you can extend the display to take advantage of the greater screen area.

1. On the Display dialog, select Extend Grids Onto 2nd Monitor. The Select Grid pop-up opens.

Note: Extend Grids... only appears when a second monitor is connected. Configure Windows so that the instrument is the primary display and is extended, not duplicated.

- 2. Switch to the Extended Display submenu and choose a **Grid** style. Tab 1 and the external monitor will share the same grid style.
- 3. Drag-and-drop descriptor boxes to place traces on the desired grids.

0

Tip: To take advantage of more grid styles on the larger display, choose **File > Windowed** on the instrument, then grab the window title bar and drag it to the external monitor screen. Drag the Extended Display window to the instrument screen.

Grid Mode

In Normal Display Mode, select one Grid Mode. In Q-Scape Display Mode, select a Grid Mode for each tab. The selection icon shows the number and arrangement of grids.

Grid Mode	Number	Orientation	Notes
Auto (default)	variable	landscape	Automatically adds or deletes grids as traces turned on/off, up to the maximum supported
Single	1	landscape	All traces share one grid
Dual	2	landscape	One top, one bottom
Tandem	2	portrait	One left, one right
Triplex	3	landscape	Stacked top to bottom
Triad	3	portrait	Left, center, right
Quad	4	landscape	Stacked top to bottom
Quattro	4	landscape	One in each quarter of screen
Octal	8	landscape	Two columns of four stacked top to bottom
Twelve	12	landscape	Three columns of four stacked top to bottom
Sixteen	16	landscape	Four columns of four stacked top to bottom
XY	1	portrait	Single XY type grid
XYSingle	2	portrait	One VT grid left, one XY grid right
XYDual	3	variable	Two VT grids left, one XY grid right

0

Note: Additional grid modes may become available with the installation of software options.

Grid Intensity

To dim or brighten the background grid lines, touch **Grid Intensity** and enter a value from 0 to 100.

Grid on top superimposes the grid over the waveform.




Note: Some waveforms may be hidden from view with the grid on top.

Axis labels display the values represented by each division of the grid, based on your vertical scale and timebase. Turned on by default, they may appear as absolute values or delta from center (0). Deselect the checkboxbox to remove them from the display.

Trace Intensity

Choose a line style for traces: solid Line or disconnected sample Points.

When more data is available than can actually be displayed, Trace Intensity helps to visualize significant events by applying an algorithm that dims less frequently occurring samples. Touch **Intensity** and enter a value from 0 to 100.

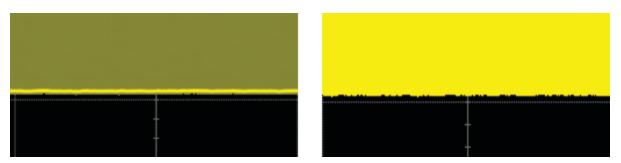

Intensity 40% (left) dims samples that occur ≤ 40% of the time to highlight the more frequent samples, vs. intensity 100% (right) which shows all samples the same.

XY Plots

XY plots display the phase shift between otherwise identical signals. They can be used to display either voltage or frequency on both axes, each axis now corresponding to a different signal input, rather than a different parameter. The shape of the resulting pattern reveals information about phase difference and frequency ratio.

Note: The inputs can be any combination of channels, math functions, or memories, but both sources must have the same X-axis scale.

Choose an XY grid mode and select the sources for Input X and Input Y.

Sequence Display Mode

Use these settings to select the <u>Display Mode</u> used when sampling in <u>Sequence mode</u>.

Persistence Display

The Persistence feature retains waveform traces on the display for a set amount of time before allowing them to gradually "decay," similar to the display of old phosphor screen oscilloscopes.

The Persistence display is generated by repeated sampling of the amplitudes of events over time, and the accumulation of the sampled data into display maps. These maps create an analog-style display. Statistical integrity is preserved because the duration (decay) is proportional to the persistence population for each amplitude or time combination in the data.

Use Persistence to accumulate on-screen points from many acquisitions to see your signal change over time. The persistence modes show the most frequent signal path in three-dimensional intensities of the same color (Analog), or graded in a spectrum of colors (Color). You can show persistence for any channel, math function, or memory.

Access the Persistence dialog from the Display dialog or by choosing **Display > Persistence Setup**.


Display	Persistence									🙁 CLOSE
Pers	sistence On	Cold	or Analog	3d	Intensity		Saturation	3D Set	tings	
L	.				40 %	26 %		Quality	MonoChrome	
A	All Locked				Persistence Time 0.5s			Solid	L	
F	Per Trace		Clear Sweeps				Dot Joined	Axis X Rotation	Axis Y Rotation	_4

Apply Persistence

- 1. Check Persistence On.
- 2. To set up all traces together, touch **All Locked**. This constrains all input channels to the same persistence settings.

To set up traces individually, touch **Per Trace**.

3. Use the buttons to select a persistence mode:

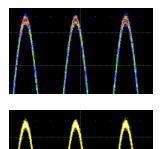


Color Mode persistence works on the same principle as Analog persistence, but instead uses the entire color spectrum to map signal intensity: violet for minimum population, red for maximum population. In this mode, all traces use all colors, which is helpful for comparing amplitudes by seeking like colors among the traces.

In **Analog Mode**, as a persistence data map develops, different intensities of the same color are assigned to the range between a minimum and a maximum population. The maximum population automatically gets the highest intensity, the minimum population gets the lowest intensity, and intermediate populations get intensities in

between these extremes. The information in the lower populations (for example, down at the noise level) could be of greater interest to you than the rest. The Analog persistence view highlights the distribution of data so that you can examine it in detail.

 3d Mode persistence creates a topographical view of your waveform from a selection of shadings, textures, and hues. The advantage of the topographical view is that areas of highest and lowest intensity are shown as peaks and valleys, in addition to color or brightness. The shape of the peaks (pointed or flat) can reveal further information about the frequency of occurrences in your waveform. You choose the **Quality** of the 3D display:



Solid quality can be either color or monochrome. Saturation is set at 50%, with hotter colors indicating highest intensity.



In the monochrome view of solid, the lightest areas indicate highest intensity, corresponding to the red areas in the color view.



In **shaded** (projected light) quality, the shape of the pulses is emphasized. This quality is monochrome only.



In **wire frame** quality, lines of equal intensity are used to construct the persistence map. This display can be either color or **Monochrome**.

In 3d mode, **X Axis Rotation** and **Y Axis Roation** can range 180° from -90° to +90°. In the examples above, the X-axis is rotated 60° an the Y-axis 15°.



Tip: To quickly rotate the graph, grab a corner of the persistence map and drag it in the desired direction.

- 4. Select the Saturation level as a percentage of the maximum population. All populations above the saturation population are assigned the highest color intensity: that is, they are saturated. At the same time, all populations below the saturation level are assigned the remaining intensities. Data populations are dynamically updated as data from new acquisitions is accumulated. A saturation level of 100% spreads the intensity variation across the entire distribution; at lower saturation levels the intensity will saturate (become brighter) at the percentage value specified. Lowering this percentage causes the pixels to be saturated at a lower population and makes visible those events rarely seen at higher saturation levels.
- 5. In **Persistence Time**, enter the duration of time (in seconds) after which persistence data is erased from the display.
- 6. Choose to superimpose the last waveform over the persistence display by selecting **Show Last Trace** (not available in 3d mode).
- 7. To display persistence traces as a continuous line (instead of a series of sample points), select **Dot Joined**.

Remove Persistence

To turn off persistence and return to the regular trace style, clear **Persistence On** or select an individual trace's **None** (left-most) persistence mode button.

Math and Measure

Teledyne LeCroy offers a rich set of standard, pre-programmed tools for the "quickest time to insight" into the characteristics of acquired waveforms. Most instruments calculate measurements for all samples in an acquisition, enabling you to rapidly and thoroughly calculate thousands or millions of parameter values and apply a variety of mathematical functions to the input waveform trace.

Cursors

Cursors are markers (lines, cross-hairs, or arrows) that identify voltage and time values on the waveform. Use cursors to make fast, accurate measurements of specific points in the waveform. There are five, standard <u>cursor types</u> available.

Vertical (amplitude) cursor readouts appear the trace descriptor box; Horizontal (time) cursor readouts appear below the Timbebase descriptor box.

Cursors can be placed on math functions whose X-axis has a dimension other than time, such as an FFT. When there is at least one non-time-domain math trace open, the <u>Standard Cursors dialog</u> contains an **X-Axis** control where you can choose the units measured by the horizontal cursors. The options will be appropriate to the types of function traces open; for example, if there is an FFT trace, there is an option for Hz. The cursor lines are placed on the traces that normally display X-axis values in the selected units.



Horizontal Relative cursors.

Cursor Types

Horizontal (Time) cursors intersect a point on the horizontal axis.

- Horizontal Abs displays a single, dashed, vertical line. The readout shows the absolute value at the cursor location.
- Horizontal Rel displays two, dashed, vertical lines. The readout may be in absolute values or a delta of the two points, depending on the Show option selected.

Vertical (Amplitude) cursors intersect a point on the vertical axis.

- Vertical Abs displays a dashed, horizontal line. The readout shows the absolute value at the cursor location.
- Vertical Rel displays two dashed, horizontal lines. As with Horizontal Relative cursors, the readout may show absolute values or a delta.

The **Both Rel**(ative) option places both Vertical and Horizontal relative cursors together.

Apply and Position Cursors

Apply Cursors

To turn on cursors, either:

- From the menu bar, choose **Cursors** and select the desired cursor type from the drop-down list.
- On the front panel, press the **Cursor Type** button repeatedly to cycle through all the cursor types. Stop when the desired type is displayed.

Note: There must be a waveform on the grid for cursors to execute, although acquisition may be in process or stopped when you turn them on.

To turn off cursors, choose Cursors > Off, or continue cycling the Cursor Type button until they disappear.

Position Cursors

The easiest way to reposition a cursor is to drag-and-drop the cursor marker to a new position. Indicators outside the grid show to which trace the cursor belongs when you have multiple traces on one grid.

Alternatively, turn the knob. If both vertical and horizontal cursors are turned on, push the knob until the correct line is selected, then turn to move it. When there are multiple traces each with its own cursors on the same grid, bring the desired trace to the foreground by touching the trace or its descriptor box. The Cursors knob will only operate on the foreground trace.

If Horizontal cursors are applied to a source trace but do not appear on its dependent traces (e.g., a zoom) because of differences in scale, you can drag-and-drop the cursor readout from below the Timebase descriptor box onto the target trace or its descriptor box. This applies the same cursors at

the 5 (for single cursors) or 2.5 and 7.5 (for relative cursors) division marks of the target trace and adjusts the source cursors accordingly.

Note: Horizontal Relative cursors are initially placed one on the negative side of the X-Axis (marked by a \downarrow down arrow) and one on the positive side (marked by an 1 up arrow). If you move the negative cursor to the right of the positive cursor, or the positive cursor to the left of the negative cursor, the delta will be shown in negative increments.

Use the **Position** data entry controls on the <u>Standard Cursors dialog</u> to place cursors precisely.

Standard Cursors Dialog

These controls can be used instead of the front panel controls to set cursors or to refine the cursor position. Access the dialog by choosing **Cursors > Cursors Setup** from the menu bar.

Standard Cursors			CLOSE
	Cursor Type	Show	Position
Cursors On	Horiz Abs Horiz Rel Both Rel	Absolute Delta $\begin{array}{c} Y_1 / \uparrow \\ \downarrow / Y_2 \end{array}$ Abs+Delta $\begin{array}{c} Y_2 / \uparrow \\ \downarrow / \chi_2 \end{array}$ $\begin{array}{c} Abs+\Delta v \end{array}$	Y1 2.00 div -125.00 ns -2.00 div -125.00 ns -2.00 div -2.00 div -2.20 div -2.20 div

Cursors On displays or hide cursor lines. When first checked, the last selected cursor type is displayed.

<u>Cursor Type</u> buttons select the type of cursor displayed on the grid.

The **Show** controls determine which values are shown in the readout, particularly when using relative cursors:

- Absolute shows specific voltages for the two cursor locations.
- **Delta** shows the difference between the specific voltages at the cursor locations.
- Abs+Delta shows both the absolute and delta readouts.
- **Slope** (Horizontal Relative only) shows the slope of the waveform between the cursor locations.

The **Position** controls at the right-side of the Standard Cursors dialog display the current cursor location and can be used to set a new location. The options available depend on the Cursor Type settings.

- X 1 (negative) and X 2 (positive) sets time from the zero point.
- Y 1 (negative) and Y 2 (positive) sets number of divisions from the zero level. May be a fraction of a division.
- **Track** locks cursor lines so they move together, maintaining their same relative distance from each other.


Measure

Measurement parameters are tools that give you access to a wide range of waveform properties. Use them to analyze many attributes of your waveform such as rise-time, rms voltage, and peak-to-peak voltage. Measurements can also be graphed as histrogram, track, or trend to facilitate analysis.

The instrument offers a quick selection of standard horizontal and vertical measurements, or you can create a custom set of parameters (My Measure) drawn from all available <u>measurements</u>.

Measure Table

Measurement readouts appear in a table below the grid. The **value** row shows the measurements taken for each parameter on the last cycle of the last acquisition. Other rows show optional statistics.

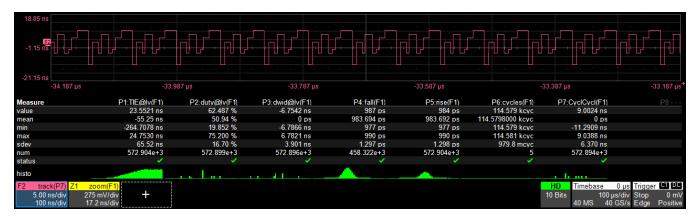

Measurement Status Indicators

Symbols in the status row of the Measure table indicate the following:

Symbol	Description
A .	Problem with the signal or the setup. Touch cell to see explanation in message bar.
×	Valid value returned.
ж	Unable to determine top and base; however, measurement may still be valid.
ж	Underflow condition.
采介	Overflow condition.
X()	Simultaneous underflow and overflow condition.

Navigating with the Table

Close setup dialogs when the Measure table is displayed to maximize the touch screen area available for viewing waveforms. The table can be used to quickly access setup dialogs and make modifications. To open the <u>Parameter Setup (Px) dialog</u>, touch the Px cell of the table. Touch the far left Measure column to open the <u>Measure dialog</u> and modify the table contents. The table is static when using the standard measurements, as these cannot be changed.


Quick Table Setup

Any parameter can be copied by dragging the cell onto the target cell of the table. Then, drag the desired measurement source descriptor box onto the new parameter. Touch the cell to make any other modifications on the Px dialog.

Measure Dialog

The Measure Dialog gives quick access to measurement display features. Besides turning on/off parameters, use the Measure dialog to show <u>Statistics</u>, <u>Histicons</u>, or <u>Help Markers</u> for standard and user-defined parameter sets. You can also <u>Gate</u> standard parameters to limit the horizontal scope of the measurement. All standard parameters will share the same gate. (Use the Px dialogs to gate user-defined parameters.)

To open the Measure dialog, touch the **Add New** box and select **Measurement**, or choose **Measure > Measure Setup** from the menu bar.

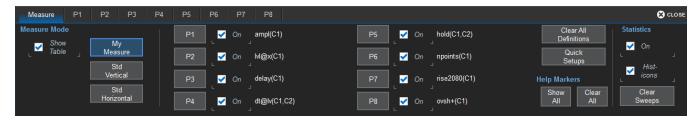

Parameter Sets

Pre-configured standard parameter sets are available for quick display. Choose either:

- Std Vertical: mean, sdev, max., min., ampl, pkpk, top, base.
- Std Horizontal: freq, period, width, rise, fall, delay, duty, num points.

To define your own parameter set, choose **My Measure**. Open the <u>Px dialogs</u> to define new parameters. Once parameters are configured, , select the **On** checkbox next to each parameter to turn on the measurement.

To quickly begin a new parameter set based on the standard vertical or horizontal sets, touch **Quick Setups** and choose the set to copy. Refine the settings on the <u>Px dialogs</u>. Touch **Clear All** to remove all measurement definitions.



Caution: Measurement definitions cannot be restored after clearing. You must repeat the manual set up.

Statistics

Checking **Statistics On** adds the measures mean, min., max., sdev, and num(ber of measurements computed) to the table.

For any parameter that computes on an entire waveform (like amplitude, mean, minimum, maximum, etc.) the num statistic represents the number of sweeps.

For any parameter that computes on every event, the num statistic represents the number of events per acquired waveform. If *x* waveforms were acquired, num is *x* times the number of cycles per waveform.

To reset the statistics counter, touch **Clear Sweeps** on the display or front panel.

Histicons

Histicons are miniature histograms of measurement parameters that appear on the measurement table. These thumbnail histograms let you see at a glance the statistical distribution of each parameter. Select the **Histicons** checkbox to turn on histicons.

Tip: You can quickly display a full histogram by touching the histicon you want to enlarge.


Help Markers

Help Markers clarify measurements by displaying lines, labels and hysteresis bands to mark the points being measured on the trace. For "@Level" parameters, markers make it easier to see where your waveform intersects the chosen level.

You can choose to use **Simple** markers, which are only the lines, or **Detailed** markers, which include the measurement point labels.

You also have the option, by means of the **Always On** checkbox, to leave the markers displayed over traces after you have closed the Measure dialogs or readout table. If you change the set of parameters displayed, the markers will change, as well.

Note: Unlike regular cursors, which are white and can be moved, help markers are blue and only augment the display; they cannot be moved, and they do not reset the measurement points. Some optional analysis software packages include markers designed specially for that domain of reference, which are documented in the option manual.

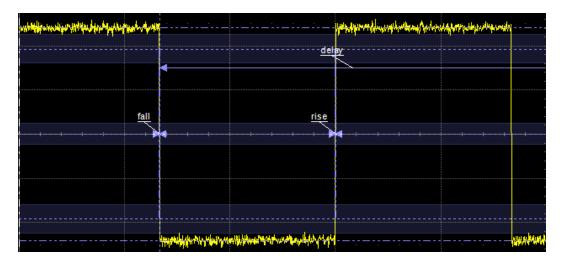

Detailed Help Markers on standard horizontal parameters.

Parameter Set Up

Use the Px dialogs to define a new set of measurement parameters ("My Measure").

You may also define parameters using <u>Math on Parameters</u> or the <u>Web Editor</u>.

1. From the menu bar, choose **Measure > Measure Setup**. On the Measure dialog, select **Show Table** to display the readout on screen.

To quickly reopen the Measure Setup dialog, touch any cell of the Measure readout table.

- 2. Choose Measure Mode **My Measure**.
- 3. Open the **Px tab** of an unused location (or one that you want to change).
- 4. Check **On** to enable the parameter and add it to the measurement readout table.

Measure P1 P2	P3 P4 P5 P6 P7 P8	Dtime@level 1 Dtime@level 2 Gate Accept 😵 CLOSE
On J Type	Source1 Measure C1 Dime@level 4	Time between selectable levels on 2 waveforms.
+ - math on	Source2 C2 dt@h(C1,C2)	Level type Percent level Find level
* + parameters advanced web edit	Actions for P4	Slope Hysteresis Pos500 mdiv

- 5. Select the Type Measure On Waveforms.
- 6. Touch **Source1** and select the channel, math trace, memory trace, or other waveform to be measured.
- 7. Touch the **Measure** field and select the measurement from the pop-up menu.
- 8. Enter the measurement **Level** and **Type** (percent or absolute) when it appears on the parameter subdialogs (e.g., for @Level parameters).
- 9. For certain time-based measurements, choose to measure on the positive, negative, or both **Slope**(s). For two-input parameters, such as Dtime@level, you can specify the slope for each input, as well as the level and type.
- 10. Make any further selections on the subdialogs that appear after your Measure selection. These are explained on the dialog and are necessary to fully define the selected measurement.
- 11. Optionally, turn on Help Markers, or use the parameter subdialogs to:
 - Gate measurements (limit the horizontal scope of the measurement)
 - Qualify measurements (accept only measurements that meet additional conditions)

Gating Measurements

By using gates, you can narrow the span of the waveform on which to perform tests and measurements, allowing you to focus on the area of greatest interest. For example, if you "gate" five rising edges of the waveform, rise time calculations are performed only on the five pulses bounded by the gate posts.

The default starting positions of the gate posts are 0 div and 10 div, which coincide with the left and right ends of the grid. Therefore, the gate initially encloses the entire waveform.

The quickest way to set a gate is to drag the gate posts from the far left and right of the grid to the desired positions. You can refine this setting by specifying a position down to hundredths of a division using the **Gate Start** and **Stop** fields.

Touch the **Default** button to return gates to the width of the trace.


Qualified Measurements

Some measurements can be constrained to a vertically or horizontally limited range, or to occurrences gated by the state of a second waveform. Both constraints can operate together. This capability enables you to exclude unwanted characteristics from your measurements. It is much more restrictive than a <u>measure gate</u>, which is used only to narrow the span of analysis along the horizontal axis.

0

Note: Since this feature operates on only a subset of the data, possible alerts or status indicators concerning the measurement (such as "Data range too low") are not displayed.

If the measurement supports this feature, you will see the Accept subdialog next to the Px dialog for you to define your constraints.

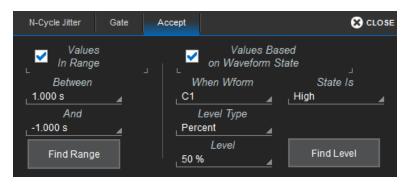

Range Limited Parameters

- 1. From the menu bar, choose **Measure > Measure Setup...**, then touch the **Px** tab to open the parameter setup dialog.
- 2. On the **Accept** subdialog, select **Values In Range** and enter the start and stop values, or touch the **Find Range** button to quickly display the most recently measured range of values.

Note: Depending on whether it is a vertical or horizontal measurement, the correct units are automatically displayed (V, s, Hz, dB) in Between and And. If you select a simple ratio parameter (such as power factor) that yields a dimensionless number, no units will be displayed.

Waveform Gated Parameters

- 1. From the menu bar, choose **Measure > Measure Setup**, then touch the **P***x* tab to open the parameter setup dialog.
- 2. On the Accept subdialog, select Values Based on Waveform State.
- 3. Touch **When Wform** and select the gating waveform. It can be any waveform active at the same time as the measurement source waveform.
- 4. Touch **State Is** and select **High** or **Low** from the pop-up menu. Measurements will only be taken when the gating waveform is in the selected state.
- 5. Touch **Level Type** and select **Absolute** (voltage) or **Percent** (of amplitude) from the pop-up menu.
- 6. Enter the crossing Level value at which you want measurements to begin.

You can also touch the **Find Level** button to automatically set the level at 50% of the gating waveform.

Math on Parameters

In addition to measuring waveforms, you can set up a parameter that performs mathematical operations on other measurements.

The setup for Math on Parameters is much like that for other parameters. Some parameters can also be qualified on the Accept dialog using value ranges or gating waveforms, as can regular waveform measurements.

Math on Parameters differs from Math functions in that the input and the output are still numerical values that display in the measurement readout table. Math functions, on the other hand, input and output waveform traces that appear on the grid.

Exclusions

The parameter math feature prevents multiplication and division of parameters that return logarithmic values.

Parameters that are already the result of parameter math operations are also excluded. If they are included in a remote control setup command, an error message is generated and the setup canceled.

Set Up Math on Parameters

- 1. From the menu bar, choose **Measure > Measure Setup...**.
- 2. Choose Measure Mode **My Measure** and open a parameter setup (Px) dialog.
- 3. Touch the **Math on Parameters** button.
- 4. Touch Math Operator and choose an operation from the Select Measurement menu.
- 5. Touch the **Source** fields and select the parameters that are the inputs to the measurement. These should be other parameters than that you are now using for Math on Parameters.
- 6. Check **On** to enable the new output parameter and add it to the measurement readout.

Using Web Editor

Whereas with Math on Parameters you can apply a single math operation to a measurement parameter, the Web Editor enables you to create custom processes that potentially chain many operations and apply them to the output of a single parameter or math function. These processes are integral to the operation of the instrument; there is no need to export data to other programs.

Processes are "programmed" in the X-Stream application simply by dragging and dropping a series of blocks representing different math functions or measurements and connecting them to form a flow chart—a "processing web." The parameter value shown in the Measure table represents the numeric result of this process flow applied to the raw, acquired sample. Math functions would likewise display the waveform trace that results from the process.

Create Processing Web

- 1. From the menu bar, choose **Measure > Measure Setup**.
- 2. On the Measure dialog, choose Measure Mode My Measure.
- 3. Open the **P***x* dialog of an unused parameter (or one that you want to change) and select **Advanced Web Edit**.

Measure	P1 P2 F	P3 P4 P5 P6 P7 P8		8	CLOSE
	J Type measure on waveforms	Show Processing Web	When in 'Web Edit' mode use the processing web to define function processing. Summary	Solori montre constan	
	math on parameters	Actions for P1	web edit	Select measure operator using the Measure control	
	advanced web edit	Histogram	Markers Always On		

4. Touch the **Show Processing Web** button. You will see a "peg board" display with potential input sources aligned along the left, and a terminal marked with the parameter number to the far right.

On the Source Filter subdialog, deselect any types (e.g., zooms) that you do not want to use in the process. This simplifes the display and reduces the need to scroll.

Math and Measure

🛱 File 🏾 🎗 Vertical	↔ Timebase 🕴 Trig	ger 🛛 📼 Display	🖉 Cursors 📗	Measure 🛛 🖬 Math	🗠 Analysis	🗙 Utilities	 Support 			
C1										
C2										
C3										
C4 💙										
F1										
F2										
F3 🛃										
F4										
F5 📫 🗛 🖓 🖓										P1
F6 📫										
F7 🔶										
F8 📫										1
P1										
P2										
P3 🛉										
P4										
P5 📫										
P6 📫										
P7 📫										
P8 📫										
										· · · ·
Web Editor Ma	th Measure						Source Filter			🙁 CLOS
Add P	rocessing Nodes						Enable/Disable I	nput Sources		
	Add new math comp	onent					🖌 Channels		Measure	
+ Wath	+ Math to the processing web + Meas. Add new measurement to the processing web		Add Prev	Add Previewed nodes appear only in the Web Editor.			∟ ✓ Math			
+ Meas.							_ Zoom			
+ PMath	Add new parameter r the processing web	nath to	Delete				∟ Memory			


- 5. On the Wed Editor dialog, choose the type of process to add to the flow. You can **Add Math**, **Add Measure**, or **Add Param Math** (Math on Parameters).
- 6. From the pop-up, choose the operation or measurement that will occur at that node. A new block appears on the display. Drag the block to a location in the flow.

Touch the location to place a green plus sign before adding the node. Then, the new block will be created at this spot. Otherwise, blocks may cover one another until they are moved.

7. The process block will have a input "pin" on the left. If a waveform is required, the pin is blue; if a number is required, the pin is purple. Touch and drag a matching colored pin from the sources on the left of the screen to the block. Choose as many sources as there are input pins on the block.

You may need to use the scrollbar to see all the available sources. For convenience, the Math and Measure dialogs behind the Web Editor dialog summarize what is currently configured for those sources.

When you drop the pin, a line is drawn from the source to the process. If a source is incompatible with a process, you will not be able to pin it.

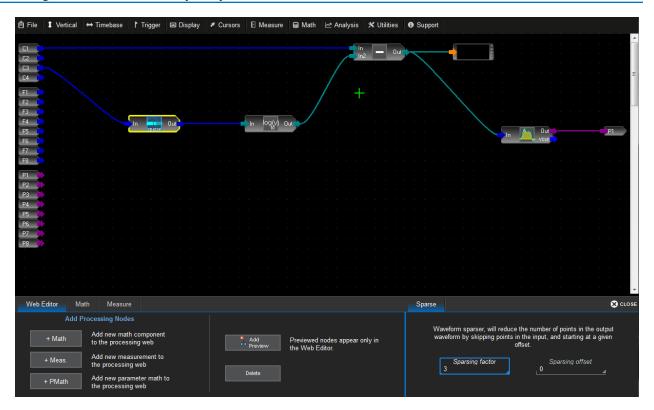

- 2. If the process requires additional configuration, a subdialog appears next to the Web Editor dialog. Use it to enter the values to apply to that processing node.
- 3. Continue to add processes as needed, pinning the output of each block to the input of the next block in the flow. The final process should be the same type as the terminal (in this example, a measurement).
 - Note: The flow does not need to be strictly sequential, as many processes can accept multiple inputs that may or may not have undergone other processes. The only requirement is that the outputs are pinned to acceptable inputs. The color of the input/output arrows indicates which connections are compatible.
- 4. Drag the output pin from the final process block to the input pin on the terminal to complete the flow.

Preview Outputs

You can add preview "windows" to see the output of a process at any stage in the flow. These previews apply only to the Web Editor.

Select the output pin of the processing block you wish to preview. It will turn bright green. Then, on the Web Editor dialog choose **Add Preview**.

Delete Process/Connection

To delete any process from the web, select the block then touch **Delete**. All the connections to/from it are automatically deleted.

To remove a connection between process blocks, touch the line. A scissor icon appears above it. Confirm whether or not to "cut" the connection.

Add Other Terminals to Processing Web

Other measurements or math functions can share the same processing web. For example, you may wish to create a math function of the waveform that would result from a sub-processing node, while the final output of the full process is a measurement parameter.

To add a terminal:

- 1. Open the Math or Measure dialog behind the Web Editor dialog.
- 2. Touch the Web Edit icon following the location (Px or Fx). The summary changes to Web Edit, and a new terminal block appears on the Web Editor peg board.
- 3. Connect the output pin of the desired process to the input pin of the terminal. You can select outputs that are already pinned to other blocks.

Graphing Measurements

Measurements can be viewed in several graphical formats to facilitate your analysis:

- Histograms display the distribution of measured values for a given parameter as a bar chart.
- **Tracks** provide a time-correlated view of a measurement parameter compared to other acquired channels or calculated math traces. A common usage for track is to observe the modulation of a signal, such as amplitude, frequency, or pulse width modulation.
- **Trends** provide a view of a measurement parameter over an extended period of time and over multiple acquisitions.

Action buttons at the bottom of the the Parameter (Px) dialogs let you quickly draw these plots for the respective measurement.



Although these graphs plot measurement values, they are generated on the display as math functions (Fx) and can be set up through either the Measure or Math dialogs.

Histogramming

Histograms graphically divide data points into intervals, or bins. These bins are plotted on a bar chart such that the bar height relates to the number of data points within each bin.



Histograms can be created to visualize the results of measurement parameters or math functions. Regardless of the source, the histogram is created as a Histogram function (Fx) trace, and the number of sweeps (k#) comprising the histogram is shown on the function descriptor box. The Phistogram function creates a histogram

of a persistence display.

The range of a histogram is limited to the portion of the (measurement or math) source trace that is visible on screen. If you zoom in on a trace, the histogram does not contain data for the no longer visible parts of the original trace.

Thumbnail versions of measurement parameter histograms are called <u>Histicons</u>. They are available as a checkbox option on the Measure dialog. Histicons appear on the measurement parameter table, rather than as a new math trace.


Histogram Function

To create a histogram of a measurement:

1. Open the parameter setup (Px) dialog for the measurement you wish to histogram.

A quick way to do this is to touch the measurement table cell.

- 2. Touch the **Histogram** toolbar button at the bottom of the Px dialog and choose the function location (**Fx**) in which to display the histogram. The histogram opens in a new grid along with its function descriptor box.
- 3. Touch the new hist descriptor box to display the Fx dialog, then open the Histogram subdialog.

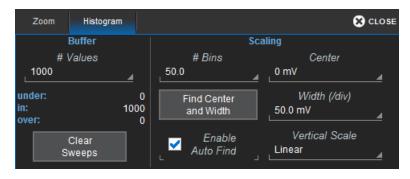

- 4. Enter the maximum **#Values** in one bin of the histogram. This determines the number of samples that are represented by the bar at full height.
- 5. Touch **#Bins** and enter the number of bins that comprise the histogram. This determines how many bars appear in the histogram.
- 6. To let the software determine the range of values represented by each bin/bar, check **Enable Auto Find**, then touch the **Find Center and Width button**.

To set your own range, enter **Center** and **Width** values.

- 7. Choose a Vertical Scale method:
 - Linear allows the histogram to build vertically as data accumulates. When the histogram reaches the top of the display, it rescales the vertical axis to keep it on screen
 - LinConstMax keeps the histogram at near full scale and rescales the vertical axis as data is accumulated.

Phistogram Function

The Phistogram function creates a histogram of the samples within a horizontal or vertical "slice" of a persistence map. You must <u>apply persistence</u> to the function source trace to generate the persistence map.



Note: This operation is different than the Histogram math operation and is not affected by Center and Width settings made on any existing Histograms.

- 1. Follow the usual steps to set up a math function, choosing a **Single** operator function using the **Phistogram** operator.
- 2. On the **Phistogram** subdialog, enter values to select the slice of the persistence map to histogram:
 - Slice Direction of determines whether the slice transverses the entire height of the map centered around a time (vertical), or transverses a period of time in the map centered around a level (horizontal).
 - Slice Center represents the center time or level of the slice.
 - Slice Width represents the total time or amplitude of the slice, half each side of the center.
- 3. Choose to **Center Cursor** to place a measurement cursor at the center of the slice.

Zoom Phistogram			Ӿ CLOSE
Histogran Slice Center _ <mark>0 s</mark> Slice Width	n of a slice	of a persistence map Slice Direction Vertical	4
_10.000000 ns			
		Center Cursor	

Track and Trend

Both Track and Trend are tools that can be used to plot measurement data and observe variations with respect to time. The table below summarizes their differences.

In general, Track is the tool to use if you want to capture a continuous stream of data spaced closely together.

To understand the change in a parameter with time, Trend can be used if your data is spaced widely apart and longer than the dead-time between acquisitions. Think of Trend as a strip chart recorder for your instrument.

Characteristic	Track	Trend	
Representation	Parameter value vs. time	Parameter value vs. event	
Behavior	Non-cumulative (resets after every acquisition). Unlimited number of events	Cumulative over several acquisitions up to 1 million events	
Time Correlation to Other Data	Yes	No	
Monitors an Evolution in the Fre- quency Domain	Yes	No. Trend points are not evenly spaced in time and therefore cannot be used for an FFT.	
Monitors the Evolution of a Meas- urement Parameter over Several Acquisitions	No. Track resets after every acquis- ition.	Yes	
Ensures No Lost Measurement Data	Yes. Maximum time period that can be captured is limited by acquisition memory and sampling rate.	No. Since data can be accumulated over many acquisitions, and since the instrument takes time to calculate measurement values and to display data before the trigger is re-armed, data can be missed.	

HDO9000 High Definition Oscilloscopes Operator's Manual


Track

A Track is a plot composed of parameter measurements that is time synchronous with the source waveform. The vertical units are those of the source parameter and the horizontal units are seconds. In order to maintain time synchronism, the parameter values are posted at the sampling rate. Track values are redundant in that the same value is repeated every sample period until the measurement changes.

1. Open the parameter setup (Px) dialog for the measurement you wish to track.

A quick way to do this is to touch the measurement table cell.

- Touch the Track toolbar button at the bottom of the Px dialog and choose the function location (F1-F12) in which to display the plot. The track opens in a new grid along with its function descriptor box.
- 3. Touch the new **Track descriptor box** to display the Fx dialog, then open the **Track subdialog**.

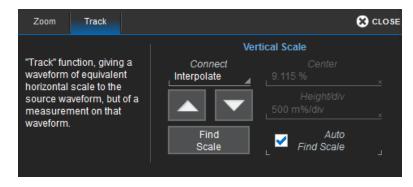

- 4. On the Track subdialog, **uncheck Auto Find Scale** and enter a new **Center** and **Height/div**. You can also use **Find Scale** to automatically find suitable values.
- 5. Choose a line **Connect** function of either Interpolate or Extend.


Trend

A Trend is a plot composed of a series of parameter measurements in the order the measurements were taken. The vertical units are those of the source parameter, the horizontal unit is measurement number. The Trend contains a single value for each measurement. Trends are especially useful for visualizing the history of a parameter over an extended period of time or over multiple acquisitions.

1. Open the parameter setup (Px) dialog for the measurement you wish to histogram.

A quick way to do this is to touch the measurement table cell.

- 2. Touch the **Trend button** at the bottom of the Px dialog and choose the function location (**Fx**) in which to display the plot. The Trend opens in a new grid along with its function descriptor box.
- 3. Touch the new **Trend descriptor box** to display the Fx dialog, then open the **Trend subdialog**.

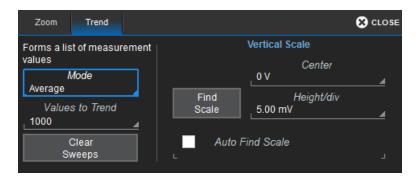

- 4. Choose a computation **Mode** of All (plots multiple points per acquisition) or Average (plots one point per acquisition). Enter the number of measured **Values to Trend**.
- 5. To rescale the Trend, uncheck **Auto Find Scale** and enter the new **Center** and **Height/div** values. You can also use **Find Scale** to automatically find suitable values.

List of Standard Measurements

The measurements included standard with your instrument are listed below alphabetically.

Note: Additional measurements may be available depending on the software options installed.

Measurement	Description		
Amplitude (ampl)	Measures the difference between upper and lower levels in two-level signals. Differs from pkpk in that noise, overshoot, undershoot, and ringing do not affect the measurement. Amplitude is calculated by using the formula Top – Base. On signals not having two major levels (such as triangle or saw-tooth waves), the amplitude parameter returns the same value as peak-to-peak.		
Area	Integral of data. Computes area of the waveform relative to zero level. Values > zero contribute positively to the area; values < zero, negatively.		
Base	Lower of two most probable states (higher is top). Measures lower level in two-level signals. Dif- fers from min in that noise, overshoot, undershoot, and ringing do not affect measurement. On signals not having two major levels (such as triangle or saw-tooth waves), the amplitude para- meter returns the same value as minimum.		
Bit Rate	Bit rate of serial data stream.		
Cycles (cycles)	Determines number of cycles of a periodic waveform lying between cursors. First cycle begins at first transition after the left cursor. Transition may be positive- or negative-going.		
Delay	Time from trigger to transition: Measures time between trigger and first 50% crossing of spe- cifies signal. Delay can be used to measure the propagation delay between two signals by trig- gering on one and determining delay of other.		
Delta Delay (ddelay)	Computes time between 50% level of two sources.		
Dperiod@level (dper@lv)	Adjacent cycle deviation (cycle-to-cycle jitter) of the period measurement for each cycle in a waveform. The reference level for this measurement can be specified.		
Dtime@level (dt@lv)	Computes the time between transitions of the selected sources at the specified levels. Only po itive going transitions are counted.		
Dtrig Time (dtrig)	Time from last trigger to this trigger		
Duration (dur)	For single sweep waveforms, dur is 0; for sequence waveforms: time from first to last segment's trigger; for single segments of sequence waveforms: time from previous segment's to current segment's trigger; for waveforms produced by a history function: time from first to last accumulated waveform's trigger.		
Duty Cycle	Percent of period for which data are above or below the 50% level of the signal.		
Duty@level (duty@lv)	Percent of period for which data are above or below a specified level.		
Dwidth@level	Difference (delta) between adjacent widths above or below a specified level.		
Edge@level (edge@lv)	Number of positive edges in waveform that cross the specified threshold level.		
Edge to Edge	Delta time between some edge on the first source to some (other) edge on a second source.		
Fall 80-20% (fall8020)	Duration of pulse waveform's falling transition from 80% to 20% of the amplitude averaged for all falling transitions between the measurement gates. On signals not having two major levels (triangle or saw-tooth waves, for example), top and base can default to maximum and minimum, giving less predictable results.		

Measurement	Description		
Fall time (fall)	Duration of pulse waveform's falling transition from 90% to 10% of the amplitude averaged for all falling transitions between the measurement gates. On signals not having two major levels (triangle or saw-tooth waves, for example), top and base can default to maximum and minimum, giving less predictable results.		
	Fall at level: Duration of pulse waveform's falling edges between user-specified transition levels.		
Fall@level (fall@lv)	Thresh. Remote Lower Upper Default Lower Low 1% 45% 10% Upper High 55% 99% 90%		
	Threshold arguments specify two vertical values on each edge used to compute fall time: lower = lower thresh. x amp/100 + base upper = upper thresh. x amp/100 + base		
First	Indicates value of horizontal axis at left cursor.		
Frequency (freq)	Period of cyclic signal measured as time between every other pair of 50% crossings. Starting with first transition after left measurement gate. The period is measured for each transition pair. The reciprocal of each period measurement is calculated as the frequency.		
Freq@level (freq@lv)	Period of cyclic signal measured as time between every other pair at the specified level. Start- ing with first transition after left measurement gate. The period is measured for each transition pair. The reciprocal of each period measurement is calculated as the frequency.		
FWHM	Measures the width of the largest area histogram peak at half of the populationof the highest peak.		
FWxx	Measures the width of the largest area histogram peak at xx% of the population of the highest peak.		
Half Period (hper)	Half period of a waveform.		
Hist ampl (hampl)	Difference in value between the two most populated peaks in a histogram.		
Hist base	Value of the left-most of the two most populated histogram peaks.		
Hist max pop	Peak with maximum population in a histogram.		
Hist maximum	Value of the highest (right-most) populated bin in a histogram.		
Hist mean	Average or mean value of data in a histogram.		
Hist median	Value of the 'x' axis of a histogram that divides the population into two equal halves.		
Hist minimum	Value of the lowest (left-most) populated bin in a histogram.		
Hist mode	Position of the highest histogram peak.		
Hist pop@x	Population at bin for specified horizontal coordinate.		
Hist range	Calculates range (max-min) of a histogram.		
Hist rms	Root mean square of the values in a histogram.		
Hist sdev	Standard deviation of values in a histogram.		
Hist top	Value of the right-most of the two most populated histogram peaks.		
Hist X@peak	Value of the <i>n</i> th highest histogram peak. You supply the value of <i>n</i> .		
Hold Time	Time from the clock edge to the data edge.		
Last	Time from trigger to last (rightmost) cursor.		

HDO9000 High Definition Oscilloscopes Operator's Manual

Measurement	Description		
Level@X (Ivl@x)	Gives the vertical value at the specified <i>x</i> position. If the <i>x</i> position is between two points, it gives the interpolated value. When the Nearest point checkbox is selected, it gives the vertical value of the nearest data point.		
MATLAB param	Custom MATLAB function that produces a measurement. Requires XDEV option to edit func- tions through the oscilloscope GUI using MATLAB Script.		
Maximum (max)	Measures highest point in waveform. Unlike top, does not assume waveform has two levels.		
Mean	Average of data for time domain waveform. Computed as centroid of distribution for a histogram of the data values.		
Median	The average of base and top values.		
Minimum (min)	Measures the lowest point in a waveform. Unlike base, does not assume waveform has two levels.		
N-cycle Jitter	Peak-to-peak jitter between edges spaced <i>n</i> UI apart.		
NBPhase	Provides measurement of the narrow band phase at a specific frequency of the waveform.		
NBPower	Provides measurement of the narrow band power at a specific frequency of the waveform.		
None	Disables parameter calculation		
Num Points (npoints)	Number of points in the waveform between the measurement gates.		
Overshoot-	Amount of overshoot following a falling edge. This is represented as percentage of amplitude. Overshoot- is calculated using the formula (base - min.)/ampl x 100. On signals not having two major levels (triangle or saw-tooth waves, for example), may not give predictable results.		
Overshoot+	Amount of overshoot following a rising edge specified This is represented as a percentage of amplitude. Overshoot+ is calculated using the formula (max top)/ampl x 100. On signals not having two major levels (triangle or saw-tooth waves, for example), may not give predictable results.		
Peak to Peak (pkpk)	Difference between highest and lowest points in waveform. Unlike ampl, does not assume the waveform has two levels. Peak to peak is calculated using the formula <i>maximum – minimum</i> .		
Peaks	Number of peaks in a histogram.		
Percentile (pctl)	Horizontal data value that divides a histogram so the population to the left is xx% of the total.		
Period	The time between every other pair of 50% crossings. Starting with first transition after left measurement gate, period is measured for each transition pair, with values averaged to give final result.		
Period@level (per@lv)	The time between every other pair of at the level specified. Starting with first transition after left measurement gate, period is measured for each transition pair, with values averaged to give final result.		
Phase	Phase difference between signal analyzed and signal used as reference. Both signals are measured from the 50% point of their rising edges.		
Rise 20-80% (rise2080)	Duration of pulse waveform's rising transition from 20% to 80% of the amplitude averaged for all rising transitions between the measurement gates. On signals not having two major levels (triangle or saw-tooth waves, for example), top and base can default to maximum and minimum giving less predictable results.		
Rise Time	Duration of pulse waveform's rising transition from 10% to 90% of the amplitude averaged for all rising transitions between the measurement gates. On signals not having two major levels (triangle or saw-tooth waves, for example), top and base can default to maximum and minimum, giving less predictable results.		

Measurement	Description		
Rise@level (rise@lv)	Duration of pulse waveform's rising edges between user-defined transition levels. Threshold arguments specify two vertical values on each edge used to compute rise time: lower = lower thresh. x amp/100 + base upper = upper thresh. x amp/100 + base		
RMS	Root Mean Square of data (between gates) calculated using the formula: $\sqrt{\frac{1}{N} - \sum_{j=1}^{N} (v_j)^2}$ Where: vi denotes measured sample values, and N = number of data points within the periods found up to maximum of 100 periods.		
Setup	Time from the data edge to the clock edge.		
Skew	Time of Clock2 edge (nearest to Clock1) minus time of Clock1 edge. "Clock" refers to specified edge and level of any two sources, data signals included.		
Slew Rate (slew)	Slew rate or local dV/dt in a transition zone		
Std Dev (sdev)	Standard deviation of the data between the measure gates using the formula: $\sqrt{\frac{1}{N}\sum_{l=1}^{N} (v_l - mean)^2}$ Where: vi denotes measured sample values, and N = number of data points within the periods found up to maximum of 100 periods. This is equivalent to the rms for a zero-mean waveform. Also referred to as AC RMS		
TIE@level (tie@lv)	Difference between the measured times of crossing a given slope and level and the ideal expected time. For Slope you can choose positive, negative, or both. For output units you can choose time or unit interval (UI). A unit interval equals one clock period. The Virtual Clock setup gives you a choice of Standard (1.544 MHz) or Custom reference clocks. You can also use a mathematically derived Golden PLL to filter low frequency jitter. The cutoff frequency is user selectable.		
Time@level (time@lv)l	Time from trigger (t=0) to crossing at a specified level.		
Тор	Higher of two most probable states (base is lower). Measures higher level in two-level signals. Differs from max in that noise, overshoot, undershoot, and ringing do not affect measurement. On signals not having two major levels (such as triangle or saw-tooth waves), the amplitude parameter returns the same value as minimum.		
Total Pop (totp)	Total population of a histogram.		
Width	Width of cyclic signal determined by examining 50% crossings in data input. If first transition after left cursor is a rising edge, waveform is considered to consist of positive pulses and width the time between adjacent rising and falling edges. Conversely, if falling edge, pulses are considered negative and width the time between adjacent falling and rising edges. For both cases, widths of all waveform pulses are averaged for the final result.		
Width@level (wid@lv)	Width measured at a user-specified level.		
WidthN (widn)	Time of cyclic signal determined by examining 50% crossings in data input. The widthN is measured from falling edge to rising edge.		
X@max	Determines the horizontal axis location of the maximum value between the measure gate.		
X@min	Determines the horizontal axis location of the minimum value between the measure gate.		

EMC Pulse Parameter Software Package

The EMC option enhances the oscilloscope's measurement functionality for the @level parameters Rise@Level, Fall@Level, Width@Level, Time@Level, and dTime@level.

In addition to setting the Level for these measurements using the absolute voltage or percentage of amplitude based on the <u>computed Top and Base Lines</u>, you may set Level using:

- actual Peak to Peak
- 0V Max
- 0V Min

Once the option is activated, the new selections are added to the Level pop-up menu. Otherwsise, parameters are configured exactly the same as with other measurements.


Histogramming is also enhanced with the ability to plot up-to-2-billion events when configuring the histogram and the addition of 19 histogram-specific measurements. To set up one of these measurements in a parameter location, select the Math function (F*x*) location of the histogram as the measurement Source.

Calculating Measurements

The instrument uses the following methods to calculate measurements.

Determining Top and Base Lines

Proper determination of the top and base reference lines is fundamental for ensuring correct parameter calculations. The analysis begins by computing a histogram of the waveform data over the time interval spanned by the left and right measurement gates. For example, the histogram of a waveform transitioning in two states will contain two peaks (see figure). The analysis will attempt to identify the two clusters that contain the largest data density. Then the most probable state (centroids) associated with these two clusters will be computed to determine the top and base reference levels: the top line corresponds to the top and the base line to the bottom centroid.

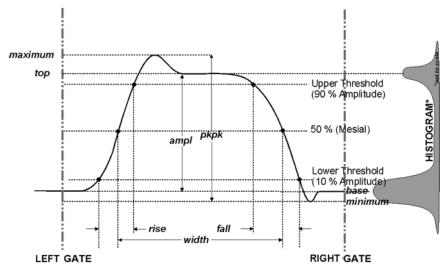

Determining Rise and Fall Times

Once top and base are estimated, calculation of the rise and fall times is easily done (see figure). The appropriate threshold levels are automatically determined by the instrument, using the amplitude (ampl) parameter.

Threshold levels for rise or fall time can also be selected using absolute or relative settings (if @level measurements are included with your model). If absolute settings are chosen, the rise or fall time is measured as the time interval separating the two crossing points on a rising or falling edge. But when relative settings are chosen, the vertical interval spanned between the base and top lines is subdivided into a percentile scale (base = 0 %, top = 100 %) to determine the vertical position of the crossing points.

The time interval separating the points on the rising or falling edges is then estimated to yield the rise or fall time. These results are averaged over the number of transition edges that occur within the observation window.

Rising Edge Duration

$$\frac{1}{Mr} \sum_{i=1}^{Mr} (Tr_i^{90} - Tr_i^{10})$$

Falling Edge Duration


$$\frac{1}{Mf} \sum_{i=1}^{Mf} (Tf_i^{10} - Tf_i^{90})$$

Where *Mr* is the number of rising edges found, *Mf* the number of falling edges found, Tr_i^x the time when rising edge *i* crosses the x% level, and Tf_i^x the time when falling edge *i* crosses the x% level.

Determining Time Parameters

Time parameter measurements such as width, period and delay are carried out with respect to the mesial reference level, located halfway (50%) between the top and base reference lines or with respect to the specified level for @level parameters.


Time-parameter estimation depends on the number of cycles included within the observation window. If the number of cycles is not an integer, parameter measurements such as rms or mean will be biased. However, only the last value is actually displayed, the mean being available when statistics are enabled. To avoid these bias effects, cyclic parameters can be chosen, including crms and cmean, that restrict the calculation to an integer number of cycles.

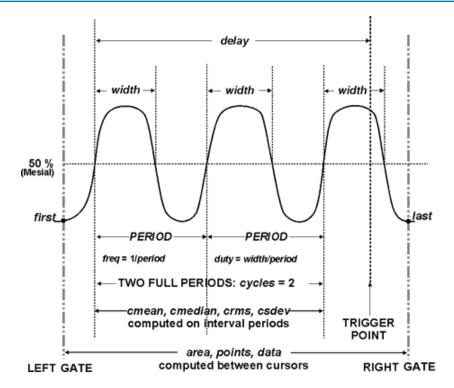

Determining Differential Time Measurements

The instrument enables accurate differential time measurements between two traces: for example, propagation, setup and hold delays.

Parameters such as Skew require the transition polarity of the clock and data signals to be specified. A hysteresis range may be specified to ignore any spurious transition that does not exceed the boundaries of the hysteresis interval. In the figure below, Skew measures the time interval separating the falling edge of Source1 from the rising edge of Source2.

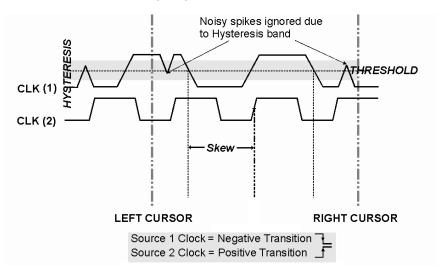

Math

Math traces (Fx) display the result of applying a mathematical operation to a source trace. The output of a math function is always another trace, whereas the output of a measurement parameter is a tabular readout of the measurement.

Math can be applied to any channel (Cx), zoom (Zx), or memory (Mx) trace. It can even be applied to another math trace, allowing you to chain operations (for example, trace F1 can show the average of C1, while trace F2 provides the integral of F1). Functions such as Trend can be applied to measurement parameters (Px) to plot the history of the measurement.

In addition to the extensive math capabilities that are standard with every instrument, enhanced math analysis tools customized for various industries and applications are offered through optional software packages. To learn about math tools available in each optional package, see the product datasheets at teledynelecroy.com.

If you have installed software options, the new capabilities are usually accessed through the Analysis menu, rather than the Math menu, although special measure parameters and math functions will be available when using Measure and Math dialogs.

Math Function Set Up

Use the Function dialog to set up math function traces. Math functions take as input one or more channel, zoom, memory or math traces and output a new function trace (Fx). Any additional settings required for the operator will appear on a subdialog at the right of the screen.

Single functions perform one operation on one or two input sources.

Dual functions chain two operations to arrive at a single result. This saves you the effort of having to chain two separate math functions. As with single functions, the number of sources required will vary based on the operation. You may need only one source for Operator1, but two for Operator2 (the result of the first operation counts as one source).

Setting Up New Functions

- 1. From the menu bar choose **Math > Math Setup**, or press the front panel **Math button**.
- 2. Choose a location by touching one of the **Fx tabs**.

If you know which function location you'll be using, you can select **Fx Setup** right from the Math menu.

Math F1 F2	F3 F4 F5 F6 F7 F8		Zoom FFT	CLOSE
Trace On	Source1 Operator1	Summary FFT(P4)	Output type Power Spectrum Window VonHann Algorithm	Lune Lune J
graph web edit	Actions for trace F2	Help Markers Next Simple	Power2 Line Impedance 50 Ω	

3. Choose a **single f(x)** or **dual g(f(x)** operator function.

You can also choose Web Edit, in which case this function is added as a terminal to the processing web. See the instructions for <u>Using Wed Edit</u> to set up the function.

- 4. In **Operator1**, choose the math operation to perform.
- 5. The choice of operator drives the number of **Source** fields you will see displayed. Make a selection in each field, or drag the source channel descriptor box to the field.

A **Summary** of the function you are building appears on the dialog. Refer to this to be sure your sources are in the proper order to yield the function you want (e.g., C1-C2 vs. C2-C1).

- 6. If the operator you've selected has any other configurable settings, you'll see a subdialog of the same name as the operator. Touch the tab to open the dialog and make any further settings. These are explained on the dialog.
- 7. If you're creating a dual function, repeat the procedure for the second operator.

Graphing

The **Graph button** on the Function (F*x*) dialogs allows you to plot the results of an applied measurement parameter using histogram, track, or trend. Choose the source, the measurement parameter, and the type of plot to draw. See <u>Histogramming</u> and <u>Track and Trend</u>.

Tip: The plots are the same as those created using the toolbar on the Parameter (Px) dialog.

As with other math functions, configurable settings will appear on subdialogs after the plot is selected.

Adjusting Memory or Math Traces

Unlike channel traces, the scale of memory (Mx) or math function (Fx) traces can be adjusted directly without having to create a separate zoom trace. The same set of zoom factor controls used for zoom traces appear on the **Zoom subdialog**, but in this context they only rescale the active math or memory trace rather than create a new zoom. This applies to any trace that is created as a math function (Fx) trace, including traces generated through analysis options and graphs.

You can, if you wish, create a separate zoom trace from a memory or function trace the same as you would normally create a zoom (draw a selection box, apply the Zoom math operator, etc.). In this case, you choose one of the zoom locations (Zx) in which to draw the trace, but the source trace remains at the original scale.

Math Dialog

Once a math function has been created and saved on the Function (Fx) dialog, use the main Math dialog to quickly enable/disable it.



To open the Math dialogs, touch the front panel **Math button**, or from the menu bar choose **Math > Math Setup**. Select the **On** checkbox next to each function you wish to display.

To modify a function, touch the **Fx button**.

To erase all functions from their locations, touch Reset All.

To restart the counter on cumulative functions (like Average), touch **Clear Sweeps**.

Average Function

Setting Up Averaging

To apply Continuous or Summed Averaging as a Math function:

- 1. Follow the usual steps to <u>set up a math fuction</u>, selecting **Average** from the **Basic Math** submenu.
- 2. On the Average subdialog, choose Summed or Continuous.
- 3. Touch **Sweeps** and provide a value. The valid range is 1 to 1,000,000 sweeps.

Tip: To quickly set up Continuous Averaging (only), access the channel setup dialog (Cx) and enter the number of sweeps to average in Averaging. The valid range is 1 to 1,000,000 sweeps.

Summed Averaging

Summed Averaging is the repeated addition, with equal weight, of successive source waveform records. If a stable trigger is available, the resulting average has a random noise component lower than that of a single-shot record. Whenever the maximum number of sweeps is reached, the averaging process stops. In Summed averaging, you specify the number of acquisitions to be averaged. The averaged data is updated at regular intervals.

An even larger number of records can be accumulated simply by changing the number in the dialog. However, the other parameters must be left unchanged or a new averaging calculation will be started. You can pause the averaging by changing the trigger mode from NORMAL/AUTO to STOP. The instrument resumes averaging when you change the trigger mode back to NORMAL/AUTO.

You can reset the accumulated average by pushing the CLEAR SWEEPS button or by changing an acquisition parameter such as input gain, offset, coupling, trigger condition, timebase, or bandwidth limit. The number of current averaged waveforms of the function, or its zoom, is shown in the acquisition status dialog. When summed averaging is performed, the display is updated at a reduced rate to increase the averaging speed (points and events per second).

Continuous Averaging

Continuous Averaging, the default setting, is the repeated addition, with unequal weight, of successive source waveforms. It is particularly useful for reducing noise on signals that drift very slowly in time or amplitude. The most recently acquired waveform has more weight than all the previously acquired ones: the continuous average is dominated by the statistical fluctuations of the most recently acquired waveforms in the continuous average tends to zero (following an exponential rule) at a rate that decreases as the weight increases.

You determine the importance of new data vs. old data by assigning a weighting factor. Continuous averaging allows you to make adjustments to a system under test and to see the results immediately. The formula for both summed and continuous averaging is:

new average = (new data + weight * old average)/(weight + 1)

However, by setting a **Sweeps** value, you establish a fixed weight that is assigned to the old average once the number of sweeps is reached. For example, for a sweeps (weight) value of **4**:

Sweep	New Average =
1 (no old average yet)	(new data +0 * old average)/(0 + 1) = new data only
2	(new data + 1*old average)/(1 + 1) = 1/2 new data +1/2 old average
3	(new data + 2 * old average)/(2 + 1) = 1/3 new data + 2/3 old average
4	(new data + 3 * old average)/(3 + 1) = 1/4 new data + 3/4 old average
5	(new data + 4 * old average)/(4 + 1) = 1/5 new data + 4/5 old average
6	(new data + 4 * old average)/(4 + 1) = 1/5 new data + 4/5 old average
7	(new data + 4 * old average)/(4 + 1) = 1/5 new data + 4/5 old average

In this way, for sweeps > 4 the importance of the old average begins to decrease exponentially.

Note: The number of sweeps used to compute the average is displayed at the bottom of the trace descriptor box.

Copy Function

The **Copy** math function saves a copy of your present waveform in its unprocessed state to the first available memory location. While processing may continue on the original waveform, the copy enables faster throughput in some cases by preserving the original data. No calculations need to be undone on the copy before additional math can be calculated. This benefit of faster throughput, however, comes at the expense of memory usage.

Follow the ususal steps to <u>set up a math function</u>, selecting **Copy** from the **Misc** submenu.

On the Wform Copy subdialog, optionally Reset Count or Change BatchSize.

ERes Function

ERes (Enhanced Resolution) filtering increases vertical resolution, allowing you to distinguish closely spaced voltage levels. The instrument's ERes function is similar to smoothing the signal with a simple, moving-average filter. However, it is more efficient concerning bandwidth and pass-band filtering.

Use ERes:

- On single-shot acquisitions, or where the data record is slowly repetitive (cases where you cannot use averaging).
- To reduce noise on noticeably noisy signals when you do not need to perform noise measurements.
- When performing high-precision voltage measurements (e.g., zooming with high vertical gain).

Setting Up ERes

To apply ERes as a Math function:

- 1. Follow the usual steps to set up a math function, selecting Eres from the Filter submenu.
- 2. Touch the Trace On checkbox.
- 3. On the **Eres** subdialog, then touch **bits** and make a selection from the pop-up menu.
- **Tip:** To quickly set up ERes as a pre-processing function, access the channel setup dialog (Cx) and select a **Noise Filter (ERes)** bit size.

How the Instrument Enhances Resolution

The instrument's enhanced resolution feature improves vertical resolution by a fixed amount for each filter. This real increase in resolution occurs whether or not the signal is noisy, or whether it is single-shot or repetitive. The signal-to-noise ratio (SNR) improvement depends on the form of the noise in the original signal. The enhanced resolution filtering decreases the bandwidth of the signal, filtering out some of the noise.

The instrument's constant phase finite impulse response (FIR) filters provide fast computation, excellent step response in 0.5 bit steps, and minimum bandwidth reduction for resolution improvements of between 0.5 and 3 bits. Each step corresponds to a bandwidth reduction factor of two, allowing easy control of the bandwidth resolution trade-off.

Resolution increased by	-3 dB Bandwidth (x Nyquist)	Filter Length (Samples)
0.5	0.5	2
1.0	0.241	5
1.5	0.121	10
2.0	0.058	24
2.5	0.029	51
3.0	0.016	117

With low-pass filters, the actual SNR increase obtained in any particular situation depends on the power spectral density of the noise on the signal.

The improvement in SNR corresponds to the improvement in resolution if the noise in the signal is white (evenly distributed across the frequency spectrum). If the noise power is biased towards high frequencies, the SNR improvement will be better than the resolution improvement.

The opposite may be true if the noise is mostly at lower frequencies. SNR improvement due to the removal of coherent noise signals—feed-through of clock signals, for example—is determined by the fall of the dominant frequency components of the signal in the passband. This is easily ascertained using spectral analysis. The filters have a precisely constant zero-phase response. This has two benefits. First, the filters do not distort the relative position of different events in the waveform, even if the events' frequency content is different. Second, because the waveforms are stored, the delay normally associated with filtering (between the input and output waveforms) can be exactly compensated during the computation of the filtered waveform.

The filters have been given exact unity gain at low frequency. ERes should therefore not cause overflow if the source data is not overflowed. If part of the source trace were to overflow, filtering would be allowed, but the results in the vicinity of the overflowed data—the filter impulse response length—would be incorrect. This is because in some circumstances an overflow may be a spike of only one or two samples, and the energy in this spike may not be enough to significantly affect the results. It would then be undesirable to disallow the whole trace.

Note: While ERes improves the resolution of a trace, it cannot improve the accuracy or linearity of the original quantization. The pass-band causes signal attenuation for signals near the cut-off frequency. The highest frequencies passed may be slightly attenuated. Perform the filtering on finite record lengths. Data is lost at the start and end of the waveform and the trace ends up slightly shorter after filtering. The number of samples lost is exactly equal to the length of the impulse response of the filter used: between 2 and 117 samples. Normally this loss (just 0.2 % of a 50,000 point trace) is not noticed. However, you might filter a record so short that no data is output. In that case, however, the instrument would not allow you to use the ERes feature.

Fast Wave Port Function

Fast Wave Port is a function of Teledyne LeCroy X-Stream oscilloscopes that enables you to insert your own custom algorithm, written in the C/C++ language, into the oscilloscope's processing stream. It also maximizes data throughput from the acquisition system to your custom algorithm for purposes of debugging. Custom algorithms can be written right on the oscilloscope using the Web Editor.

This is possible because two Windows system processes may share a region of memory, enabling high-speed data transfer between the acquisition system and the custom algorithm, which runs in a separate process from the oscilloscope application. A major benefit of Fast Wave Port is that your algorithm may be implemented and, more importantly, debugged independently of the main application.

It is important to note that transferring the results of your algorithm back into the X-Stream processing stream is optional. If performance is the primary goal, and further processing of the results within the X-Stream software is not required, this step may be skipped.

Fast Wave Port was designed for use with the C/C++ programming language. However, it is theoretically possible for the processing to be implemented in any language supporting Windows named events (Mutex) that can open a named memory-mapped file. No guarantee can be given, however, as to the behavior of the function using anything but C/C++.

The size of the memory window is fixed at 80 MB, equating to 40 ms.

To use Fast Wave Port, follow the usual steps to <u>set up a math function</u>, selecting **Fast Wave Port** as the Operator, then make the appropriate settings on the **Fast Wave Port** subdialog.

The **Port Name** is critical, indicating the base name of the memory window and the global objects within the Windows O/S. Only change the default value if using multiple Fast Wave Port functions in parallel.

Note: The base name must match the base name used in the client application.

Object	Full Name
Memory Mapped File	FastWavePort1File
Data Available Event	FastWavePort1MutexDataAvailable
Processing Complete Event	FastWavePort1MutexProcessingComplete

The full names of the default global objects are as follows:

The **Timeout** control specifies the amount of time the DSO waits for the custom processing function to complete. This prevents the DSO from waiting indefinitely for a custom processing function which may never arrive. Be careful to set this control to a reasonable value, meaning a time longer by a reasonable margin than the custom processing is ever expected to take.

FFT Function

For a large class of signals, you can gain greater insight by looking at spectral representation rather than time description. Signals encountered in the frequency response of amplifiers, oscillator phase noise and those in mechanical vibration analysis, for example, are easier to observe in the frequency domain.

If sampling is done at a rate fast enough to faithfully approximate the original waveform (usually five times the highest frequency component in the signal), the resulting discrete data series will uniquely describe the analog signal. This is of particular value when dealing with transient signals, which conventional swept spectrum analyzers cannot handle.

While FFT has become a popular analysis tool, some care must be taken with it. In most instances, incorrect positioning of the signal within the display grid will significantly alter the spectrum, producing effects such as leakage and aliasing that distort the spectrum.

An effective way to reduce these effects is to maximize the acquisition record length. Record length directly conditions the effective sampling rate and therefore determines the frequency resolution and span at which spectral analysis can be carried out.

Setting Up FFT

- 1. Follow the usual steps to <u>set up a math function</u>, selecting **FFT** from the **Frequency Analysis** submenu.
- 2. Open the FFT subdialog.
- 3. Choose an **Output type**.
- 4. Optionally, choose a weighting Window (see below).
- 5. Depending on your Output Type selection, also make selections for :
 - Group Delay Shift
 - Line Impedence. By default, the FFT function assumes a termination of 50 Ohms. If an external terminator is being used, this setting can be changed to properly calculate the FFT based on the new termination value.
- 6. Check the **Suppress DC** box to make the DC bin go to zero. Otherwise, leave it unchecked.

Choosing a Window

The choice of a spectral window is dictated by the signal's characteristics. Weighting functions control the filter response shape, and affect noise bandwidth as well as side lobe levels. Ideally, the main lobe should be as narrow and flat as possible to effectively discriminate all spectral components, while all side lobes should be infinitely attenuated. The window type defines the bandwidth and shape of the equivalent filter to be used in the FFT processing.

Rectangular windows provide the highest frequency resolution and are useful for estimating the type of harmonics present in the signal. Because the rectangular window decays as a (sinx)/x function in the spectral domain, slight attenuation will be induced. Functions with less attenuation (Flat Top and

Blackman-Harris) provide maximum amplitude at the expense of frequency resolution, whereas Hamming and Von Hann are good for general purpose use with continuous waveforms.

Window Type	Applications and Limitations
Rectangular	Normally used when the signal is transient (completely contained in the time-domain window) or known to have a fundamental frequency component that is an integer multiple of the fun- damental frequency of the window. Signals other than these types will show varying amounts of spectral leakage and scallop loss, which can be corrected by selecting another type of window.
Hanning (Von Hann)	Reduces leakage and improves amplitude accuracy. However, frequency resolution is also reduced.
Hamming	Reduces leakage and improves amplitude accuracy. However, frequency resolution is also reduced.
Flat Top	Provides excellent amplitude accuracy with moderate reduction of leakage, but with reduced frequency resolution.
Blackman-Harris	Reduces leakage to a minimum, but with reduced frequency resolution.

FFT Window Filter Parameters				
Window Type	Window TypeHighest Side Lobe (dB)Scallop Loss (dB)ENBW (bins)		Coherent Gain (dB)	
Rectangular	-13	3.92	1.0	0.0
Von Hann	-32	1.42	1.5	-6.02
Hamming	-43	1.78	1.37	-5.35
Flat Top	-44	0.01	3.43	-11.05
Blackman-Harris	-67	1.13	1.71	-7.53

Interpolate Function

Linear interpolation, which inserts a straight line between sample points, is best used to reconstruct straight-edged signals such as square waves. This is the default interpolation method used by the oscilloscope.

(Sinx)/x interpolation, on the other hand, is suitable for reconstructing curved or irregular waveshapes, especially when the sampling rate is 3 to 5 times the system bandwidth.

Cubic interpolation can be used to create a smooth, continuous function by applying a third-degree polynomial.

For each method, you can select an upsample factor of 2 to 50 points to insert between samples.

- 1. Follow the usual steps to <u>set up a math function</u>, selecting **Interpolate** from the **Filter** submenu.
- 2. Touch **Algorithm** and select an interpolation type.
- 3. Enter the **Upsample** factor by which to increase sampling.

You can use the Up and Down buttons to set this value. To make fine increment changes, deselect the "only by 2, 5..." checkbox.

- 4. In Half Width enter the width in taps of the filter.
- 5. To use a weighting function rather than an upsample factor, select it from **Weighting**. See <u>FFT</u> for more information about the functions. If using the Kaiser function, also enter the **Beta** value.

Sparse Function

The Sparse math function allows you to thin out an incoming waveform by skipping points at regular intervals, and by starting acquisition at a particular offset (point). The **Sparsing factor** specifies the number of sample points to reduce the input waveform by. A sparsing factor of 4, for example, says to retain only one out of every 4 samples. A **Sparsing offset** of 3, on the other hand, says to begin on the third sample, then skip the number of samples specified by the sparsing factor (4). In this way, the sample rate is effectively reduced.

For the sparsing factor (interval), you can set a value from 1 to 1,000,000 points. For the sparsing offset you can set a value from 0 to 999,999.

- 1. Follow the usual steps to set up a math function, selecting **Sparse** from the **Misc** submenu.
- 2. Touch the **Sparsing factor** control and provide a Bandwidth Limit value.
- 3. Touch the **Sparsing offset** control and provide a value.

Rescale Function and Assigning Units

The Rescale function allows you to apply a multiplication factor (*a*) and additive constant (*b*) to any source waveform. You can do it in the unit of your choice, depending on the type of application.



Tip: Analog channel traces may be rescaled directly using the Cx dialogs. They do not require a separate Math function.

Setting Up Rescaling

- 1. Follow the usual steps to <u>set up a math function</u>, selecting **Rescale** from the **Functions** submenu.
- 2. Touch the **Rescale** subdialog tab.
- 3. To apply a multiplication factor:
 - Check the **First multiply by:** box and enter a value for *a*, the multiplication factor.
 - Touch **then add:** and enter a value for *b*, the additive constant.
- 4. To change the output unit of measure from that of the source waveform:
 - Check Override units.
 - In **Output** enter the abbreviation for the new unit of measure.

You can combine units following these rules:

- For the quotient of two units, use the character ":/"
- For the product of two units, use the character "."
- For exponents, append the digit to the unit without a space (e.g., "S2" for seconds squared)

Note: Some units are converted to simple units (e.g., V.A becomes W).

Abbreviated Units of Measure

Abbreviation	Measure	Abbreviation	Measure
(blank)	No units	N	Newton
A	Ampere	ОНМ	Ohm
С	Coulomb	PAL	Pascal
CYCLE	Cycles	PCT	Percent
DB	Decibel	POISE	Poise
DBC	Decibel referred to carrier	РРМ	Parts per million
DBM	Decibel Milliwatt	RAD	Radian
DBV	Decibel Volts	DEG	Degree (of arc)
DBUZ	Decibel Microamp	MNT	Minute (of arc)
DEC	Decade	SAMPLE	Sample
DIV	Divisions	SWEEP	Sweeps
Event	Events	SEC	Second (of arc)
F	Farad	S	Second
G	Gram	SIE	Siemens
Н	Henry	Т	Tesla
HZ	Hertz	UI	Unit interval
J	Joule	V	Volt
К	Degree Kelvin	VA	Volt amps
CEL	Degree Celsius	W	Watt
FAR	Degree Fahrenheit	WB	Weber
L	Liter	MIN	Min
М	Meter	HOUR	Hour
FT	Foot	DAY	Day
IN	Inch	WEEK	Week
YARD	Yard		
MILE	Mile		

List of Standard Operators

The math operators included standard with your oscilloscope are listed below alphabetically.



Note: There may be additional operators available depending on the software options installed on the oscilloscope.

Operator	Definition	
Absolute	For every point in the waveform the distance away from zero is calculated. For values greater than zero this is the same as the value. For values less than zero, the magnitude of this value without regard to its sign is used.	
Average	Calculates either a summed or continuous average of a selected number of sweeps. See <u>Averaging Waveforms</u> . The maximum number of sweeps is determined by the oscilloscope model and memory.	
Сору	Copies waveform in its unprocessed state to the first available memory location.	
Correlation	Calculates a measure of similarity of two waveforms, or a waveform against itself, as a function of a time-lag applied to one of them.	
Derivative	Calculates the derivative of adjacent samples using the formula: (next sample value – current sample value) / (horizontal sample interval)	
Deskew	Shifts trace in time the amount of the deskew factor.	
Difference	For every point in the waveform, the value of Source2 is subtracted from the value of Source1. Source1 and Source2 must have the same horizontal units and scale and the same vertical units.	
Envelope	Calculates highest and lowest vertical values of a waveform at each horizontal value for a spe- cified number of sweeps.	
ERes	Applies a noise reduction and smoothing filter by adding a specified number of bits. See Enhanced Resolution.	
Exp	Calculates the antilog to the base e of the source; that is, e raised to the power equal to the source.	
Exp10	Same as Exp, using base 10.	
FFT	Computes a frequency spectrum with optional Rectangular, Von Hann, Flat Topp, Hamming, Blackman-Harris, and Hanning windows. Calculates up to 128 Mpts. Also allows FFT Averaging through use of a second math operator. See <u>FFT</u> .	
Floor	Calculates the lowest vertical values of a waveform at each horizontal value for a specified num- ber of sweeps.	
Histogram	Plots the number of data points that fall into statistically significant intervals or bins. Bar height relates to the frequency at which data points fall into each interval/bin.	
Integral	Calculates the linearly rescaled integral (with multiplier and adder) of a waveform input starting from the left edge of the screen using the formula: (current sample value + next sample value) * (horizontal sample interval) Each calculated area is summed with the previous sum of areas. The multiplier and adder are applied before the integration function.	
Interpolate	Inserts points between sampled points (upsamples) according to one of three algorithms: Lin- ear (straight line), Sinx/x (curved), and Cubic (spine). Interpolation factor of 2 to 50 determines number of points in the upsample.	
Invert	For every point in the waveform, the inverse of that point is calculated.	

Operator	Definition			
Ln	Peforms a natural log of a waveform. Values less than or equal to zero are set to underflow.			
Log10	Performs a log base 10 of a waveform. Values less than or equal to zero are set to underflow.			
MatLab math	Produces a waveform using a custom MatLab function.			
Phistogram	Creates a persistence histogram based on the displayed pixels of a waveform falling within a user defined vertical or horizontal box (slice).			
Product	For every point in the waveform, the value of Source1 is multiplied by the value of Source 2. Source1 and Source2 must have the same horizontal units and scale.			
Ptrace mean	Plots the mean value of each sample point in a persistence map.			
Ptrace range	Generates a waveform with a width derived from the population range of a persistence map.			
Ptrace sigma	Generates a waveform with a width derived from the sigma (sum) of a persistence map.			
Ratio	For every point in the waveform, the value of Source1 is divided by the value of Source2. Source1 and Source2 must have the same horizontal units and scale.			
Reciprocal	For every point in the waveform the inverse is calculated using the formula: 1 / (sample value)			
Rescale	For every point in the waveform the sample value is multiplied by the specified multiplier and then add to with the specified adder. See Rescaling and Assigning Units.			
Roof	Calculates the highest vertical values of a waveform at each horizontal value for a specified number of sweeps.			
Segment	Selects one segment from a source waveform to place in a sequence waveform. Used in Sequence sampling mode.			
Sinx/x	Performs 10-to-1 interpolation using a Sin(x)/x filter.			
Sparse	"Thins," or decimates, an incoming acquisition by dropping sample points at regular intervals. Sparsing factor specifies the number of points to drop between retained samples (e.g., factor of 4 retains 1 then drops 4). Sparsing offset specifies the point at which to begin applying the sparsing factor (e.g., offset of 3 begins count on the third sample (3), then drops the number of samples specified by the sparsing factor (4).			
Square	For every point in the waveform, the square of the sample value is calculated.			
Square Root	For every point in the waveform, the square root of the sample value is calculated.			
Sum	For every point in the waveform, the value of Source1 is added to the value of Source 2. Source1 and Source2 must have the same horizontal units and scale and the same vertical units.			
Track	Generates a waveform composed of parameter measurements that is time synchronous with the source waveform. The vertical units are those of the source parameter value and the hori- zontal units are seconds. Parameter values are posted at the sampling rate.			
Trend	Produces a waveform composed of a series of parameter measurements in the order the meas- urements were taken. The vertical units are those of the source parameter, the horizontal unit is measurement number. The trend contains a single value for each measurement.			
Zoom	Produces a magnified trace of a selected portion of the input waveform. See Zooming Traces.			

Memory

The instrument is equipped with four internal memory slots (M*x*) to which you can copy any waveform that is active on the grid. This is a convenient way to store an acquisition for later viewing and analysis.

Memories can be used as source inputs for most oscilloscope math and measurements, allowing you to compare historical data to a live acquisition or perform "what if" modeling on saved acquisitions.

Saving Memories

Store <u>memories</u> on the Memory dialogs (M*x*). Memories are created at the same scale as the source trace, but they can be adjusted independently by using the <u>zoom factor controls</u> that appear next to the M*x* dialogs.

Save Waveform to Memory

Touch the **Add New box** and choose **Memory** until you see an empty memory slot. Drag the descriptor box of the trace you wish to store onto the Mx descriptor box.

Note: Try to choose an empty slot, as anything currently stored in that location will be overwritten. All memories will state if they are empty or an acquisition is stored there.

- 1. Press the front panel **Mem button** or choose **Math > Memory Setup** to open the Memories dialog.
- 2. Touch the Mx tab corresponding to the memory slot you wish to use.

Memories M1 M2	M3 M4		Zoom		😢 CLOSE
Trace On	To save Waveform Memory to a local or network folder, use the "File" menu:	Source: C2 Stored: 3/17/2016 13:27:44 PM Notes	Segments First	Horizontal Center 0.0 µs	Vertical Center 0 mV Scale / div
Copy From Waveform	Actions for trace M2			_10.0 μs x 1.00	_500 mV
Copy Now	Clear Measure Memory	Label Next Grid	Reset Zoom	On and a set	in Out

- 3. In **Copy from Waveform**, choose the source trace to copy to memory.
- 4. Touch Copy Now.
- 5. Optionally, check **Trace On** to immediately display the memory. Use the Zoom controls to adjust the scale of the memory trace.

Save (External) Waveform Files to Memory

Trace (.trc) files saved on other Teledyne LeCroy instruments can also be saved to internal memory. Use the <u>Recall Waveform</u> function to save external files to memory. Then, you can use the <u>Memories</u> dialog to restore them to the touch screen.

Restoring Memories


The Memories dialog is a convenient panel for restoring saved memories to the display.

Access the Memories dialog by pressing the front panel **Mem button** or choosing **Math > Memory Setup**.

Check **On** next to the memory trace you wish to display. A description of the memory showing the source channel and creation time appears next to each Mx on the dialog.

Touch **Clear All Memories** to empty the memory banks.

Caution: Memories cannot be restored once they have been erased.

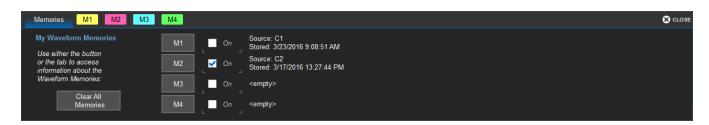

Analysis Tools

The Analysis menu tools complement the standard math and measurements to help you understand the behavior of waveforms.


<u>WaveScan</u> searches a single acquisition for events that meet specific criteria, enabling you to zoom in on anomalies in the waveform, or scans multiple acquisitions with allowable trigger actions when conditions are met. It can also be used to filter measurements.

Pass/Fail Testing shows whether waveforms or measurements meet a set of defined criteria.

Optional software packages may be purchased for specialized uses, such as power analysis. In most cases, these options are added to the Analysis menu. Documentation for software options can be found at <u>teledynelecroy.com/support/techlib</u> under Manuals > Software Options. In addition, documentation for many options available on your platform can be found in the online Help under the Support menu.

WaveScan

The WaveScan® Search and Find tool enables you to search for unusual events in a single capture, or to scan for a particular event in many acquisitions over a long period of time. Each <u>Scan Mode</u> is optimized to find a different type of event. Results are time stamped, tabulated, and can be selected individually.

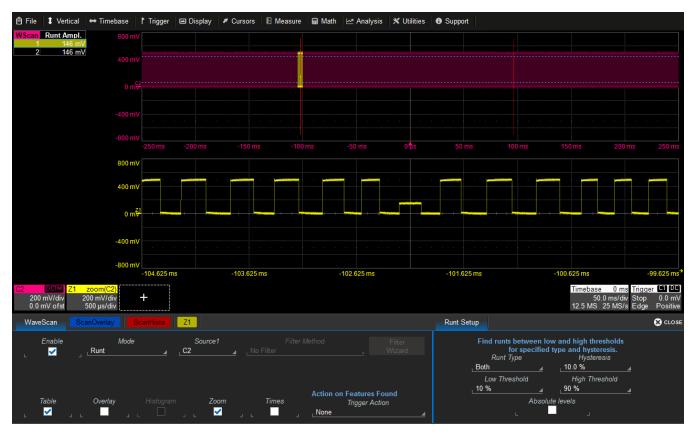

WaveScan window with different scan "views" turned on.

When <u>setting up WaveScan</u>, you can customize the presentation by choosing different WaveScan display features, called <u>Scan Views</u>. Optionally, set actions to occur automatically when unusual events are found, such as stopping the acquisition or sounding an alarm.

Note: The instrument reverts to Real-time sampling mode when WaveScan is enabled.

Scan Modes

The Scan Mode determines the type of search to be performed. Select the **Mode** along with the **Source** trace to be searched on the main WaveScan dialog. For each mode, different controls appear on the WaveScan dialog, providing additional inputs to the search criteria. Make the appropriate entries in these fields before starting the search.

Edge Mode

Edge Mode is used for detecting the occurrence of edges. Events that meet the threshold level are captured and tabulated. When the acquisition is stopped, scan filters can be applied to the edges to find specific characteristics. Edge Mode settings are:

- Slope. Choose Pos, Neg, or Both.
- Level is (set in...). Choose Percent or Absolute.
- **Percent/Absolute Level**. Enter a threshold value as a percentage of Top to Base or voltage level.

Non-monotonic Mode

Non-monotonic Mode looks for edges that cross a threshold more than once between high and low levels. All events that meet the criteria of slope, hysteresis, and level are presented in a table and highlighted in the source trace. The value displayed in the table is the difference of the max. and min. of the non-monotonicity. This can be confirmed with cursors. The hysteresis value is used to eliminate noise. A non-monotonicity is detected only when its amplitude is greater than the hysteresis. Therefore, when setting a hysteresis level, set a value that is greater than the amplitude of the noise. Non-monotonic Mode settings are:

- Slope. Choose Pos, Neg, or Both.
- Hysteresis is (set in...). Choose Division, Percent, Absolute.
- Division/Percent/Absolute. Enter hysteresis level in the selected unit.
- Levels are (set in...). Choose Percent, Absolute, or Pk-Pk%.
- High/Low Level. Enter top and bottom thresholds in the selected unit.

Runt Mode

Runt Mode looks for pulses that fail to cross a specified threshhold. You can search for positivegoing or negative-going runts, or both. An adjustable hysteresis band is provided to eliminate noise.

In the case of negative-going runt pulses, the value displayed in the table is the difference (delta) of the high level of the signal and the runt amplitude (i.e., where the runt bottoms out). This can be confirmed by placing cursors on the runt pulse and reading the delta Y value in the trace labels. In the

case of positive-going runt pulses, the value displayed in the table is the absolute value of the amplitude of the runt pulse. Runt Mode settings are:

- Runt Type. Choose Both, Pos, or Neg.
- Hysteresis. Enter the hysteresis level as a percentage or voltage.
- Low/High Threshold. Enter the levels as a percentage or voltage.
- Absolute Levels. Check this box to enter levels as absolute voltage instead of percentage.

Measurement Mode

Measurement Mode is used for applying filters to measurements to find those that meet your defined criteria, helping to isolate particular events within many samples. Markers appear over the source trace to indicate the location of measurement, while the table displays values for the selected parameter that meet the criteria. Measurement Mode settings are:

- Measurement. Choose the measurement parameter you wish to search.
- **Filter Method**. Choose the operator that indicates the desired relationship to the Filter Limit. Only measurements that meet this criteria are returned.
- Filter Limit. Enter the value that completes the filter criteria.

Alternatively, you can use the **Filter Wizard** to create the filter criteria.

Serial Pattern Mode

Serial Pattern Mode is used for finding 2- to 64-bit patterns in digital sequences; ideal for bursted patterns where a PLL cannot lock. Serial Pattern Mode settings are:

- Viewing. Choose to enter the pattern as Binary or Hex(adecimal).
- Binary/Hex. Enter the pattern.
- Num. Patterns to detect. Enter a whole number.

Bus Pattern Mode

Bus Pattern Mode (-MS models only) is used for finding 2- to 16-bit patterns across the digital lines. Bus Pattern Mode settings are:

- Viewing. Choose to enter the pattern as Binary or Hex(adecimal).
- **Binary/Hex**. Enter the pattern.
- Num. Patterns to detect. Enter a whole number.

Scan Views

Scan Views are different ways to view your WaveScan results. You can choose to display views simultaneously or visit them sequentially. Just check the boxes at the bottom of the WaveScan dialog for those views you wish to display. Uncheck the box to turn off the view.



Note: The number of grids varies from one to three depending on which views are enabled. WaveScan handles this function automatically, and you cannot move traces among grids as in normal operation.

You'll find additional controls for manipulating Scan Overlay and Zoom on their respective dialogs. If you turn on these traces from those dialogs, you must turn them off from there, too.

Source Trace

By default, the source trace is displayed in the top grid, with markers indicating points in the trace that meet the search criteria.

Table

Table view displays a table of measurements relevant to your chosen Search Mode next to the source trace. **Times** view adds columns to the table showing Start and Stop Times for each event.

Scan Overlay

Scan Overlay view plots the location of captured events in a new trace. Colored overlays provide quick reference to sections of the waveform.

Zoom

Zoom view works exactly as it does elsewhere in the X-Stream software, creating a new trace that is a magnified section of the source trace. A Zx tab appears by default when you launch WaveScan; see <u>zoom factor controls</u> for an explanation of the remainder of the controls found on this dialog.

A unique feature of the WaveScan Zoom is that you can automatically zoom the events captured from the source trace by touching the Prev/Next buttons on the Zx dialog. You can also select a row from the Table, and you are automatically relocated to that point on the zoom.

Setting Up WaveScan

This procedure explains how to set up WaveScan to search an acquisition for events of interest. Set up your source channel and triggers before setting up the scan.

- 1. Press the front panel Stop button to stop acquisition.
- 2. Choose Analysis > WaveScan.
- 3. Check Enable.
- 4. Choose the **Source** waveform.
- 5. Choose the <u>Scan Mode</u> and enter values for any additional settings that appear at the right of the dialog based on your selection.
- 6. If you're using Measurement Mode, set up the filter in one of the following ways:
 - Touch Filter and choose an operator, then enter the Filter Limit.
 - Touch **Filter Wizard** and choose one of the pre-set filters. The Filter and Filter Limit are automatically set based on your selection.
- 7. Select each <u>Scan View</u> in which you wish to display results by checking the box at the bottom of the dialog. Each view selected is displayed simultaneously.
- 8. If you're using Scan Overlay view, on the Scan Overlay dialog **Clear Sweeps**. If desired, set up the <u>Persistence</u> display.
- 9. Optionally, choose an Action to trigger when an event that meets your scan criteria is found.
- 10. Restart acquisition.
- 11. When using the Zoom view, use the Zx tab to adjust the zoom.

Scan Overlay

To apply monochromatic persistence to a Scan Overlay:

- 1. Select Scan Overlay when setting up the wave scan, then open the Scan Overlay dialog.
- 2. Check Persistence On.
- 3. Enter a **Saturation** level as a percentage. All samples above the saturation level are assigned the highest color intensity.
- 4. Choose a **Persistence Time**. The higher the time, the more static the persistence display.

To adjust the scan overlay to "zoom" in or out: touch the **In/Out buttons**, or touch **Scale** and enter new values. Check **Var.** to adjust scale in finer steps than the default 1, 2, 5.

Analysis Tools

WaveScan	ScanOverlay	ScanHisto Z1			CLOSE
Trace On		Persist On ✓ ✓ J Clear Sweeps	Saturation 26 % Persistence Time 0.5s	Overlays 'Software Triggers' into a persistence map. Data selection <u>Scale</u> <u>1.00 ns/div</u> <u>Construction</u> Var.	Delay _0µs

Scan Histogram

Scan Histogram is an additional <u>WaveScan</u> "view" that generates a histogram to give you a statistical view of edges that meet your search criteria. Enter the parameters as you would to set up any histogram:

- 1. Total **#Values** in the histogram buffer
- 2. **#Bins** (bars) in the histogram
- 3. Center value and Width of each bin from center, or check Enable Auto Find and let the sofware Find Center and Width.
- 4. Choose a Vertical Scale method:
 - Linear allows the histogram to build vertically as data accumulates. When the histogram reaches the top of the display it rescales the vertical axis to keep it on screen.
 - LinConstMax keeps the histogram at near full scale and rescales the vertical axis as data is accumulated.

WaveScan Search

Search is used to find events in traces—usually zoom (Zx) traces—that match user-defined criteria. To search within WaveScan:

- 1. Select the **Zoom** view.
- 2. After stopping the acquisition, open the **Zx dialog** that appears behind the WaveScan dialog.
- 3. Use the **Prev** and **Next** buttons to move back or forward within the trace to the events that matched your Scan Modes criteria.

Or

If you know the WaveScan table index (row) number of the event you wish to find, enter it in Idx.

Pass/Fail Testing

Pass/Fail testing allows you to define a set of qualifying conditions that an acquisition may "pass" or "fail" when tested against, then take actions depending on whether the result is a pass or a fail.

- <u>Mask testing</u> compares sampled values to a pre-defined area of the grid (the "mask") to see if they fall within or without.
- <u>Parameter comparison</u> compares a measurement result to a pre-defined value (Param compare) or to another measurement (Dual param compare).

You can preconfigure to eight qualifiers (Q*x*) using either method, which are then enabled by selecting them on the Pass/Fail dialog and defining what combination of results constitutes a "Pass" on the <u>Actions</u> dialog.

Mask Test Qualifiers

Testing against a mask is particularly useful for comparing newly acquired signals to a previously acquired "golden standard" waveform.


A mask defines an area of the grid against which a source Channel, Zoom, or Math trace is compared. Test conditions are associated with the mask, defining how the waveform is to be compared to the masked area (e.g., some/all values fall within, some/all values fall outside), and a Pass or Fail result is returned indicating the condition was found to be true or false.

Mask testing can be done using a pre-defined mask or a mask created from a waveform with userdefined vertical and horizontal tolerances. Some industry standard masks used for compliance testing are included with the oscilloscope software. The mask test can be confined to just a portion of the trace by the use of a measure gate.

Access Mask Test Dialogs

- 1. Choose Analysis > Pass/Fail to display the Pass/Fail dialog.
- 2. Touch the **Qx button** where you want to set up the qualifier.
- 3. Select Mask test.

The Qx dialog opens with the Mask test condition selected and the **Test**, **Load Mask**, **Make Mask**, and **Gate** subdialogs displayed. On these dialogs, you manage, make, and apply gates to your mask.

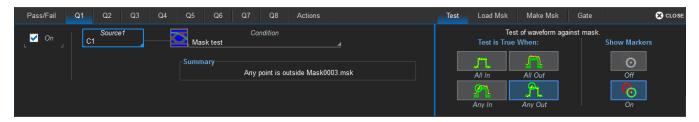

Make Mask

Use this procedure to create a new mask based on a live waveform. The mask covers the area of the waveform plus the boundaries you enter.

- 1. Open the Make Mask subdialog.
- 2. If desired, enter a new **Destination File Name** and path, or touch Browse and select a previous file to overwrite. The file name should end with the **.msk** extension.
- 3. Touch the **Ver Delta** and **Hor Delta** fields and enter boundary values using the pop-up Virtual Keypad or the front panel Adjust knob.
- 4. Touch Make from Trace.

Load Mask

Use this procedure in lieu of Make Mask if you have a pre-defined mask file, or wish to recall a mask you previously created and saved.

- 1. Open the Load Mask subdialog.
- 2. To use a saved .msk file, touch **File** and select the mask.

To use an industry standard mask, touch **Standard** and select the mask from the pop-up.

3. Check View Mask to display the mask over the trace.

Remove a Mask from the Display

Touch the **Delete All Masks** button. Alternatively, open the **Qx** dialog where a particular mask is set, and on the **Load Mask** subdialog, touch **Delete**.

Set Gates

Set gates to limit the portion of the waveform that is compared to the mask.

- 1. Open the Gate subdialog.
- 2. Enter the **Start** and **Stop** horizontal divisions that mark the segment of the waveform to be tested with this mask. This can be a whole division or a fraction of a division. Divisions are numbered 1-*n* left to right.

A quick way to position the gate is to drag the gate posts initially placed at the extreme left and right ends of the grid to the desired points.

Define "True"

- 1. Open the **Test** subdialog.
- 2. Select one of the conditions that, when True (yes), results in a Pass.
- 3. Optionally, turn **Off/On** markers. Markers visually indicate where on the waveform mask violations have occurred.

Param(eter) Compare Qualifiers

Pass/Fail qualifiers (Q*x*) can be configured to compare different parameter measurements (P*x*) to each other or to a user-defined limit (or statistical range).

Comparing a Measurement to a Limit

This method takes the result of a selected measurement parameter and compares it to a userdefined value or range of values.

- 1. Choose Analysis > Pass/Fail to display the Pass/Fail dialog.
- 2. Touch the **Qx button** where you want to set up a qualifier.
- 3. From the pop-up menu, choose **Param compare**.
- 4. On the Qx dialog, touch **Source1** and choose the parameter.

Pass/Fail Q1 Q2 Q3 Q4 Q5 Q6 Q7 Q8 Actions	ParamCompare 😵 CLOSE
On Source1 Condition Param compare	Test parameter value(s) against limit(s) Compare values All Greater than or Equal to
All P2 ≥ 0.147782	Limit 147.78162e-3 Set Limit and Delta using Current µ±1 µ±3 µ±5 Nean Sigma Sigma Sigma

5. On the ParamCompare dialog, touch **Compare Values** and select **All** or **Any** from the pop-up.

By selecting **All**, the condition is true only if every waveform falls within the limit. Selecting **Any** makes the condition true if just one waveform falls within the limit.

- 6. Touch **Condition** and select a math operator, then touch **Limit** and enter the value that completes the condition. The value entered acquires properties corresponding to the parameters being tested. For example, if you are testing a time parameter, the unit is seconds.
- 7. If you chose to set a Delta limit, also enter the **Absolute or % Delta** value. You may choose instead to set Limit and Delta using one of the buttons at the bottom of the dialog.

Comparing Parameter Measurements

When using Dual Param Compare, two measurements are compared, rather than two waveforms.

- 1. Choose Analysis > Pass/Fail to display the Pass/Fail dialog.
- 2. Touch the **Qx button** where you want to set up a qualifier.
- 3. From the Pass/Fail Condition menu, choose **Dual Param Compare**.
- 4. On the left-hand Qx dialog, select the parameters to compare in **Source1** and **Source2**.
- 5. On the ParamCompare dialog, touch **Compare values** and select **All** or **Any** from the pop-up.

By selecting **All**, the test are true only if every waveform falls within the set limit. Selecting **Any** makes the test true if just one waveform falls within the limit.

6. Touch **Condition** and select the math operator that completes the condition. The Summary field shows the completed condition that is represented by this qualifier.

Define Pass/Fail Tests

The Qualifiers define the conditions of a Pass/Fail test that would result in either "True" or "False" but don't in themselves determine the test result. You must separately define what constitutes a "Pass" or a "Fail" on the Actions dialog. A Pass or Fail result can be made to produce various additional actions, such as sending a pulse to another device.

1. After setting up the Pass/Fail test qualifiers, open the Actions tab.



- 2. Optionally, check **Summary View** to see a running summary of results over the total number of sweeps.
- 3. Select the test Pass criteria in Pass If.
- 4. To apply additional actions to the test result:
 - Check Enable Actions to turn on actions.
 - Under If, choose to apply actions if the result is a **Pass** or a **Fail**.
 - Under Then, choose all the actions to apply:
 - Save a waveform file
 - Stop the test
 - Sound an Alarm
 - Emit a **Pulse** from the AUX OUT connector. When taking this action, also open the **Aux Output tab** and choose to **Use Auxilliary Output For Pass/Fail**.
 - Capture the screen and process it according to your **Hardcopy** selection (e.g., send to printer)
 - Create a LabNotebook Notebook Entry

Use the **Clear All** button to clear all the action checkboxes, or **Force Actions Once** to apply them once regardless of the test results.

Delay Test

You can delay the start of a test by entering the number of sweeps to wait in Start Testing After.

Touch Clear Sweeps at any time to reset the test counter.

Stop Test

To stop the test following a specified number of sweeps, rather than a Pass or Fail result, check the **Stop Test** box, then enter the desired number of sweeps in **After**.



Saving Data (File Functions)

This topics in this sections explain the instrument's File menu functions.

Some of these features, like the <u>Disk Utilities</u>, provide an alternative interface for performing typical Windows file functions, such as creating and deleting files/folders on the instrument's hard drive.

Others, such as the <u>Save/Recall</u> features, are related directly to moving waveform data on/off the instrument.

<u>LabNotebook</u> is Teledyne LeCroy's proprietary tool for capturing and creating custom reports of waveform data. An important feature of LabNotebook is <u>Flashback Recall</u>, which enables you to restore an acquisition (and the setups used to create it) to the oscilloscope screen simply by recalling a LabNotebook entry.

LabNotebook

The LabNotebook feature allows you to create and save <u>Notebook Entries</u> containing a capture of all displayed waveforms and the waveform data, to which you may add custom annotations.

Besides storing the waveform data, LabNotebook also stores the current panel setups and parameter measurements. The <u>Flashback Recall</u> feature instantly recalls the setups stored with individual Notebook Entries, enabling you to restore the exact state of the instrument at a later date to perform additional analysis.

Back up the LabNotebook database to external media for indefinite storage of waveform data.

Create Notebook Entry

A Notebook Entry is a snapshot of the instrument at the moment it is taken: it captures the waveforms, their setups, and any measurements in process. As each new entry is created, it is added to the current Notebook, a database of entries. All entries are accessible from the LabNotebook dialog, where they can be recalled to the screen through Flashback Recall.

- 1. Choose File > LabNotebook to open the LabNotebook dialog.
- 2. Touch Create.
- 3. Optionally, Enter Report Title and Description.

The default title is the date and time stamp.



Note: By default, you will be prompted to title and annotate notebook entries as they are created. You can <u>configure LabNotebook preferences</u> so that these steps are skipped in order to streamline the creation process. To update entries at a later time, select the entry from the list of Notebook Entries, then open the tab of the same name that appears behind the LabNotebook dialog.

LabNotebook Drawing Toolbar

The basic Notebook Entry is a screen capture of the display as it was at the time of entry, along with the setup and waveform data. When an entry is first captured, it is immediately displayed in the Drawing window for you to annotate.

0

Tip: This default setting can be changed on the LabNotebook Preferences dialog.

Markup tools are available from the toolbar along the top of the window.

To use any tool, touch the icon, then touch the point on the image where you wish to draw or add text. From left to right, the tools are:

ΤοοΙ	Function					
Pencil	raw in freehand. Maintain contact with the screen to make a continuous mark. Once you release, you can buch-and-drag the object to any point on the image.					
Circle	Draw a circle around a waveform feature that you want to emphasize. Touch-and-drag across the diameter of the circle. When you release, the circle is placed. You can drag the circle to any location on the image.					
Arrow	Draw lines with arrowheads for placing callouts. You can rotate these lines through 360 degrees or drag them o any location on the image.					
Text	Open a textbox for placing labels/annotations on the image. Touch the point on the image to place the label, nen enter the text in the pop-up dialog. Once placed, you can resize the textbox or drag it to any location on the image.					
RGB Selectors	Quickly change the line color. Just touch the color icon, then choose the next drawing tool.					
More	Activates a Custom line color field. The default color is Yellow. To choose another, touch the color swatch, then select from the Color dialog. You can enter RGB values, or choose from the spectrum. After saving, the new color appears in the Custom field. This remains the markup color until you choose another.					
Erase Selected / Erase All	Remove selected drawing objects. Erase All will also undo any Custom color selection.					
Undo	Cancel the last action. Use it to restore any objects you inadvertently erased.					
Move	Undock the drawing toolbar so you can move it anywhere on the display. This helps to keep tools handy when working on a particular area of a waveform. Touch the button again to restore the toolbar to the top of the Drawing window.					
Done	Save the annotations with the image and close the Drawing window.					

Manage Notebook Entries

Before any further actions can be performed on saved Notebook Entries, first select the Notebook from the **My Notebooks** list, then select the entry from the **My Notebook Entries** list. The selected entry is highlighted in blue.

Select Multiple Notebook Entries

- 1. Check the Multi-selection box at the far right of the dialog.
- 2. **Select All**, or else touch each desired entry then touch **Select** as the entry is highlighted. A white arrow appears next to each selected entry.
- 3. To remove entries from a multi-selection, highlight them and touch Clear, or else Clear All.

Filter Notebook Entries

To apply filters to limit a large list of entries:

- 1. Select the notebook from the My Notebooks list.
- 2. Touch the **Filter** button.
- 3. On the **Filter Entries** pop-up, enter the filter criteria. You can use **Day/Month/Year**, a **Keyword**, or a combination.
- 4. Touch Find Now to filter.
- 5. To restore the full list, touch Clear Filter.

Preview Notebook Entries

View allows you to preview the selected entries in the report format before printing/saving.

Select the desired entries, then touch the **View** button. Use the scrollbar that appears on the LabNotebook window to navigate the report.

Edit Notebook Entries

To annotate or change the description of a notebook entry:

- 1. Select the entry from the My Notebook Entries list.
- 2. Go to the **second tab** labeled with the entry name.
- 3. Modify the Title or Description.
- 4. To add markup to the entry, touch Scribble and use the Drawing Toolbar.

Email Notebook Entries

Choose **E-Mail** to send selected Notebook Entries to the default address specified in system Preferences. To use the E-Mail button, the instrument must have an active network connection and you must first <u>configure the email address and server</u>.

To change the recipient address (from the default) before sending, open the LabNotebook Preferences tab, then touch the **Configure E-Mail** button.

Also select whether or not to Attach Setup & Waveform files to the email with the LabNotebook files.

Print Notebook Entries

To print multiple entries, select them on the main LabNotebook dialog, then touch the **Print button** on the same dialog.

To print a single entry, select it on the main LabNotebook dialog, then go to the **second tab** and touch the **Print button**.

Delete Notebook Entries

Use the **Delete** button to remove selected Notebook Entries, or **Delete All** to clear the entire **My Notebook Entries**.



Note: Unless you have previously backed up the notebook, deleted entries cannot be restored.

Create Report

Create Reports collates the selected Notebook Entries into a single .RTF/.PDF document or HTML archive using the report template selected on the LabNotebook Preferences tab. This can be one of the preformatted templates or a <u>custom format</u>.



Note: It is not necessary to first create a report document to preview, email, or print selected Notebook Entries.

- 1. Select the notebook from the My Notebooks list.
- 2. Select the entries from the My Notebook Entries list.
- 3. Choose the output **Format**.
- 4. Touch Create Report.
- 5. On the **Create Report** window, select the folder in which to save the report.

Tip: Touch **Open Explorer Here** and use the Windows Explorer to create a new folder. After closing the Explorer, touch the **Refresh** button to display the folder in the Create Report window.

6. Enter a File name for the report and click OK.

Flashback Recall

Once a Notebook Entry is made, you can recall it at any time using Flashback Recall. The recall includes waveforms and panel settings, so you can analyze the inputs that resulted in that capture.

- 1. Choose File > LabNotebook to open the LabNotebook dialog.
- 2. Select the Notebook and Notebook Entry from the lists.
- 3. Touch the **Flashback Recall button**.
- 4. To exit Flashback Recall, touch the **Undo** button at the far right of the menu bar.

Some result data not included in Flashback Recall are:

- Persistence data (although it is saved in with the Notebook Entry).
- Floating point waveforms resulting from certain math operations that have much higher resolution than 16-bits. This extra resolution is not preserved when traces are recalled using Flashback.
- **Cumulative Measurements** in process when Flashback Recall is entered. When Flashback is used, they lose their history and show instead only the results from the stored waveforms, not including any data taken from interim acquisitions.

Manage Notebooks

LabNotebook stores Notebook Entries in a .zip archive on the instrument hard drive. Each .zip file is one Notebook comprised of everything shown in the My Notebook Entries list. New Notebooks can be created for different individuals or projects, or an existing Notebook backed up for storage.



Note: The default Notebook is D:\Xport\MyLabNotebook.zip. If you've already created Notebook Entries that you wish to keep, you can use the backup feature to save them under a new file name or location before starting a new Notebook.

Create New Notebook

- 1. Choose File > LabNotebook.
- 2. Enter a File Name for the Notebook (optionally, choose a new folder as well). Touch OK.

The new notebook now appears. New Notebook Entries will be added to this whenever it is selected.

Back Up Notebook

- 1. Choose File > LabNotebook.
- 2. Optionally, enter a new File Name or choose a new storage Folder.

Note: The default is the notebook name with *.bak.zip appended to it.

3. Choose to **Backup to Removable Disk** (this option is active when a USB drive is connected) or **Backup to Folder** on hard drive.

Import Notebook

Archived notebooks can be imported into .

- 1. Choose File > LabNotebook.
- 2. Navigate to the desired archive and select it. Touch OK.

Delete Notebook

Customize Reports

The Advanced dialog allows you to customize the LabNotebook report creation function.

Change Directories

To change where Notebooks are stored, change the **Notebooks Directory** folder.

To change where reports are output, change the **Report Directory** folder. You can choose an external location, such as a USB drive.

Change Report Template

Deselect **Use Default** next to the Template field, then touch **Browse** and select a different template from the D:\Xport folder.

You can create your own report template and place it in this directory for selection. Templates must be saved as .xsl or .xslt files.

Change Logo

The included LabNotebook report templates use our logo as a placeholder. You can replace this with your custom logo. Logo files should be in bitmap (.bmp) format and not exceed 100 pixels high by 180 pixels wide.

- 1. Copy the logo file to the D:\Xport folder.
- 2. Choose File > LabNotebook, then touch the Advanced tab.
- 3. Deselect the Use Default checkbox next to the Logo field.
- 4. Touch the **Browse** button and navigate to the the new logo file. Select and touch **OK**. The new file path appears in the Logo field with a preview of the image above it.

LabNotebook Preferences

To modify the behavior of the LabNotebook tool, change settings on the LabNotebook **Preferences** dialog:

Prompt for Entry Title Before Saving opens the LabNotebook dialog when a new entry is created. You can elect to name notebook entries using only the date/timestamp by leaving this box unchecked.

Use Print Colors outputs waveforms on a white background. This option helps save ink/toner when printing.

Hardcopy Area determines how much of the screen image is included in the report: grid area only, grid area plus dialog, whole screen. Touch the field and choose from the pop-up menu.

Save / Recall

The oscilloscope is capable of saving panel setups, waveform data, table data (such as measurements), screen prints, and LabNotebooks in several formats and to recall them to the display. The File menu functions enable you to set the defaults used for these features as well as to manually launch each.

Save Setups

Save Setups allows you to quickly save up-to-six panel settings to internal storage, while Recall Setups restores them with a touch. Setups are saved to the D:\Internal Setups folder.

If desired, you can also save panel settings as an .lss file in a different location, such as a USB drive, and recall them from the same.

Choose File > Save Setup... from the menu bar or click the Save Instrument Setup button on the main Save/Recall dialog.

Save/Recall	Save Waveform Recall Waveform Save Table	Save Setup	Recall Setup Disk Utilities	😢 CLO
	Save To Inte	ernal Setup		Save To File
Save	Setup1 18-Mar-2015 13:02:23 NewNameforSetup	Save	Setup4 - Empty Panel4	Save Panel To File
Save	Setup2 - Empty Panel2 ⊿	Save	Setup5 - Empty Panel5	
Save	Setup3 - Empty Panel3	Save	Setup6 - Empty Panel6	Save Now!

Save Setup to Memory

- 1. Touch one of the **Setup** data entry controls and enter a name for the memory.
- 2. Touch the corresponding **Save** button directly to the left of the Setup field.

The save date/time is displayed above the **Setup** data entry control.

Save Setup to File

1. In Save Panel to File, touch Browse and navigate to the desired folder.

Tip: If the instrument is networked, you can touch Save Panel to File and enter the full Windows network address of another location in which to save the file. The instrument must have access to this directory.

- 2. Enter a **File name**, or choose a existing file to overwrite. Touch **OK**.
- 3. On the Save Setups dialog, touch Save Now!

Recall Setups

Recall Setups restores setups saved to one of the internal memory locations, or enables you to import a setup file.

Choose **File > Recall Setup...** from the menu bar or click the **Recall Instrument Setup** button on the main Save/Recall dialog.

Save/Recall	Save Waveform	Recall Waveform	Save Table	Save Setup	Recall Setup	Disk Utilities		CLOSE
			Recall From In	ternal Setup			Recall From File	
Recall	Setup1 18-Mar-2 NewNameforSet				Setup4 - Em Panel4	ıpty	Recall Panel From File	e ⊿Browse
	Setup2 - Empty Panel2				Setup5 - Em Panel5	ıpty	Recall Default Setup 0 → 麗	
	Setup3 - Empty Panel3				Setup6 - Em Panel6	ıpty	Recall Default	Recall Now!

Recall Setup from Memory

Touch one of the six Recall buttons under Recall From Internal Setup....



Note: If a setup has been stored to a location, it is labeled with the save date/time. Otherwise, the slot is labeled **Empty**.

Recall Setup from File

- 1. In **Recall panel from file**, touch **Browse** and navigate to the desired folder.
- 2. Select the setup file and touch **OK**.
- 3. On the Recall Setups dialog, touch Recall Now!

Save Waveforms

The Save Waveform function saves trace data to either an internal memory location, or to a text or binary format file (.trc). The source waveform can be any type of trace; a channel, math function, zoom, or even another memory. Use Recall Waveform to restore these previously saved waveforms to the display.

Note: Only files saved in binary format (.trc) can be recalled to the touch screen.

By default, trace files are saved to the D:\...\Waveforms folder on the instrument hard drive, although you can choose another location, such as a USB drive. The file name is autogenerated from the <source trace><trace title><number in sequence> (e.g., C1test000001).

Choose File > Save Waveform from the menu bar or click the Save Waveform button on the main Save/Recall dialog.



Save Waveform To Memory

1. Touch Memory.

Note: When Memory is selected, only Source and Destination controls are shown on the Save Waveform dialog. When File is selected, many more controls are available.

- 2. Choose the Source trace you are saving.
- 3. Choose the **Destination** location.
- 4. Touch Save Now!

Save Waveform To File

- 1. Touch File.
- 2. Choose the **Source** waveform.
- 3. Optionally, touch Trace Title to change the root file name of your waveforms.

Caution: Numbers you place at the end of this name are truncated because the instrument appends a sequence number to each file. Place numbers at the beginning, or place an alpha character after the number (e.g., XYZ32a).

- 4. Touch Data Format and select a file format:
 - **Binary**, Teledyne LeCroy's binary file format (.trc). Binary results in the smallest possible file size, and is necessary for recalling waveforms to Teledyne LeCroy instruments.



Note: Binary files can be converted to ASCII using Teledye LeCroy utilities such as ScopeExplorer or WaveStudio.

- **ASCII** text file (.txt extension).
- MATLAB text file (.dat extension).
- Excel text file (.csv extension).
- MathCad text file (.prn extension).
- Audio .wav file.
- 5. Depending on your file format selection, you may also need to specify a SubFormat:
 - Word (Binary) represents samples in the output file with 16 bits. Always use this options unless Byte mode is "pre."
 - **Byte** (Binary) represents samples in the output file with 8 bits. This option can result in a loss of output file resolution.
 - Auto (Binary) looks at the data and automatically selects either Word or Byte subformat.
 - Amplitude only (Text) includes amplitude data for each sample, but not time data.
 - Time and Amplitude (Text) includes both types of data for each sample.
 - With Header (Text) includes a file header with scaling information.
- 6. If you selected **ASCII** format, also touch **Delimiter** and select a delimiter character from the pop-up menu.
- 7. In Save Files in Directory, touch **Browse** and navigate to the desired location. Touch **OK**.

Tip: If the instrument is networked, you can touch on Save Files in Directory and enter the full Windows network address of another location in which to save the file. The instrument must have access to this directory.

8. On the Save Waveform dialog, touch Save Now!

Recall Waveforms

Use Recall Waveform to restore previously saved waveform files to the display.



Note: Only files saved in binary format (.trc) can be recalled to the touch screen.

Choose File > Recall Waveform from the menu bar or click the Recall Waveform button on the main Save/Recall dialog.

Save/Recall	Save Waveform	Recall Waveform	Save Table	Save Setup	Recall Setup	Disk Utilities			8	CLOSE
Recall Fro	m _I					Trace F	iles			
Memory File	, 	Destination Show On Recall		_All _D:Xstrea _F1unipro	m\Waveforms\	▲ Files From Direc Will Be Recalled 0'361 bytes)	Browse	•	ਵਾਂ → ਮੁਮ Recall Now!	

Recall Waveform From Memory

- 1. Touch Memory.
- 2. Touch **Source** and choose a memory location from the **Select Source** pop-up.
- 3. Touch **Destination** and select a location into which to open the recalled memory.
- 4. Mark Show on Recall to display the trace on the grid.
- 5. Touch Recall Now!

Recall Waveform From File

- 1. Touch File.
- 2. Touch **Recall files from directory** and enter the path to the waveform folder, or touch **Browse** and navigate to the folder.
- 3. Use the Up /Down Arrows to cycle through the available files until the desired file is selected.

Optionally, touch **Show only files** to apply a search filter (channels, math functions, or memory) to the list of available files.



Note: The filter only applies to the files that will appear in the "Next File Will Be Recalled From..." list. It does not impact the Browse function.

- 4. Mark Show on Recall to display the trace on the grid.
- 5. Touch Recall Now!

Save Table Data

The Save Table function saves tabular measurement data displayed on screen to an Excel or ASCII file. By default, files are saved in D:\...\Tables, although you can choose another location.

Access the **Save Table** dialog by choosing **File > Save Table** from the menu bar.

Save/Recall	Save Waveform Recall Waveform	Save Table Save Setup	Recall Setup	Disk Utilities	CLOSE
		Data Format		Auto Save (save on each new trigger)	Disk Space
	Source _All Displayed▲	Format ASCII			Size : Free :
	Table Title _Table	Delimiter Comma		Save Files In Directory Browse Next File Will Be Saved To: XXTable00000.bt	_n → ₩ Save Now!

- 1. Leave the default **Source** selection All Displayed.
- 2. Optionally touch **Table Title** and enter a new root file name.



Caution: Numbers you place at the end of this name are truncated because the instrument appends a sequence number to each file. Place numbers at the beginning, or place an alpha character after the number (e.g., XYZ32a).

- 3. Touch Data Format and choose from ASCII (.txt) or Excel (.csv) format.
- 4. If you selected **ASCII** format, also touch **Delimiter** and choose a character.
- 5. In Save Files in Directory, touch **Browse** and navigate to the desired folder. Select it and touch **OK**.



Tip: If the instrument is networked, you can touch Save Files in Directory and enter the full Windows network address of another location in which to save the file. The instrument must have access to this directory.

6. On the Save Table dialog, touch Save Now!

Auto Save

Data that appears on the oscilloscope display, such as waveforms, measurement readouts and decoder data, can be very dynamic and difficult to read from the oscilloscope unless you stop the acquisition.

The Auto Save enables you to automatically store waveform and table data to file with each new trigger. The file can later be recalled to the oscilloscope or saved permanently to external storage.

 \wedge

Caution: If you have frequent triggers, it is possible you will eventually run out of storage space. Choose Wrap only if you're not concerned about files persisting on the instrument. If you choose Fill, plan to periodically delete or move files off the instrument, or you will lose new data.

To disable this feature, choose Off.

By default, waveform files are stored in D:\Waveforms and tables are stored in D:\Tables on the instrument hard drive.

Utilities


<u>Utilities</u> settings primarily control the instrument's interaction with other devices/systems.

<u>Preferences</u> settings, on the other hand, tend to control the appearance and performance of the X-Stream application. Use these settings to personalize the behavior of the instrument.

<u>Disk Utilities</u> enable you to perform commonplace Windows file functions. They are also accessible from the File menu.

Utilities

To access the Utilities dialogs, choose Utilities > Utilities Setup... from the menu bar.

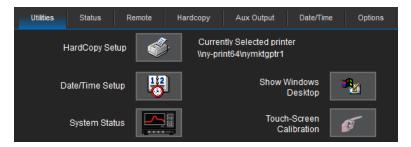

HardCopy Setup, Date/Time Setup, and System Status buttons open their corresponding dialogs, as do the tabs.

There are also tabs linking to <u>Remote Control</u>, <u>Auxilliary Output</u>, and <u>Options</u> settings.

Note: Hardcopy Setup controls the behavior of the Print function. The selected print output device or application is displayed to the right of the **HardCopy Setup** button for convenience.

Show Windows Desktop minimizes the X-Stream application window. Maximize the application by touching the display icon located at the lower-right of the desktop.

<u>Touch-Screen Calibration</u> launches a sequence of display calibration screens. You will be prompted through a series of actions to improve the precision and accuracy of the touch screen.

The **Service** button to the far right of the dialog launches a section of the application reserved for qualified Teledyne LeCroy service personnel. An access code is required to enter this section.

Status

The Utilities Status dialog displays information about your instrument including model number, serial number, firmware version, and installed hardware and software options.

Choose Utilities > Utilities Setup from the menu bar, then touch the Status tab.

Or

Choose **Support > About** from the menu bar.

Remote Control

The Remote dialog contains settings to configure remote control of the instrument and also network access. Supported remote control protocols are:

- **TCPIP (Ethernet)**. If you choose this option, also install Teledyne LeCroy's VICP drivers on the controller. These are included in the VICP Passport plug-in, available free from <u>teledynelecroy.com/support/softwaredownload</u> under Oscilloscope Downloads > Software Utilities. The instrument uses Dynamic Host Configuration Protocol (DHCP) as its default addressing protocol. You can assign a static IP address using the standard Windows network setup menus.
- LXI (Ethernet)
- **GPIB**. This selection is only active if the instrument has the GPIB hardware option installed. Connect the controller to the GPIB port.

Control from TCP/IP Security Remote Control Assistant Off TCP/IP Host Name : KPIERRO-NBW7 Restrict remote control to specified clients? Show Remote Control Log Off TCP/IP IP Address(s) : 172.28.12.198, 0.0.0, 0.0.0, No Yes Image: Control Log CPIB LXI (VXI11) Net No Yes Log Mode LSIB Connections Connections Image: Connection Show Remote Control Log	Utilities Status Remote	Hardcopy Aux Output Date/Time Options		😢 CLOSE
and clear at startup	Off TCPIP (VICP) GPIB LXI (VXI11)	Name : KPIERRO-NBW7 idress(s) : 172.28.12.198, 0.0.0.0, 0.0.0, Net	Restrict remote control to specified clients?	Show Remote Control Log Off Reset to Errors Only

Set Up Remote Control

- **Note:** Full remote control setup requires the installation and configuration of software on the controller, as well. These steps represent only what is done on the instrument. See the Remote Control manual for your model for an explantion of the complete process.
- 1. From the menu bar, choose Utilities > Utilities Setup, then touch the Remote tab.
- 2. On the **Remote** dialog, make a **Control From** selection.
- 3. If using TCPIP and wish to restrict controller privileges to specific network clients, touch **Yes** under Security. Enter the IP addresses or DNS names of the authorized controllers in a comma-delimited list.

Configure the Remote Control Assistant Event Log

The **Remote Control Assistant** monitors communication between the controller and instrument. You can log all events or errors only. The log can be output to an ASCII file and is invaluable when you are creating and debugging remote control programs.

- 1. From the menu bar, choose Utilities > Utilities Setup, then touch the Remote tab.
- 2. Under Remote Control Assistant, touch Log Mode and choose Off, Errors Only, or Full Dialog.
- 3. To always clear the log at startup, check Reset to Errors Only and clear at startup.

Export Contents of the Event Log

- 1. From the menu bar, choose **Utilities > Utilities Setup**, then touch the **Remote tab**.
- 2. Touch the **Show Remote Control Log** button. The Event Logs pop-up is shown.
- 3. Enter a log file name in **DestFilename**, or touch Browse and navigate to an existing file.




Note: New contents will overwrite the existing content; it is not appended.

4. Touch Export to Text File.

Hardcopy (Print)

Hardcopy settings control how the **Print** function behaves. Print captures an image of the touch screen display, but there are several options as to what it does next with the image, which is configured on the Utilities Hardcopy dialog. You can further set up a default print color scheme and capture area. A preview of your hardcopy setup appears to the right of the dialog.

From the menu bar, choose Utilities > Utilities Setup > Hardcopy to display the Hardcopy dialog.

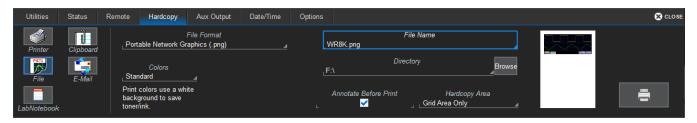

Send to Printer

Add Printer

- Note: Any printer compatible with the instrument's Windows OS is supported. Minimize the X-Stream application and use the Windows controls to install printer drivers. Connect printers via LAN (Ethernet) or USB.
- 1. On the Utilities Hardcopy dialog, choose Printer.
- 2. Touch the **Add Printer** button that appears. A Microsoft Windows Devices and Printers window opens where you can configure a new printer.
- 3. To make the printer the instrument default, select it from the Select Printer list.

Print Setup

- 1. On the Hardcopy dialog, choose Printer.
- 2. Touch **Select Printer** and choose a printer from the list. If you don't see the printer you want, first follow steps to Add Printer.
- 3. Choose a page **Orientation**: portrait or landscape.

- 4. Optionally, choose a color scheme and hardcopy (print) area.
- 5. Optionally, touch **Properties** to open the Windows print dialog and adjust printer properties.

Print to File

Image files can be saved to any folder on the instrument hard drive, or to an external drive connected to a USB port.

- 1. On the Hardcopy dialog, choose File.
- 2. Choose the output **File Format**.
- 3. Enter a File Name. This will form the basis of all print filenames, until you change it.

Numbers you place at the end of the filename will be truncated, as the instrument appends a sequence number to this name with each new file. If you wish to add your own identifying numbers, place them at the front of the name.

4. Optionally, enter the path to a new save **Directory**, or touch the **Browse** button and navigate to the folder.



Note: The default print folder is D:\Hardcopy. Other types of files that may be saved using other functions, such as masks and scripts, have their own X-Stream subfolders.

5. Optionally, choose a color scheme and hardcopy (print) area.

Copy to Clipboard

This procedure copies the screen to the clipboard so you can paste it into another application (Microsoft Word, for example).

- 1. On the Hardcopy dialog, choose **Clipboard**.
- 2. Optionally, choose a color scheme and hardcopy (print) area.

Send to E-Mail

Follow this procedure to e-mail capture files to a preset address. The e-mail connection is set up in **Utilities > Preferences Setup > E-Mail.**

- 1. On the Hardcopy dialog, choose E-Mail.
- 2. Choose the output File Format.
- 3. If you wish to be able to include messages with the files as they are sent, check **Prompt for message to send with mail**.
- 4. Optionally, choose a color scheme and hardcopy (print) area.
- 5. To go on and <u>set up the e-mail connection</u>, touch **Configure E-Mail Server and recipient**.

Create LabNotebook Entry

- 1. On the Hardcopy dialog, choose LabNotebook.
- 2. Touch <u>LabNotebook Preferences</u> and set up your notebook preferences.

Choose Print Color Scheme

To change the color of your print output, touch the **Color** button on the Hardcopy dialog and choose from:

- Standard (default) prints objects on a black background, as they appear on the display.
- Print prints objects on a white background using your chosen colors. This option saves ink.
- Black & White prints objects in grayscale.

Note: The colors used to represent channels in Standard and Print schemes are configured on the <u>Preferences Colors</u> dialog.

Set Print Area

To limit which part of the touch screen is captured, touch **Hardcopy Area** on the Hardcopy dialog and choose from:

- Grid Area Only omits dialogs and menus and prints only the grids.
- **DSO Window** prints the dialogs with the grids.
- Full Screen prints the entire touch screen.

Drawing Tools

To open the drawing toolbar for mark up as each new capture is saved, select Annotate Before Print.

Auxiliary Output

Use the Aux Output dialog to configure the output of the Aux Out port.

Utilities Status Remote Hardcopy Aux Output	Date/Time Options		🙁 CLOSE
Use Auxiliary Output For Trigger Trigger Pass Enabled Ut Pass Fail Fail Fail	Use Calibration Output For Image: Square DC Level Image: Off Off	Amplitude into 1MOhm Frequency 1.000 V1.00 kHz Set to 1KHz, 1V Square Wave	

Auxiliary Output

Trigger Enabled sends a pulse when the trigger is ready (Ready indicator lit), but not necessarily triggered. It can be used as a gating function to trigger another instrument. Enter the desired pulse **Amplitude**.

Trigger Out sends a pulse upon a trigger (TRIG'D Indicator lit). Enter the desired pulse **Amplitude**.

Pass/Fail generates a pulse when Pass/Fail testing is active and conditions are met. Enter the desired **Pulse Duration**.

Fast Edge provides a fast edge signal that can be used to deskew multiple channels.

Off disables auxiliary input/output.

Calibration Output

Choose the signal to be output from the Cal Out hook on the front of the instrument:

- Square wave signal. Enter the wave Frequency and Amplitude into 1 MΩ, or choose to Set to 1 kHz, 1 V Square Wave.
- Reference DC Level. Enter an Amplitude into 1 M Ω .

Off disables calibration output.

Date/Time

Date/Time settings control the instrument's timestamp. These numbers appear in the message bar and on tables/records internal to the X-Stream application, such as History Mode and WaveScan.

To access the Date/Time dialog, choose **Utilities > Utilities Setup** from the menu bar, then touch the **Date/Time tab**.

Utilities	Status	Remote	Hardcopy Aux O	utput Date/Time	Options		🗙 CLOSE
Current			Wednesday, March 18	8, 2015 12:55:48 PM			
12	lour Day	Minute 55 Month 3	Second 25 Year 2015	Validate Change 		Set from Internet Set the system date/time from the internet time server at time-a.nist.gov (requires internet connection)	Present Windows Date/Time configuration page. Use this to set timezone and enable daylight savings time.

Manual Method

Enter the Hour, Minute, Second, Day, Month, and Year, then touch the Validate Changes button.

Internet Method

This method uses the Simple Network Time Protocol (SNTP) to read the time from time-a.nist.gov. The instrument must be connected to an internet access device through a LAN (Ethernet) port.

If your connection is active, touch the **Set from Internet** button.

Windows Method

To set date and time using the internal Windows system clock, touch the **Windows Date/Time** button. This displays the standard Windows **Date and Time Properties** pop-up dialog, where you can further configure these settings. If you are satisfied with the setup, just touch OK.

Options

Many optional software packages are available to extend the Analysis functions of the instrument. When you purchase an option, you will receive a key code by email that activates the new functionality. Use the **Options** dialog to activate software options by installing the key code. This dialog also displays the **ScopelD** and **Serial** #.

To install a key:

1. From the menu bar, choose **Utilities > Utilities Setup**, then touch the **Options tab**.

Utilities Status Remote Hardcopy Aux Output Date/Time	Options	🔀 CLOSE
ScopeID : 11ae95-6d Serial # : KPIERRO-NBW7 For information on Software Options contact your local LeCroy Sales/Service organization or visit our web site at http://www.teledynelecroy.com/options	Reset Masked Options Installed Option K 39FD-9722-8FE8-0F06 895A-EEC4-33F0-4BF8 77E4-87F2-0249-67CA RA65-50F6-3556-5E1D RF33-247FE-7445-2642 Installed Option K Key Enables Options : PWR_ANALYSIS PWR_ANALYSIS	Add Key

- 2. Touch Add Key. The Virtual Keyboard appears onscreen.
- 3. Use the VIrtual Keyboard to type the Key Code in the **Enter Option Key** field, then touch **O.K.** on the keyboard to enter the information.

The Key Code is added to the list of Installed Option Keys. You can use the Up/Down buttons to scroll the list. The software option that each key activates is displayed below the list.

4. Restart the X-Stream application: choose **File > Shutdown**, then double-click the **Start DSO** icon on the desktop.

Disk Utilities

Use the Disk Utilities dialog to manage files and folders on your instrument's hard drive. Disk Space information is shown at the far right of the dialog for convenience.



Note: These tasks can also be accomplished using the standard Microsoft Windows file management tools. Choose **File > Minimize** to access the Windows desktop and task bar.

Access the **Disk Utilities** dialog by selecting **Utilities > Disk Utilities** from the menu bar, or choose any of the Save/Recall functions and open the Disk Utilities tab.



Delete a Single File

- 1. Touch the **Delete** button.
- 2. Browse to the current folder containing the file.
- 3. **Browse** to the file to be deleted, or use the **Up** and **Down** arrow buttons to scroll through the files in the folder.
- 4. With the desired file selected, touch **Delete File**.

Delete All Files in a Folder

- 1. Touch the **Delete** button.
- 2. Browse to the current folder containing the file.
- 3. With the desired folder selected, touch **Empty Folder**.

Create a New Folder

- 1. Touch Create.
- 2. Touch **Current folder** and provide the full path to the new folder, including the folder name.
- 3. Touch Create Folder.

Preferences

Preference settings have mostly to do with the appearance and performance of the instrument itself, rather than its interaction with other devices/systems.

To change LabNotebook application preferences, see <u>LabNotebook Preferences</u>.

Access the Preferences dialogs by choosing **Utilities > Preference Setup...** from the menu bar.

Preferences Calibration Acquis	sition E-Mail Color	Miscellaneous		🙁 CLOSE
Audible Feedback	Language	Font Size	Performance	
	Language	Text Size	Optimize For :	
✓ Enable	English 4	Default	Analysis 🖏 🐝 📼 🔲 Display	
Enables audible feedback of Touch-Screen Activity.	۵.		If display update rate is your primary concern, optimize for Display. If Acquisition and Analysis performance is your primary concern, select Analysis.	

Audible Feedback controls the instrument's audio output. Select this box to hear a beep each time you touch a screen or front panel control.

Language sets the language used on the touch screen display.

Font Size changes the size of the text that appears on the touch screen display.

Performance settings let you optimize performance for either **Analysis** (speed of acquisition and calculation) or **Display** (speed of update/refresh). For example, if you are concerned with persistence or averaging, you might optimize for Analysis, giving higher priority to waveform acquisition at the expense of display update rate. Choices are presented as a spectrum.

There are also tabs linking to <u>Calibration</u>, <u>Acquisition</u>, <u>E-Mail</u>, <u>Color</u>, and <u>Miscellaneous</u> settings.

Acquisition Preferences

The Acquisition preference settings determine how traces behave as Vertical Offset or Horizontal Delay changes. To access them, choose **Utilities > Preference Setup** and open the **Acquisition** dialog.

Preferences Calibration Acquisition E-Mail C	olor Miscellaneous	S CLOSE
Offset Setting Constant In:	Delay Setting Constant In:	Trigger Counter Setting:
Volts On Vertical Scale changes, the offset setting can be constant in either divisions or in absolute volts.	On Horizontal Scale changes, the delay setting can be constant in either divisions or in Div	Reset trigger counter before starting a new acquisition.

Offset Setting constant in:

- Volts moves the Vertical Offset level indicator with the actual voltage level.
- **Div**(isions) keeps the Vertical Offset level indicator stationary. The waveform remains on the grid as you increase the gain; whereas, if Volts is selected, the waveform could move off the grid.

Delay Setting constant in:


- Time moves the Horizontal Delay indicator relative to the 0 point at the center of the grid.
- **Div**(isions) keeps the Horizontal Delay indicator stationary. The trigger point remains on the grid as you increase the timebase; whereas, if Time is selected, the trigger point could move off the grid.
- **Note:** The Offset value is always in the vertical unit, and the Delay is always in time. However, whenever Div is selected, these values are scaled proportional to the change in gain or timebase, thereby keeping the division of the grid constant.

Reset trigger counter before starting a new acquisition is selected by default. It clears the trigger counter each time a new acquisition command is sent. It is only made active for deselection when trigger Holdoff is set.

Calibration

Calibration ensures that the output from the analog-to-digital converters (ADCs) accurately represents the input. The instrument is calibrated at the factory prior to shipment. So that it maintains specified performance, it is factory set to perform an automatic calibration routine upon start-up and whenever conditions warrant it, based on your automatic calibration selection.

Warm up the oscilloscope for at least 10 minutes prior to use to give the instrument time to complete the automatic calibration procedure. You will see a warning message on the Calibration dialog when the oscilloscope is still in the warm-up phase.

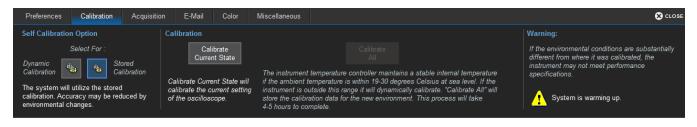

Automatic Calibration

You have the option of selecting the automatic calibration routine used. Go to **Utilities > Preference Setup > Calibration**.

Stored Calibration (the default selection) uses cached calibration files to recalibrate the instrument at start-up. As long as the oscilloscope is used at or near sea level within a temperature range of 19-30 °C, this calibration routine should be sufficient to maintain specified performance. The instrument will dynamically recalibrate if the temperature goes outside of the stored calibration range. If you know you will be operating outside this temperature range, do a Calibrate All to minimize recalibration.

The **Dynamic Calibration** routine recalibrates the oscilloscope at start-up and every time there is a change in any of the acquisition settings that directly affect the performance of the ADCs, in particular Vertical Scale, Coupling, Bandwidth, Attenuation, and Horizontal Scale. This can cause interruptions during operation, but ensures absolute accuracy within the current operating environment at every setting. When one setup is calibrated at a particular ambient temperature, the calibration is entered in a calibration table and reused for the duration of the session, so that over time the frequency of recalibration decreases. These calibration entries persist only for a single session; Dynamic Calibration restarts when the instrument is restarted or you change the principal acquisition settings.

Manual Calibration

Two manual calibration routines can be used to recalibrate immediately before sensitive measurements or when there is a significant change of environmental characteristics that could affect the performance of the ADCs.

Go to Utilities > Preference Setup > Calibration to manually invoke calibration.

Caution: Remove all inputs from the oscilloscope prior to manual calibration.

Calibrate Current State calibrates at the current vertical and horizontal settings. This calibration takes 5 seconds but is valid *for only this setup* at the current temperature ±2.5 °C.

Calibrate All calibrates all possible combinations of vertical and horizontal settings. This calibration is valid for the current temperature and takes about four to five hours. Perform it when the ambient temperature is stable from the time of calibration to the time of operation.

We recommend that you run Calibrate All when:

• The instrument is operating outside the 19-30 °C range and the operating temperature changes while outside that range. Calibrate All is only valid for \pm 2.5 °C of the last calibration

temperature when operating outside of the 19-30 °C range.

- The instrument is moved to a new operating environment.
- It has been six months since the previous manual calibration.

E-Mail

Use the E-mail dialog settings to configure e-mail on the instrument.

Preferences Calibration	Acquisition E-Mail Color Miscellaneous	😪 close
E-Mail Server	Configuration	Overview of E-Mail modes
MAPI SMTP	SMTP Server domino lecroy.com Originator Address (From:) myXStreamDSO@lecroy.com Default Recipient Address (To:) myname@myprovider.com	MAPI uses the default Windows E-Mail application (usually Outlook Express). SMTP uses a Simple Mail Transfer Protocol server directly. In many cases no account is required. Send Test Mail

Under E-Mail Server, select the protocol used by your network:

- MAPI (Messaging Application Programming Interface) is the Microsoft interface specification that allows different messaging and workgroup applications (including e-mail, voice mail, and fax) to work through a single client, such as the Exchange client. MAPI uses the default Windows e-mail application.
- **SMTP** (Simple Mail Transfer Protocol) is a TCP/IP protocol for sending messages from one computer to another through a network. This protocol is used on the Internet to route e-mail. In many cases no account is needed.

Under Configuration:

- If you chose SMTP, touch **SMTP Server** and enter the network address of your mail server.
- Touch Originator Address (From:) and enter the instrument's e-mail address.
- Touch Default Recipient Address (To:) and enter the recipient's e-mail address.

Use Send Test Mail to send a confirmation message to ensure proper e-mail configuration.

Color

Color dialog settings assign the colors used for channel, math, and memory traces. All dialogs, tables, and trace descriptor boxes will match the color of the trace assigned here. You can choose different colors to be used on the instrument and in print.

For convenience, you can **Preview print colors** to see how the settings will appear in print output.

Note: Print colors are used only when the Colors control is set to Print on the Hardcopy dialog in **Utilities > Utilities Setup...**. Otherwise, the Screen colors are used for print output as well as on screen.

Pref	erences Ca	libration A	cquisition	E-Mail	Color	Miscellaneo	ous					CLOSE
	Chann Screen	els Print		Screen	l Print	Math Traces	Screen	Print		Memory Screen	Traces Print	Print color is used when the 'Use Print Colors' option
C1			F1			F5			M1			is enabled in the Hardcopy Setup menu. This allows colors to appear the same when printed
C2 C3			F2 F3			F6 F7			M2 M3			on white paper to save ink/toner.
C4			F4			F8			M4			Factory Preview default colors print colors

To make any setting, just touch the color swatch for either Screen or Print next to the trace number, and make a selection from the Color pop-up menu.

Touch Factory default colors to recall the original color settings for your instrument.

Miscellaneous

These other Preference settings are located on the Miscellaneous dialog.

Preferences Calibration Acquisition E-Mail	Color Miscellaneous	😵 CLOSE
Hardcopy	Zoom	Serial Decode
Print Teledyne LeCroy Logo When Printing Grid Area Only	Dimming On Control Sensitivity Optimized	Annotations Position On Trace Security Enable HTTP Screen Capture

To add the Teledyne LeCroy logo to print output, check **Print Teledyne LeCroy Logo When Printing Grid Area Only**. This identifies the instrument as the source of the image.

You can adjust zoom behavior as follows:

- **Dimming** darkens/shades those areas of the source waveform that are not part of the Zoom trace.
- **Control Sensitivity** adjusts the sensitivity of the front panel knobs. **Optimized** applies an acceleration algorithm to the knobs. **Legacy** detects rotation of the front panel knobs in a manner similar to our legacy oscilloscopes.

Serial Decode Annotation Position: If you have Serial Trigger or Decode options installed on your instrument, this control determines the placement of annotation labels relative to the trace line. It does not appear if there are no installed options.

- On Trace places the label close to the line.
- **On Noisy Trace** sets the label further from the line to accommodate potential noise spikes in the trace.

Check **Enable HTTP Screen Capture** to enable remote capture of the touch screen display over a netowrk. This setting is required to use the instrument with the WaveStudio software.

Maintenance

Topics in this section describe procedures for keeping the instrument in optimal working condition.

Touch Screen Calibration

Periodically calibrate the touch screen to maintain its accuracy and responsiveness. We recommend that you use a stylus rather than your finger for this procedure.

- 1. From the menu bar, choose Utilities > Utilities Setup.
- 2. On the Utilities main dialog, touch Touch-Screen Calibration.
- 3. Following the prompts, touch as close as possible to the center of each cross that appears on the screen until the calibration sequence is complete.

Restart/Reboot Instrument

To restart the oscilloscope application, choose **File > Exit** from the menu bar, then touch the **Start DSO** desktop shortcut.



Note: You will generally need to exit and restart the application after adding new options keys.

To reboot the instrument, which includes restarting the OS:

- 1. From within the oscilloscope application, choose **File > Shutdown** from the menu bar. From the Windows desktop, use the Windows Start Menu Shutdown command.
- 2. Wait 10 seconds, then press the **Power button** on the front of the instrument.

Firmware Update

Teledyne LeCroy frequently releases free oscilloscope firmware updates containing new product features and bug fixes. The installer updates multiple components including the base application, required DLLs, drivers, and low-level microcode for integrated circuits.

The firmware update procedure *does not* modify or delete any saved panel setups, waveforms, screen captures, calibration constants, or other data stored on the D: drive.



Caution: The installation may take several minutes, depending on the length of time since your last update. **Do not power down at any point during the installation process.**

- 1. Exit the X-Stream application by choosing File > Exit.
- Visit our download page at <u>teledynelecroy.com/support/softwaredownload</u> and click the link to Oscilloscope Downloads > Firmware Upgrades.
- 3. Select your **series** and **model number**.
- 4. Enter your registration login information, or create a new account.
- 5. Click the **download** link, and choose to **Save** the installer to the instrument Desktop or a folder on the D: drive. If downloading from a remote PC, save the installer to a USB storage device to transfer it to the instrument.
- 6. Browse to the location of the installer (xstreamdsoinstaller_x.x.x.x.exe) and double-click it to launch the X-Stream Setup wizard.
- 7. On the wizard, click **Next**, then read the EULA and click **I Agree**.
- 8. Leave the default installation (recommended), or select individual components:
 - Drivers for GPIB1 required for internal PCI-GPIB card.
 - MATLAB MCR required for sampling scopes, QPHY-USB and QPHY-Broad-R-Reach.
 - X-Stream DSO, DSO Device drivers, Upgrade DSO Microcode required for a version upgrade.
 - Touch Screen Driver required to use the display as a touch screen (you can opt to use a mouse).
 - SPARQ Package required to drive a connected SPARQ from the instrument.

Click Install when done.

- 9. If you receive Windows security warnings, **trust** and **Install** the file. If you see the Hardware Programmers screen, accept all code installations, then click **Close** to return to the X-Stream Setup wizard.
- 10. When installation is complete, choose **Reboot now** and click **Finish**.

Technical Support

Phone

Registered users can contact their local Teledyne LeCroy service center at the number listed on our website.

Web

Teledyne LeCroy publishes a free Technical Library on its website. Manuals, tutorials, application notes, white papers, and videos are available to help you get the most out of your Teledyne LeCroy products.

The Datasheet published on the product page contains the detailed product specifications.

You can also submit Technical Support requests via the website at <u>teledynelecroy.com/support/techhelp.</u>

Service Centers

For a complete list of offices by country, including our sales & distribution partners, visit:

teledynelecroy.com/support/contact

Teledyne LeCroy 700 Chestnut Ridge Road Chestnut Ridge, NY, 10977, USA teledynelecroy.com

Sales and Service: Ph: 800-553-2769 / 845-425-2000 FAX: 845-578-5985 contact.corp@teledynelecroy.com

Support: Ph: 800-553-2769 customersupport@teledynelecroy.com

Returning a Product for Service

Contact your local Teledyne LeCroy service center for calibration or other service. If the product cannot be serviced on location, the service center will give you a **Return Material Authorization (RMA) code** and instruct you where to ship the product. All products returned to the factory must have an RMA.

Return shipments must be prepaid. Teledyne LeCroy cannot accept COD or Collect shipments. We recommend air-freighting. Insure the item you're returning for at least the replacement cost.

- 1. Remove all accessories from the device. Do not include the manual.
- 2. Pack the product in its case, surrounded by the original packing material (or equivalent).
- 3. Label the case with a tag containing:
 - The RMA
 - Name and address of the owner
 - Product model and serial number
 - Description of failure or requisite service
- 4. Pack the product case in a cardboard shipping box with adequate padding to avoid damage in transit.
- 5. Mark the outside of the box with the shipping address given to you by Teledyne LeCroy; be sure to add the following:
 - ATTN: <RMA code assigned by Teledyne LeCroy>
 - FRAGILE
- 6. If returning a product to a different country:
 - Mark the shipment as a "Return of US manufactured goods for warranty repair/recalibration."
 - If there is a cost for the service, list the cost in the Value column and the original purchase price "For insurance purposes only."
 - Be very specific about the reason for shipment. Duties may have to be paid on the value of the service.

Extended warranty, calibration, and upgrade plans are available for purchase. Contact your Teledyne LeCroy sales representative to purchase a service plan.

Certifications

Teledyne LeCroy certifies compliance to the following standards as of the time of publication. See the *EC Declaration of Conformity* document shipped with your product for the current certifications.

EMC Compliance

EC Declaration of Conformity- EMC

The instrument meets the intent of EC Directive 2014/30/EU for Electromagnetic Compatibility. Compliance was demonstrated to the following specifications listed in the Official Journal of the European Communities:

EN 61326-1:2013, EN 61326-2-1:2013 EMC requirements for electrical equipment for measurement, control, and laboratory use. ¹

Electromagnetic Emissions:

EN 55011:2010, Radiated and Conducted Emissions Group 1, Class A ²³

EN 61000-3-2/A2:2009 Harmonic Current Emissions, Class A

EN 61000-3-3:2008 Voltage Fluctuations and Flickers, Pst = 1

Electromagnetic Immunity:

EN 61000-4-2:2009 Electrostatic Discharge, 4 kV contact, 8 kV air, 4 kV vertical/horizontal coupling planes ⁴

EN 61000-4-3/A2:2010 RF Radiated Electromagnetic Field, 3 V/m, 80-1000 MHz; 3 V/m, 1400 MHz - 2 GHz; 1 V/m, 2 GHz - 2.7 GHz

EN 61000-4-4/A1:2010 Electrical Fast Transient/Burst, 1 kV on power supply lines, 0.5 kV on I/O signal data and control lines $^{\rm 4}$

EN 61000-4-5:2006 Power Line Surge, 1 kV AC Mains, L-N, L-PE, N-PE ⁴

EN 61000-4-6:2009 RF Conducted Electromagnetic Field, 3 Vrms, 0.15 MHz - 80 MHz

EN 61000-4-11:2004 Mains Dips and Interruptions, 0%/1 cycle, 70%/25 cycles, 0%/250 cycles 45

- 1. To ensure compliance with all applicable EMC standards, use high quality shielded interface cables.
- 2. Emissions which exceed the levels required by this standard may occur when the instrument is connected to a test object.
- 3. This product is intended for use in nonresidential areas only. Use in residential areas may cause electromagnetic interference.
- 4. Meets Performance Criteria "B" limits of the respective standard: during the disturbance, product undergoes a temporary degradation or loss of function or performance which is self-recoverable.
- 5. Performance Criteria "C" applied for 70%/25 cycle voltage dips and 0%/250 cycle voltage interruption test levels per EN61000-4-11.

European Contact:*

Teledyne LeCroy Europe GmbH Im Breitspiel 11c D-69126 Heidelberg Germany Tel: + 49 6221 82700

Australia & New Zealand Declaration of Conformity- EMC

The instrument complies with the EMC provision of the Radio Communications Act per the following standards, in accordance with requirements imposed by Australian Communication and Media Authority:

AS/NZS CISPR 11:2011 Radiated and Conducted Emissions, Group 1, Class A.

AUSTRALIA / NEW ZEALAND CONTACTS:*

RS Components Pty Ltd.	RS Components Ltd.
Suite 326 The Parade West	Unit 30 & 31 Warehouse World
Kent Town, South Australia 5067	761 Great South Road
	Penrose, Auckland, New Zealand

*Visit teledynelecroy.com/support/contact for the latest contact information.

Safety Compliance

EC Declaration of Conformity- Low Voltage

The instrument meets intent of EC Directive 2014/35/EU for Product Safety. Compliance was demonstrated to the following specifications as listed in the Official Journal of the European Communities:

EN 61010-1:2010 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 1: General requirements

EN 61010-2:030:2010 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits

The design has been verified to conform to the following limits put forth by these standards:

- Mains Power Supply Circuits: Overvoltage Category II, instrument intended to be supplied from the building wiring at utilization points (socket outlets and similar).
- Measuring Circuit Terminals: No rated measurement category. Terminals not intended to be directly connected to the mains supply.
- Unit: Pollution Degree 2, operating environment where normally only dry, non-conductive pollution occurs. Temporary conductivity caused by condensation should be expected.

U.S. Nationally Recognized Agency Certification

The instrument has been certified by Underwriters Laboratories (UL) to conform to the following safety standard and bears UL Listing Mark:

UL 61010-1 Third Edition – Safety standard for electrical measuring and test equipment.

Canadian Certification

The instrument has been certified by Underwriters Laboratories (UL) to conform to the following safety standard and bears cUL Listing Mark:

CAN/CSA-C22.2 No. 61010-1-12. Safety requirements for electrical equipment for measurement, control and laboratory use.

Environmental Compliance

End-of-Life Handling



The instrument is marked with this symbol to indicate that it complies with the applicable European Union requirements to Directives 2012/19/EU and 2013/56/EU on Waste Electrical and Electronic Equipment (WEEE) and Batteries.

The product is subject to disposal and recycling regulations that vary by country and region. Many countries prohibit the disposal of waste electronic equipment in standard waste receptacles. For more information about proper disposal and recycling of your Teledyne LeCroy product, please visit teledynelecroy.com/recycle.

Restriction of Hazardous Substances (RoHS)

This instrument and its accessories conform to the 2011/65/EU RoHS2 Directive.

ISO Certification

Manufactured under an ISO 9000 Registered Quality Management System.

Warranty

THE WARRANTY BELOW REPLACES ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS, OR ADEQUACY FOR ANY PARTICULAR PURPOSE OR USE. TELEDYNE LECROY SHALL NOT BE LIABLE FOR ANY SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, WHETHER IN CONTRACT OR OTHERWISE. THE CUSTOMER IS RESPONSIBLE FOR THE TRANSPORTATION AND INSURANCE CHARGES FOR THE RETURN OF PRODUCTS TO THE SERVICE FACILITY. TELEDYNE LECROY WILL RETURN ALL PRODUCTS UNDER WARRANTY WITH TRANSPORT PREPAID.

The product is warranted for normal use and operation, within specifications, for a period of three years from shipment. Teledyne LeCroy will either repair or, at our option, replace any product returned to one of our authorized service centers within this period. However, in order to do this we must first examine the product and find that it is defective due to workmanship or materials and not due to misuse, neglect, accident, or abnormal conditions or operation.

The instrument's firmware has been thoroughly tested and is presumed to be functional. Nevertheless, it is supplied without warranty of any kind covering detailed performance.

Teledyne LeCroy shall not be responsible for any defect, damage, or failure caused by any of the following: a) attempted repairs or installations by personnel other than Teledyne LeCroy representatives or b) improper connection to incompatible equipment, or c) for any damage or malfunction caused by the use of non-Teledyne LeCroy supplies. Furthermore, Teledyne LeCroy shall not be obligated to service a product that has been modified or integrated where the modification or integration increases the task duration or difficulty of servicing the instrument. Spare and replacement parts, and repairs, all have a 90-day warranty.

Products not made by Teledyne LeCroy are covered solely by the warranty of the original equipment manufacturer.

Intellectual Property

All patents pertaining to the HDO9000 can be found on our website at:

teledynelecroy.com/patents/

Windows License Agreement

The oscilloscope application software runs on a Windows® operating system. Teledyne LeCroy's agreement with Microsoft® prohibits users from installing third-party software that is not relevant to measuring, analyzing, or documenting waveforms.

Index

Α	sample 55			
acquisition	color 141, 162			
optimiztion 158	compliance 168			
pre-processing 18, 40	cooling 2			
sampling mode 47	copy function 111			
settings 159	coupling 10, 18, 39			
action toolbar 20, 94	cursor 80-81			
activating traces 27	controls 82			
altitude 2	readout 19, 80			
analog inputs 10	custom measurements 86			
attenuation 10	D date and time 155			
auto save 144, 147	de-embedding 10, 41			
auto zero 41	degauss 41 delay 47, 159 post-trigger 48			
AUX connectors 14, 154				
averaging 18, 40, 110, 112				
B	pre-trigger 47			
backup 139, 142, 144, 147	descriptor box 16-17, 27			
bandwidth limiting 18, 39	deskew 18, 40			
C cable de-embedding 41	deskew r8, 40			
calibration 2, 12, 154, 167	dialogs 19			
Cascaded 66	differential time measurements 106			
channel 38				
descriptor box 18	display 13, 73			
frequency 10	controls 74, 163			
setup 39	extended 13, 75			
cleaning 2	grid 16, 76			
clock	optimization 158			
external 55	persistence 78			

reference 55

DisplayPort 13 Ε e-mail 136, 151, 161 EC compliance 168 EMC 168 enhanced resolution 40, 112 extended display 13 external monitor 13 external trigger 10 F FFT 115 file structure 157 filtering bandwidth 39 LabNotebook entries 136 measurements 87 noise 40, 112 firmware 12 update 165 version 149 Flashback Recall 134, 138 foreground trace 27 frequency 112 response 10, 115 front panel 163 G gain 39, 159 gating measurements 86 **GPIB** 150 graphing measurements 94

grid 16, 58, 73 auto grid 73 intensity 76 style 73, 76 н hard drive 139, 157 hardcopy settings 151 histograms 85, 94, 96 WaveScan 129 holdoff 67 horizontal controls 47 humidity 2 L import .trc files 146 Labnotebooks 139 setup panels 143 inputs analog 10 intensity grid 76 interfaces 10 interleaving 48, 51 interpolation 40, 116 inversion 18, 41 IP address 13, 150 L labelling traces 30, 134-135 LabNotebook 16, 134-136, 138-141

language selection 14	memory length 48
logs	multi-grid display 73
remote control event 150	multi-stage triggers 65
M	multi-zoom 31
markers 85	N
mask testing 130	notebooks 134, 136, 139
math 107, 109	O offset 159
descriptor box 18	operating environment 2
function setup 108	optimization 158
graphing 109	options 12, 156
on parameters 89	P
operators 108	parameter compare 130, 132
measurements 83, 104-106	parameter math 89
cursors 80	pass/fail testing 130, 132-133
custom 86	persistence 78
filtering 87	histogram 96
gating 86	WaveScan 128
graphing 94, 98-99	position
histicons 85	trace 31
list of 100	post-trigger delay 48
markers 85	power
pass/fail testing 130, 132	standby 12
processing web 90	pre-processing 18
readouts 83	pre-trigger delay 47
saving 147	preferences 158
statistics 84	printing 13, 35, 136-137, 151, 163
measurements; status 83	probes 10
memory 122-123	settings 41
descriptor box 18	tip selection 41

processing web editor 90 sampling mode 47 real-time 51 0 Q-Scape display 73-74 **RIS 51** gualified measurements 87 roll 51 qualified trigger 65 sequence 52 R save real-time sampling mode 51 data 134, 147 recall LabNotebooks 139 LabNotebooks 138 setup panels 134, 142 setup panels 143 waveforms 122, 144 waveforms 146 screen capture 35, 151 reference clock 55 search 124, 136 remote control 13, 150, 163 sequence sampling mode 52, 77 reports 134, 137, 140-141 serial triggers 163 rescaling 40, 118 service 166-167 restart/reboot 164 setup panels 134, 142-143 restore sin x 18, 40 waveforms 123 software assisted trigger 70 returns 167 software options 12, 156 RH 2 sound 158 RIS sampling mode 51 sparse function 117 rise and fall time 105 support 166-167 RoHS 170 system roll sampling mode 51 hibernate 12 S safety 1, 169 on/off 12 sample clock 55 status 149 sample points 48, 117 timestamp 155 sample rate 48, 51 т technical support 166-167

temperature 2	delay 47		
time parameters 105	descriptor box 19		
timebase 47, 159	holdoff 67		
clock 55	software assisted 70		
controls 47	time 51, 67		
descriptor box 19	TriggerScan 71		
top and base 104	U UL compliance 169		
touch screen 13, 15			
calibration 164	undo 16		
language 14	units 40, 118		
traces	utilities 149		
3D 79	V vertical 38		
activating 28	controls 39		
color 162	offset 39		
copy 111,122	resolution 112		
descriptor boxes 17	sensitivity 38-39		
label 30, 85, 134-135	W		
line style 77	waveform files 122, 144, 146		
persistence 78	WaveScan 124		
recall 134, 146	WaveStudio 163		
save 134, 144	WEEE 170		
turn on/off 28	Windows		
track 94, 97-98	dialogs 14		
TRC files 122, 144, 146	networking 13, 142, 145, 147		
trend 94, 97, 99	power settings 12		
trigger 58	X XWEB 90		
automating 71	XY plots 77		
controls 58, 60, 67			
counter 67, 159			

Z zoom 25, 28, 31 controls 31, 163 descriptor box 18 multi-zoom 31 undo 16



700 Chestnut Ridge Road Chestnut Ridge, NY 10977 USA

teledynelecroy.com